

2001 Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
Маркировка	2	0(-)	1













2002 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	X	-
Маркировка	0	1	0

2003 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	X	X
5 – 6	-	X	-
7 – 8	X	-	-
Маркировка	3	1	2

2004 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
Маркировка	2	0	1

2006 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	-
Маркировка	0	1	2

2008 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	X	X	-
Маркировка	3	1	2



2009 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	X	-	-
3 - 4	-	-	X	X	X
5 - 6	-	X	X	-	-
7 - 8	-	-	X	X	-
Маркировка	4	5	1	2	3













2010 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 - 2	-	X	X
3 - 4	X	X	-
5 - 6	-	-	X
7 - 8	-	X	-
Маркировка	3	1	2

2012 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	-	-	-
3 - 4	X	X	-	-	-
5 - 6	X	-	-	X	-
7 - 8	X	-	-	X	-
Маркировка	2	3	0	1	0

2013 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	X	-
5 - 6	-	X	-
Маркировка	3	1	2

2014 Соединяемые контакты	Способ фиксации: Б, И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	X	-
3 - 4	-	X
5 - 6	X	-
7 - 8	-	X
Маркировка	1	2

2015 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	X	-
5 - 6	X	-	-
7 - 8	-	X	-
Маркировка	3	1	2



2016 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	X
Маркировка	0	1	2


2017 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	-	X	X
Маркировка	3	1	2

2018 Соединяемые контакты	Способ фиксации: А		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X


2020 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-	-
3 – 4	-	-	-	X	-
5 – 6	-	-	-	-	X
7 – 8	-	-	X	X	X
Маркировка	4	0	1	2	3

2024 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	X	-	X
5 – 6	X	-	-
7 – 8	-	-	X
Маркировка	3	1	2


2025 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 ⁰ →	0 ⁰ ←	+45 ⁰	
1 – 2	-	-	X	X
3 – 4	-	-	X	X
5 – 6	X	X	-	-
7 – 8	X	X	-	-

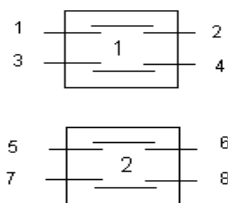


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 - 2	-	-	X	-
3 - 4	-	X	-	-
5 - 6	X	-	-	-
7 - 8	X	-	-	-
Маркировка	2	3	1	0

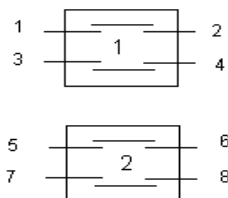


Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	X	-	X
Маркировка	2	0(-)	1

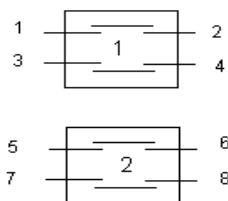


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 - 2	-	-	X
3 - 4	-	X	X
5 - 6	-	X	-
7 - 8	X	-	-
Маркировка	3	1	2

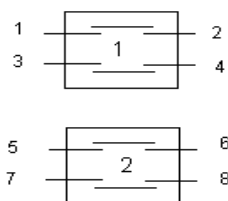



Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
Маркировка	2	0	1

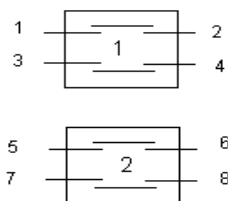



Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 - 2	-	X	-
3 - 4	X	-	-
5 - 6	-	X	-
7 - 8	X	-	X
Маркировка	3	1	2

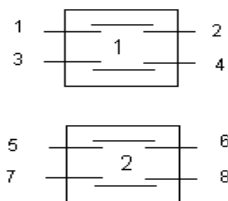



Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	X	X	-
Маркировка	0	3	1	2





2032 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	X	-	X
5 - 6	-	-	X
7 - 8	X	-	X
Маркировка	2	0	1





2034 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	X	-
5 - 6	-	X	-
7 - 8	X	-	X
Маркировка	3	1	2





2035 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-	-
3 - 4	-	-	-	X
5 - 6	-	-	-	X
7 - 8	X	-	-	-
Маркировка	2	3	0	1




2036 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	X	X	-
5 - 6	-	X	X
7 - 8	X	X	-
Маркировка	3	1	2




2037 Соединяемые контакты	Способ фиксации: Б, И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	-	X
3 - 4	-	X
5 - 6	-	X
7 - 8	-	X
Маркировка	0	1




2038 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	X	X	-
Маркировка	3	1	2

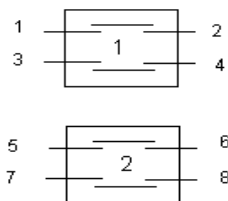


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	X	-	-	-
7 - 8	-	-	-	X	-
Маркировка	3	4	0	1	2

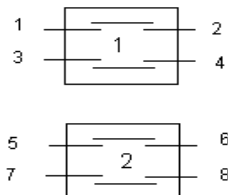


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-
3 - 4	X	-	X
5 - 6	-	X	-
7 - 8	X	-	X
Маркировка	3	1	2

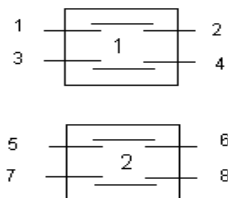


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 ⁰	→ 0 ⁰	← +45 ⁰	
1 - 2	-	-	X	X
3 - 4	X	X	-	-
5 - 6	-	-	-	X
7 - 8	X	-	-	-

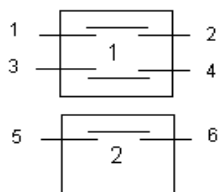


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X	X
3 - 4	-	-	X	X
5 - 6	-	-	-	X
Маркировка	0	1	2	3

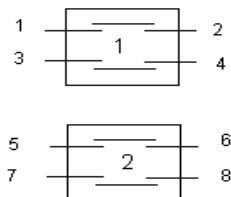


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 ⁰	→ 0 ⁰	← +45 ⁰	
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	X	-	-	-
7 - 8	-	-	-	X

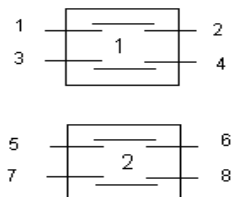


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 ⁰	→ 0 ⁰	← +45 ⁰	
1 - 2	-	-	-	X
3 - 4	X	-	-	-
5 - 6	X	-	-	X
7 - 8	-	-	X	X

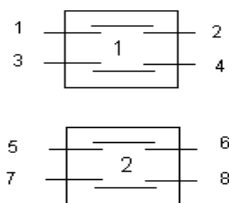


2047 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
Маркировка	0	1	2

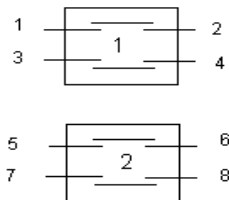


2048 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	X	-	-
3 - 4	-	-	X	X
5 - 6	-	X	-	X
7 - 8	X	-	X	-
Маркировка	3	4	1	2

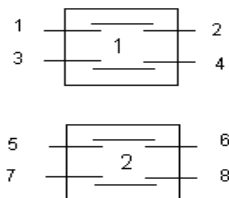


2049 Соединяемые контакты	Способ фиксации: Д			
	Положение рукоятки			
	-90 ⁰	0 ⁰	+90 ⁰	+180 ⁰
1 - 2	-	-	X	X
3 - 4	-	X	-	-
5 - 6	-	-	-	X
7 - 8	-	X	X	-
Маркировка	0	1	2	3

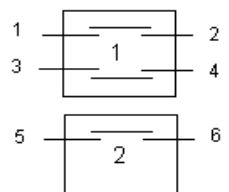


2051 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-
3 - 4	X	X	-	X
5 - 6	-	X	X	X
Маркировка	4	1	2	3

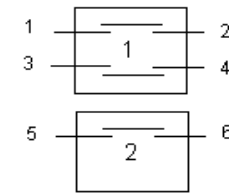


2052 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X	X
3 - 4	-	-	X	-
5 - 6	-	X	-	-
Маркировка	0	3	1	2

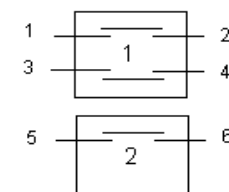


2054 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-
3 - 4	-	-	X	-
5 - 6	X	-	X	X
Маркировка	4	1	2	3

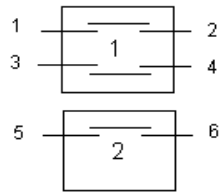


	$\langle N \rangle$			
	$/67^2$	2^2	-67^2	$-;2^2$
3"/4"	/"	/"	/"	/"
5"/6"	/"	/"	/"	/"
7"6"8"	/"	/"	/"	/"
"	6"	3"	4"	5"

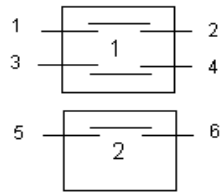


	$\langle N \rangle$			
	$/;2^2$	$/67^2$	2^2	-67^2
3"/4"	/"	/"	/"	/"
5"/6"	/"	/"	/"	/"
7"6"8"	/"	/"	/"	/"
"	5"	6"	3"	4"

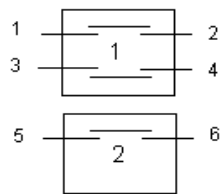


	$\langle N \rangle$			
	$/;2^2$	$/67^2$	2^2	-67^2
3"/4"	/"	/"	/"	/"
5"/6"	/"	/"	/"	/"
7"6"8"	/"	/"	/"	/"
"	2"	5"	3"	4"

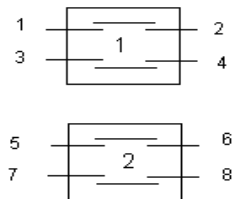

	$\langle N \rangle$			
	$/;2^2$	2^2	$-;2^2$	$-3:2^2$
3"/4"	/"	/"	/"	/"
5"/6"	/"	/"	/"	/"
7"6"8"	/"	/"	/"	/"
9"/:"	/"	/"	/"	/"
"	2"	3"	4"	5"

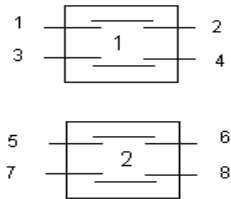

	$\langle E \rangle$	
	2^2	-67^2
3"/4"	/"	/"
5"/6"	/"	/"
7"/8"	/"	/"
9"6":	/"	/"
"	4"	3"

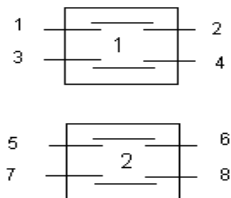

	$\langle N \rangle$			
	$/67^2$	2^2	-67^2	$-;2^2$
3"/4"	/"	/"	/"	/"
5"6"6"	/"	/"	/"	/"
7"6"8"	/"	/"	/"	/"
9"6":	/"	/"	/"	/"
"	6"	3"	4"	5"

0"	: < D =	"	"	"	"	"
		"	"	"	"	"
		0"	"	"	0"	"