




Соединяемые контакты	Способ фиксации: <b>М</b>						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	-	-	-	X	-	-	-
7 – 8	-	-	-	X	-	-	-
9 – 10	X	X	X	-	X	X	X
11 – 12	-	-	-	-	X	X	X
13 – 14	X	X	X	-	-	-	-
15 – 16	X	X	-	-	-	X	X
17 – 18	X	-	-	-	-	-	X
Маркировка	5	6	7	1	2	3	4

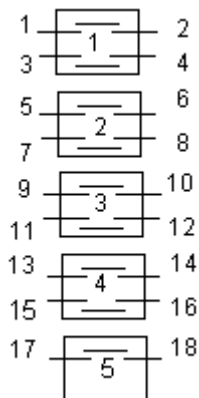


Соединяемые контакты	Способ фиксации: <b>Ф</b>			
	Положение рукоятки			
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-	-
3 – 4	-	-	X	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	-	X
13 – 14	-	X	-	-
15 – 16	-	-	X	-
17 – 18	-	-	-	X
Маркировка	0	3	1	2

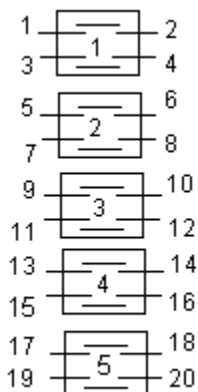


Соединяемые контакты	Способ фиксации: <b>С</b>		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	X	-	X
13 – 14	-	X	-
15 – 16	X	-	X
17 – 18	X	-	-
19 – 20	X	X	-
Маркировка	3	1	2

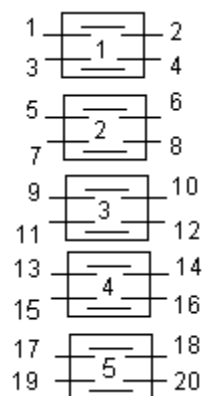

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	-	-	X
13 - 14	-	-	X
15 - 16	X	-	X
17 - 18	X	-	X
19 - 20	X	X	-
Маркировка	3	1	2

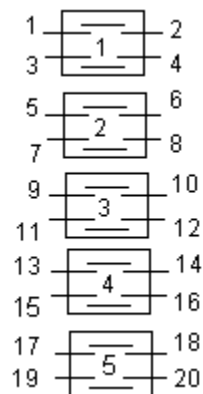

Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	X	-	-	-	X
3 - 4	X	-	-	-	X
5 – 6	X	-	-	-	X
7 – 8	X	-	-	-	X
9 – 10	X	-	-	-	X
11 - 12	X	-	-	-	X
13 - 14	-	-	X	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	X	-	-
19 - 20	-	-	X	-	-
Маркировка	3	0	1	0	2

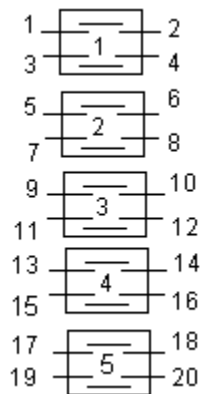

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-
3 – 4	-	-	X
5 – 6	-	X	-
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	-	-	X
13 - 14	-	X	-
15 - 16	X	-	-
17 - 18	-	X	-
19 - 20	X	-	X
Маркировка	3	1	2

Стр.

05-02

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

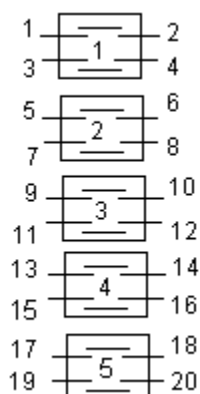


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	-	X	X
13 - 14	-	X	-
15 - 16	X	X	-
17 - 18	X	-	-
19 - 20	X	-	X
Маркировка	3	1	2

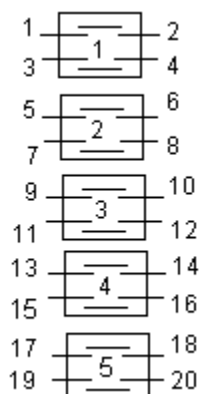


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 - 14	-	X	-
15 - 16	X	-	X
17 - 18	-	X	-
19 - 20	X	-	X
Маркировка	3	1	2

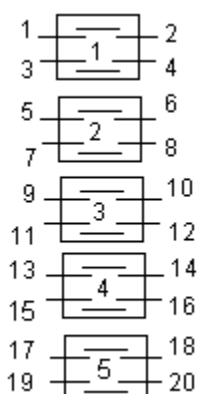


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 - 14	-	X	-
15 - 16	X	-	X
17 - 18	X	-	-
19 - 20	X	-	X
Маркировка	3	1	2

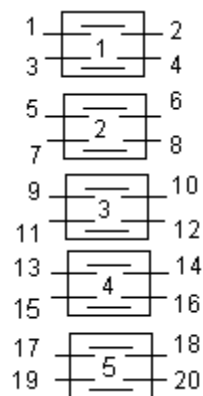


Соединяемые контакты	Способ фиксации: <b>(Ж), С</b>		
	Положение рукоятки		
	$-45^0$	$0^0$	$+45^0$
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	X	-	-
Маркировка	2	(-) 0	1

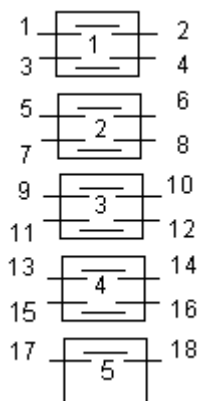


Соединяемые контакты	Способ фиксации: <b>М</b>						
	Положение рукоятки						
	$-135^0$	$-90^0$	$-45^0$	$0^0$	$+45^0$	$+90^0$	$+135^0$
1 – 2	X	-	-	-	-	-	-
3 – 4	-	-	-	-	-	-	X
5 – 6	-	X	-	-	-	-	-
7 – 8	-	-	-	-	-	X	-
9 – 10	-	-	X	-	-	-	-
11 – 12	-	-	-	-	X	-	-
13 – 14	-	-	-	X	-	-	-
15 – 16	X	X	X	-	X	X	X
17 – 18	X	X	X	-	X	X	X
Маркировка	5	6	7	1	2	3	4

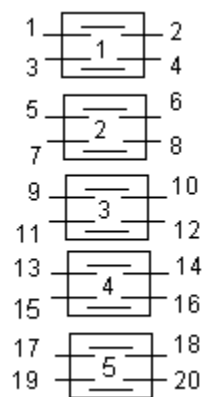


Соединяемые контакты	Способ фиксации: <b>Л</b>				
	Положение рукоятки				
	$-90^0$	$-45^0$	$0^0$	$+45^0$	$+90^0$
1 – 2	-	-	-	X	X
3 – 4	-	X	-	-	X
5 – 6	-	X	X	-	-
7 – 8	-	X	X	-	-
9 – 10	-	X	X	-	-
11 – 12	-	X	X	-	-
13 – 14	-	-	X	X	-
15 – 16	-	-	X	X	-
17 – 18	-	-	X	X	-
19 – 20	-	-	X	X	-
Маркировка	0	4	1	2	3

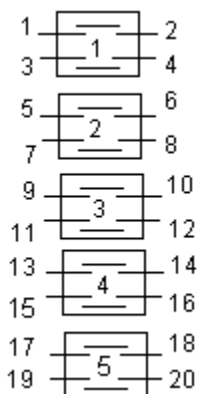


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	X	-	X
19 – 20	X	-	X
Маркировка	2	0	1

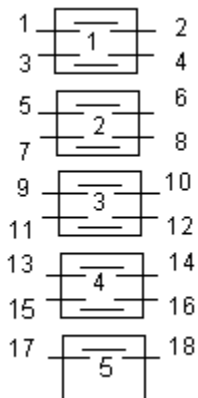


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	X	-	X
7 – 8	X	-	X
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	X	-	X
Маркировка	2	0	1

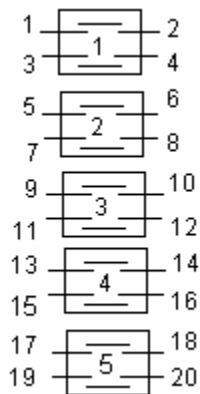


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	-	-	-	-	X	X
3 – 4	X	-	-	-	-	X	-
5 – 6	X	-	-	-	-	X	X
7 – 8	X	-	-	-	-	-	-
9 – 10	X	-	-	-	-	-	-
11 – 12	X	-	-	-	-	-	-
13 – 14	X	X	-	-	-	X	X
15 – 16	X	X	X	-	-	X	X
17 – 18	X	X	X	X	-	X	X
19 – 20	-	-	-	-	-	X	X

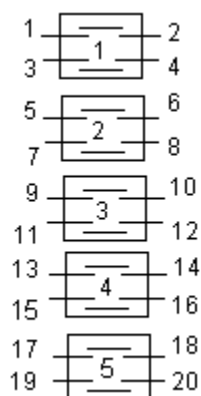


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	X
3 – 4	X	-	X
5 – 6	X	-	X
7 – 8	X	-	X
9 – 10	X	-	X
11 – 12	X	-	X
13 – 14	X	-	X
15 – 16	X	-	X
17 – 18	X	-	X
19 – 20	X	-	X
Маркировка	2	0	1

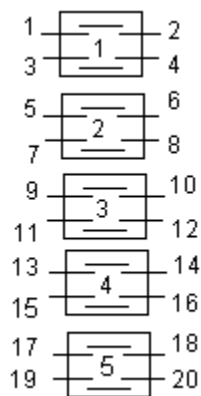


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	X	-
3 – 4	X	X	-
5 – 6	-	X	X
7 – 8	-	X	X
9 – 10	-	X	X
11 – 12	-	X	X
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	X	-	-
19 – 20	-	X	-
Маркировка	3	1	2

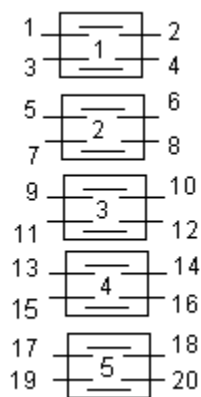


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	X	-
3 – 4	X	X	-
5 – 6	X	X	-
7 – 8	X	X	-
9 – 10	X	X	-
11 – 12	-	X	X
13 – 14	-	X	X
15 – 16	-	X	X
17 – 18	-	X	X
19 – 20	-	X	X
Маркировка	3	1	2

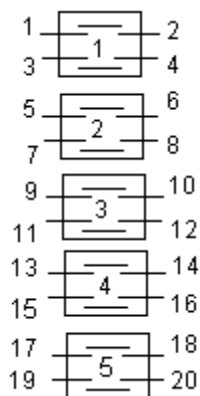

Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135
1 - 2	-	-	-	-	X	-
3 - 4	X	-	-	-	-	-
5 - 6	X	-	-	-	-	-
7 - 8	-	-	-	-	X	-
9 - 10	-	X	-	-	-	X
11 - 12	-	-	-	-	-	X
13 - 14	X	X	X	-	-	X
15 - 16	X	X	X	-	-	-
17 - 18	X	X	X	-	X	-
19 - 20	-	X	X	-	X	-
Маркировка	3	4	5	0	1	2

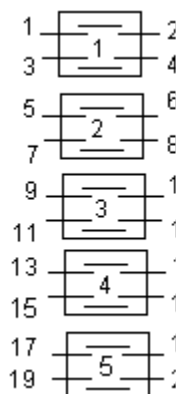


Соединяемые контакты	Способ фиксации: H							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	X	X	-	-	-	-	-	X
3 - 4	-	-	X	X	X	X	X	-
5 - 6	-	X	-	X	-	X	-	X
7 - 8	X	-	X	-	X	-	X	-
9 - 10	-	-	-	X	X	-	-	-
11 - 12	X	X	X	-	-	X	X	X
13 - 14	X	-	-	X	X	X	X	X
15 - 16	-	X	X	-	-	-	-	-
17 - 18	X	X	X	-	-	-	-	X
19 - 20	-	-	-	X	X	X	X	-
Маркировка	6	7	8	1	2	3	4	5

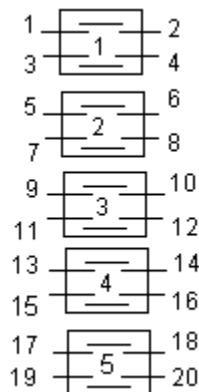


Соединяемые контакты	Способ фиксации: C		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	X	X	-
3 - 4	X	X	-
5 - 6	X	X	-
7 - 8	X	X	-
9 - 10	-	X	X
11 - 12	-	X	X
13 - 14	-	-	X
15 - 16	-	-	X
17 - 18	-	-	X
19 - 20	X	-	-
Маркировка	3	1	2


					<b>АВКГ 1848</b>	Стр.
						<b>05-07</b>
Изм.	Лист	№ докум	Подпись	Дата		

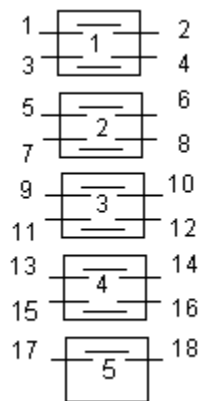

5023 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	X	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	-	-	X
7 - 8	X	-	-	X	-
9 - 10	X	-	-	X	-
11 - 12	-	-	-	-	X
13 - 14	-	X	-	-	X
15 - 16	-	-	-	X	-
17 - 18	-	X	-	-	-
Маркировка	3	4	0	1	2

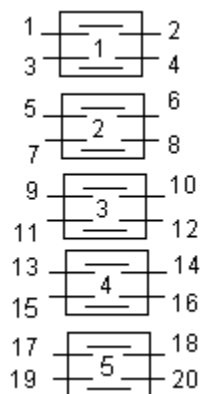

5024 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 - 6	X	X	-	-	-
7 - 8	-	-	-	X	X
9 - 10	-	X	-	X	-
11 - 12	-	X	-	X	-
13 - 14	X	-	-	-	X
15 - 16	X	-	-	-	X
17 - 18	X	-	-	-	X
19 - 20	-	-	X	-	-
Маркировка	4	5	1	2	3

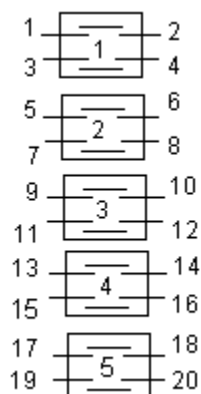

5025 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 <sup>0</sup>	→ 0 <sup>0</sup> ←	+45 <sup>0</sup>	
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	X	X	-	-
11 - 12	X	X	-	-
13 - 14	X	X	-	-
15 - 16	-	X	X	-
17 - 18	X	-	-	-
19 - 20	-	-	-	X

Стр.

05-08

АВКГ 1848

Изм.


Лист

№ докум.


Подпись

Дата




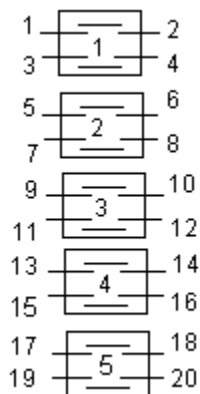


5026 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 <sup>0</sup>	→	0 <sup>0</sup>	←
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	X	X	-	-
9 - 10	X	X	-	-
11 - 12	-	X	X	-
13 - 14	-	-	-	X
15 - 16	-	-	-	X
17 - 18	X	-	-	-
19 - 20	X	-	-	-

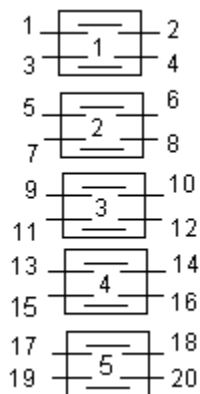


5028 Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	X	-	-
13 - 14	X	-	-
15 - 16	X	-	-
17 - 18	X	-	-
19 - 20	X	-	-
Маркировка	2	(-) 0	1

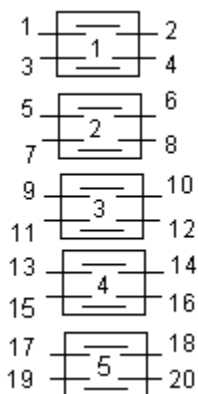


5030 Соединяемые контакты	Способ фиксации: (Е), Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	-	X	-	-
3 - 4	-	-	X	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	X	-	-
9 - 10	-	-	X	-	-
11 - 12	-	-	X	-	-
13 - 14	-	-	X	-	-
15 - 16	-	-	X	-	-
17 - 18	X	-	-	-	X
19 - 20	X	-	-	-	X
Маркировка	2	(-) 0	1	(-) 0	2

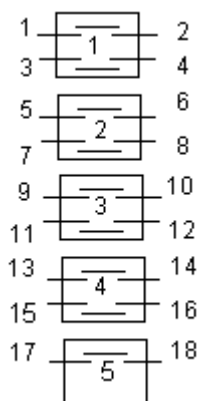

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	-	X	X
9 – 10	-	-	X
11 – 12	-	X	X
13 – 14	-	-	X
15 – 16	-	X	X
17 – 18	X	-	-
Маркировка	3	1	2

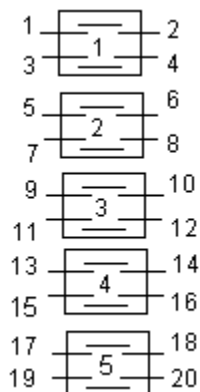

Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	X
3 – 4	-	X	X
5 – 6	X	X	-
7 – 8	X	X	-
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
Маркировка	3	1	2

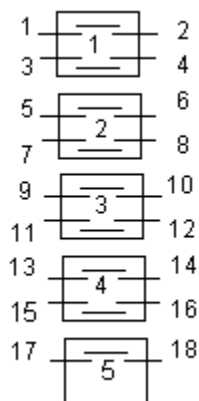

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
Маркировка	2	0	1

Стр.

05-10

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

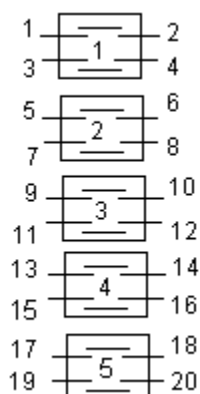


5036 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	-	X
Маркировка	2	0	1

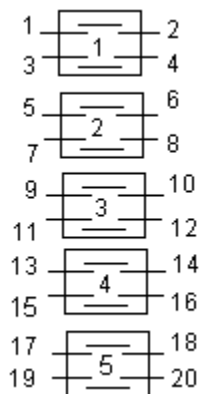


5037 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	X
3 – 4	X	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	-	X
Маркировка	2	0	1

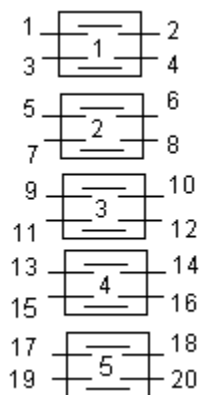


5038 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-
3 – 4	X	-
5 – 6	X	-
7 – 8	X	-
9 – 10	X	-
11 – 12	X	-
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
Маркировка	1	2

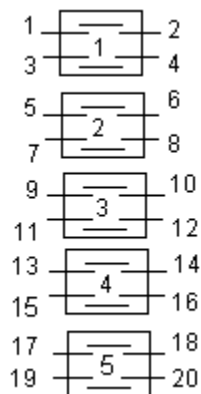


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	X
11 – 12	X	-	X
13 – 14	X	-	X
15 – 16	X	-	X
17 – 18	X	-	X
19 – 20	X	-	X
Маркировка	2	0	1

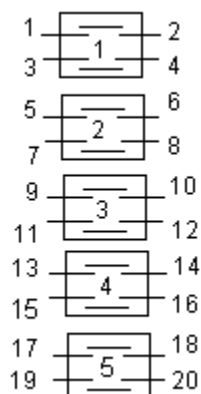


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	0°	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	X	X	-
9 – 10	-	X	X	-
11 - 12	-	X	X	-
13 - 14	-	-	-	X
15 – 16	-	-	-	X
17 - 18	X	-	-	-
19 - 20	X	-	-	-

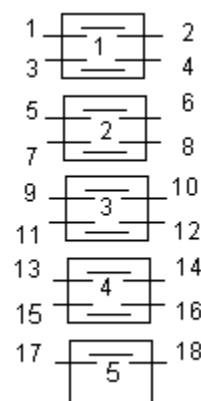


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 - 16	X	-	-	-
17 - 18	-	X	X	X
Маркировка	3	4	1	2

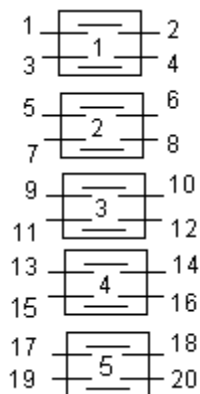


Соединяемые контакты	Способ фиксации: <b>X</b>					
	Положение рукоятки					
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135
1 - 2	-	X	-	-	-	-
3 - 4	-	-	X	-	-	-
5 - 6	-	-	-	X	-	-
7 - 8	-	-	-	-	X	-
9 - 10	-	-	-	-	-	X
11 - 12	-	X	-	-	-	-
13 - 14	-	-	X	-	-	-
15 - 16	-	-	-	X	-	-
17 - 18	-	-	-	-	X	-
19 - 20	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

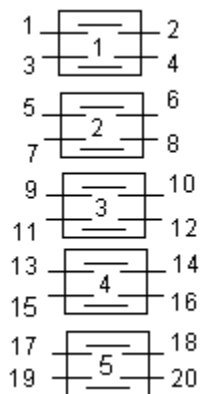


Соединяемые контакты	Способ фиксации: <b>H</b>							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	X	-	-	-	-	-	-	-
3 - 4	-	X	X	X	X	X	X	X
5 - 6	X	-	-	-	-	-	-	-
7 - 8	-	-	-	-	X	-	-	-
9 - 10	-	X	-	-	-	-	-	-
11 - 12	-	-	-	-	-	X	-	-
13 - 14	-	-	X	-	-	-	-	-
15 - 16	-	-	-	-	-	-	X	-
17 - 18	-	-	-	X	-	-	-	-
19 - 20	-	-	-	-	-	-	-	X
Маркировка	1	2	3	4	5	6	7	8

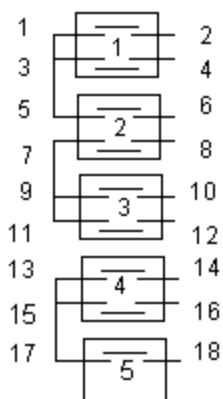


Соединяемые контакты	Способ фиксации: <b>У</b>			
	Положение рукоятки			
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	X	-	-	-
3 - 4	-	-	X	-
5 - 6	-	-	-	X
7 - 8	X	-	-	-
9 - 10	-	-	X	-
11 - 12	-	-	-	X
13 - 14	X	-	-	-
15 - 16	-	-	X	-
17 - 18	-	-	-	X
Маркировка	4	1	2	3

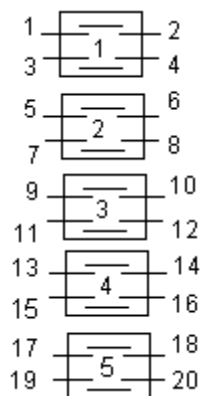

Соединяемые контакты	Способ фиксации: <b>И</b>	
	Положение рукоятки	
	0°	+45°
1 - 2	X	-
3 - 4	-	X
5 - 6	X	-
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
13 - 14	-	X
15 - 16	-	X
17 - 18	-	X
19 - 20	-	X
Маркировка	0	1

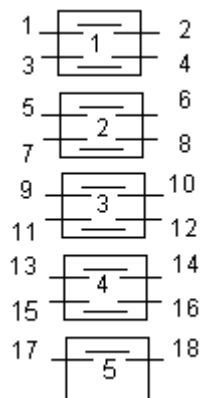

Соединяемые контакты	Способ фиксации: <b>Н</b>							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	-	-	-	-	X
3 - 4	-	-	-	-	-	-	X	X
5 - 6	-	-	-	-	-	X	X	X
7 - 8	-	-	-	-	X	X	X	X
9 - 10	-	-	-	X	X	X	X	X
11 - 12	-	-	X	X	X	X	X	X
13 - 14	-	X	X	X	X	X	X	X
15 - 16	-	X	X	X	X	X	X	X
17 - 18	X	-	-	-	-	-	-	-
Маркировка	0	1	2	3	4	5	6	7

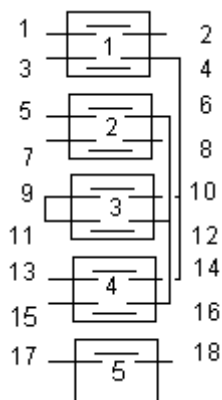

Соединяемые контакты	Способ фиксации: <b>С</b>		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	X	X
3 - 4	-	X	-
5 - 6	-	X	-
7 - 8	X	-	-
9 - 10	X	-	-
11 - 12	X	-	-
13 - 14	-	-	X
15 - 16	-	-	X
17 - 18	-	-	X
Маркировка	3	1	2

Стр.

05-14

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

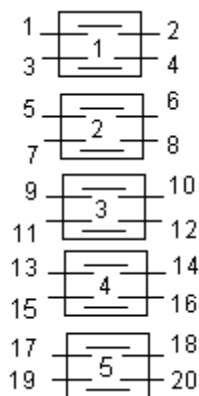


Соединяемые контакты	Способ фиксации: <b>И</b>	
	Положение рукоятки	
	0°	+45°
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	X	-
19 – 20	X	-
Маркировка	0	1

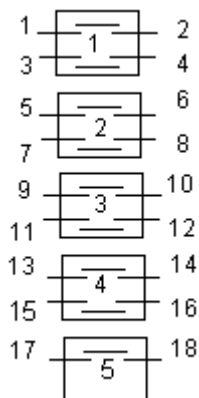


Соединяемые контакты	Способ фиксации: <b>АП</b>		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	X
3 – 4	-	X	X
5 – 6	-	X	X
7 – 8	-	X	X
9 – 10	-	X	X
11 – 12	-	-	X
13 – 14	-	X	X
15 – 16	X	-	-
17 – 18	-	X	X

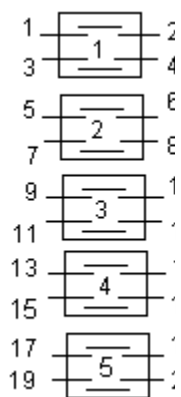


Соединяемые контакты	Способ фиксации: <b>Н</b>							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	X	-	-	-	-
3 - 4	-	-	-	X	X	-	-	-
5 – 6	-	-	X	-	-	-	-	-
7 - 8	-	-	-	-	-	-	-	X
9 – 10	-	-	-	-	X	X	X	X
11 - 12	X	X	X	-	-	-	-	-
13 - 14	X	X	X	-	X	X	X	X
15 - 16	X	X	-	-	-	-	-	X
17 - 18	X	-	-	X	X	X	-	-
19 - 20	-	-	-	-	-	X	-	-
Маркировка	6	7	8	1	2	3	4	5

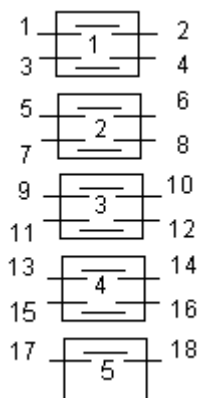

Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	X	-	-	-	-
3 – 4	-	-	X	-	-	-	-
5 – 6	-	-	X	-	-	-	-
7 – 8	-	-	X	-	-	-	-
9 – 10	X	X	-	-	X	-	-
11 – 12	-	-	-	-	-	X	-
13 – 14	-	-	-	-	-	-	X
15 – 16	X	X	-	-	-	-	-
17 – 18	X	-	-	-	-	-	-
Маркировка	4	5	6	0	1	2	3

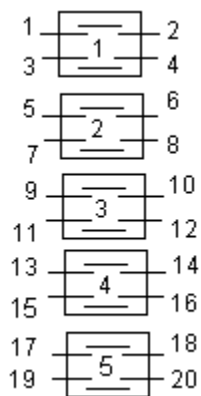

Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	-	-	-	X	-	-	-	-
3 - 4	-	-	-	X	X	-	-	-
5 – 6	-	-	-	-	X	X	X	X
7 - 8	X	-	-	-	-	-	-	X
9 – 10	-	-	-	-	X	X	X	X
11 - 12	X	X	X	-	-	-	-	-
13 - 14	X	-	-	X	X	X	-	X
15 - 16	-	-	X	-	-	X	-	-
17 - 18	X	X	-	-	-	-	-	X
19 - 20	X	X	X	-	X	X	X	X
Маркировка	6	7	8	1	2	3	4	5

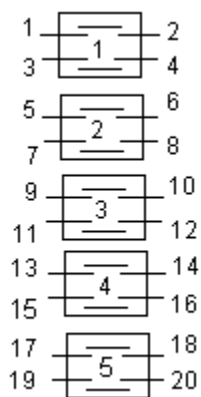

Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	X	-	-
5 – 6	-	-	-	-	X	X	X
7 – 8	X	X	-	-	-	-	X
9 – 10	-	-	-	-	X	X	X
11 – 12	X	X	X	-	-	-	-
13 – 14	X	-	-	X	X	X	-
15 - 16	X	-	-	-	-	-	X
17 - 18	X	-	-	X	X	-	X
19 - 20	X	X	X	-	X	X	X
Маркировка	5	6	7	1	2	3	4

Стр.

05-16

АВКГ 1848

Изм.


Лист

№ докум.


Подпись

Дата




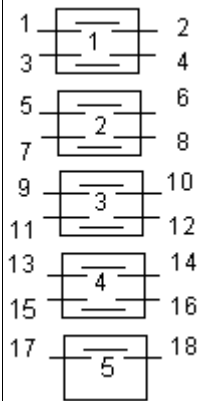


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	-	X	X	X
5 – 6	X	X	X	-	-	-	-
7 – 8	-	-	X	-	X	-	-
9 – 10	X	X	-	-	-	X	X
11 – 12	X	-	X	-	X	-	X
13 – 14	-	-	-	-	-	-	X
15 – 16	X	-	-	-	-	-	-
17 – 18	-	X	X	X	X	X	-
Маркировка	5	6	7	1	2	3	4

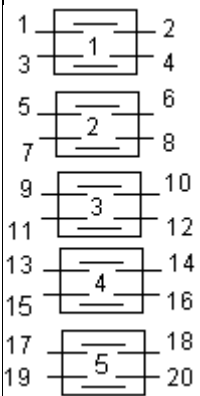


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	-	-	-	X	-	-	-	-
3 - 4	X	X	X	-	X	X	X	X
5 – 6	X	X	-	-	-	-	-	X
7 - 8	-	-	-	-	X	X	X	X
9 – 10	-	-	-	X	X	-	-	-
11 - 12	X	-	-	-	-	-	-	X
13 - 14	X	-	-	X	X	X	-	X
15 - 16	-	-	X	-	-	X	-	-
17 - 18	-	-	-	-	X	X	X	X
19 - 20	X	X	X	-	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

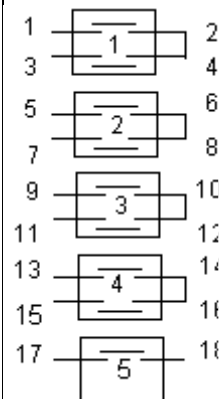


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	X	X	X	-	X	X	X
7 – 8	X	-	-	-	-	-	X
9 – 10	X	X	X	-	-	-	-
11 – 12	-	-	-	-	X	X	X
13 – 14	X	X	-	-	-	X	X
15 - 16	X	-	-	-	-	-	X
17 - 18	X	X	X	-	X	X	X
Маркировка	5	6	7	1	2	3	4

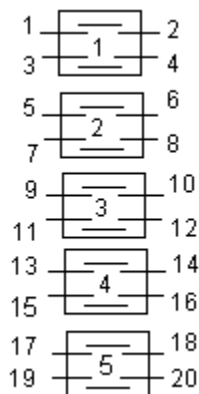


Соединяемые контакты	Способ фиксации: <b>М</b>						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	-	-	-	-	X	X	X
7 – 8	X	X	X	-	-	-	-
9 – 10	-	-	-	-	-	X	X
11 – 12	X	X	-	-	-	-	-
13 – 14	-	-	-	-	-	-	X
15 – 16	X	-	-	-	-	-	-
17 – 18	-	-	-	-	X	X	X
19 – 20	X	X	X	-	-	-	-
Маркировка	5	6	7	1	2	3	4

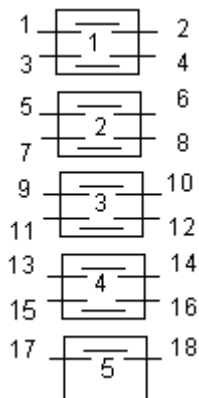


Соединяемые контакты	Способ фиксации: <b>Н</b>							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 – 2	-	-	-	X	-	-	-	-
3 – 4	-	-	-	-	X	X	X	X
5 – 6	X	X	X	-	-	-	-	-
7 – 8	-	-	X	X	-	-	-	-
9 – 10	-	-	-	-	X	X	X	X
11 – 12	X	X	X	-	-	-	-	-
13 – 14	-	-	-	-	-	X	X	X
15 – 16	-	X	X	X	-	-	X	X
17 – 18	-	-	X	X	-	-	-	X
Маркировка	6	7	8	1	2	3	4	5

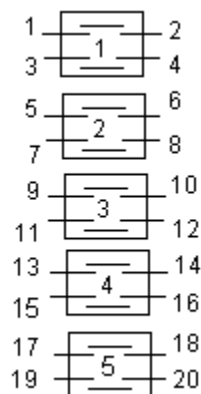


Соединяемые контакты	Способ фиксации: <b>С</b>		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	X	-
17 – 18	-	-	X
19 – 20	-	-	X
Маркировка	3	1	2

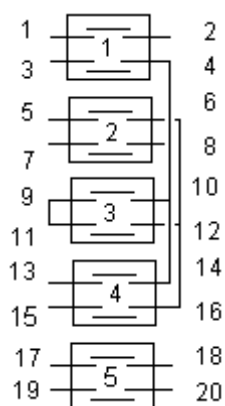


5062 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	X
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	X	X
Маркировка	3	1	2

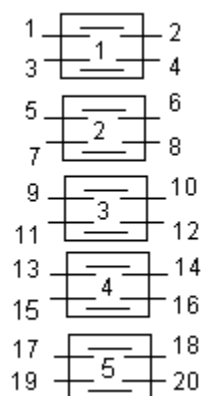


5063 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
Маркировка	1	2

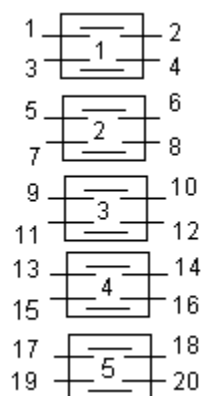


5064 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-
3 – 4	-	X
5 – 6	X	-
7 – 8	-	X
9 – 10	X	-
11 – 12	-	X
13 – 14	X	-
15 – 16	-	X
17 – 18	X	-
19 – 20	-	X
Маркировка	1	2

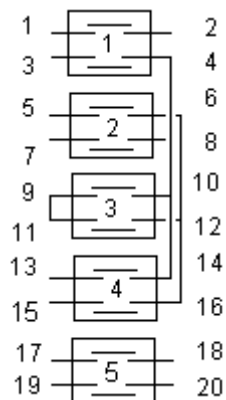


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 - 20	-	X	-
Маркировка	3	1	2

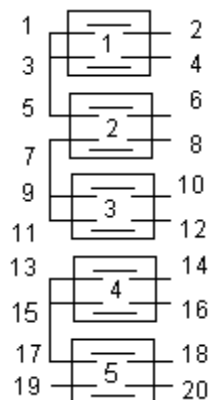


Соединяемые контакты	Способ фиксации: Ж	
	Положение рукоятки	
	-45 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-
3 – 4	X	-
5 – 6	X	-
7 – 8	X	-
9 – 10	X	-
11 – 12	X	-
13 - 14	X	-
15 - 16	X	-
17 - 18	X	-
19 - 20	X	-
Маркировка	1	2

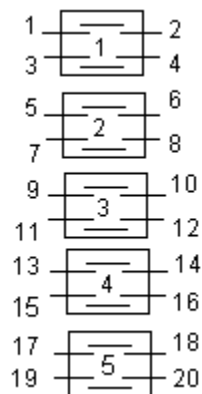


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	-	X	-
9 – 10	-	X	-
11 – 12	-	X	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 - 20	-	X	X
Маркировка	3	1	2

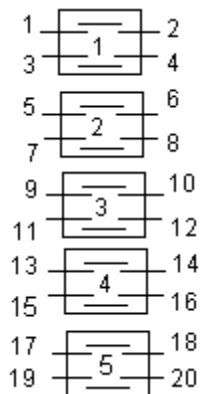


5068 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	-	X	-
9 – 10	-	X	-
11 – 12	-	X	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 - 20	-	X	-
Маркировка	3	1	2

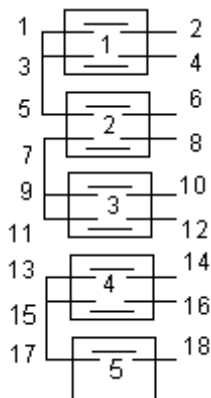


5069 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	X	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	X	-
17 – 18	-	-	X
Маркировка	3	1	2

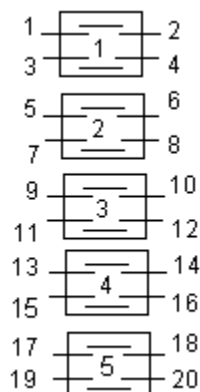


5070 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	X	X	X	-	-	-	-	-
3 - 4	-	-	-	X	X	X	-	-
5 – 6	-	-	-	-	-	-	X	X
7 - 8	X	X	-	-	-	-	-	-
9 – 10	-	-	X	X	X	-	-	-
11 - 12	-	-	-	-	-	X	X	X
13 - 14	X	-	-	-	-	-	-	-
15 - 16	-	X	X	X	-	-	-	-
17 - 18	-	-	-	-	X	X	X	-
19 - 20	-	-	-	-	-	-	-	X
Маркировка	6	7	8	1	2	3	4	5

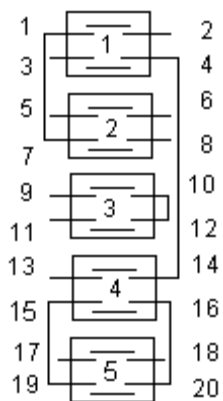

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	X	-
Маркировка	3	1	2

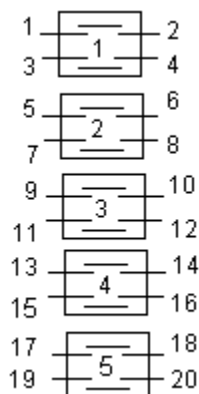

Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	-	-	-	-	-	-
3 – 4	-	X	-	-	-	-	-
5 – 6	-	-	X	-	-	-	-
7 – 8	-	-	-	X	-	-	-
9 – 10	-	-	-	-	X	-	-
11 – 12	-	-	-	-	X	-	-
13 – 14	-	-	-	-	-	X	-
15 – 16	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	X
19 – 20	-	-	-	-	-	-	X
Маркировка	5	6	7	1	2	3	4

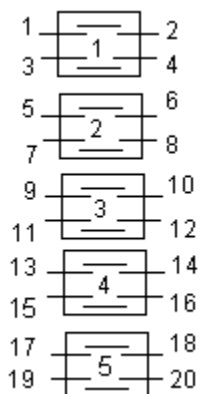

Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-
3 – 4	X	-
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	X	-
19 – 20	X	-
Маркировка	1	2

Стр.

05-22

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

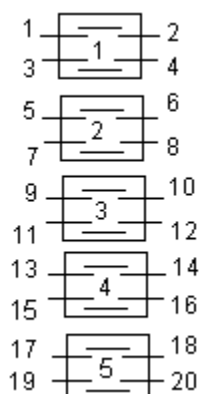


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
Маркировка	1	0	2

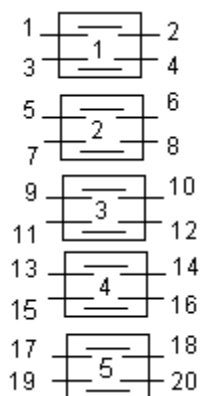


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
Маркировка	3	1	2

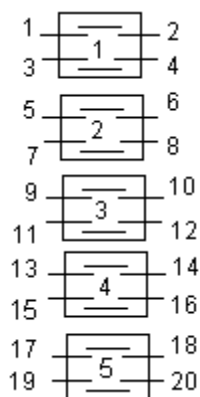


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	-	-	X	-
3 - 4	-	X	-	-	-
5 – 6	-	-	-	X	-
7 – 8	-	X	-	-	-
9 – 10	-	-	X	-	-
11 - 12	-	-	-	-	X
13 - 14	X	-	-	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	-	-	X
19 - 20	X	-	-	-	-
Маркировка	4	5	1	2	3

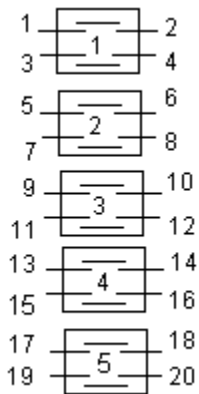

Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	X	X	-	X	X	X
3 – 4	X	X	-	-	-	X	X
5 – 6	X	-	-	-	-	-	X
7 – 8	X	-	-	-	-	-	X
9 – 10	X	X	-	-	-	X	X
11 – 12	X	X	X	-	X	X	X
13 – 14	-	-	-	X	-	-	-
15 – 16	X	X	X	-	X	X	X
17 – 18	X	X	X	-	-	-	-
19 – 20	-	-	-	-	X	X	X
Маркировка	5	6	7	1	2	3	4

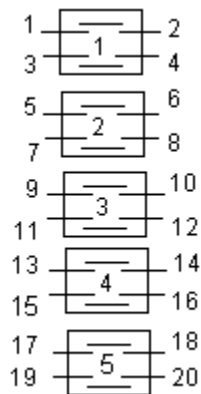


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	X
19 – 20	X	-	X
Маркировка	2	0	1

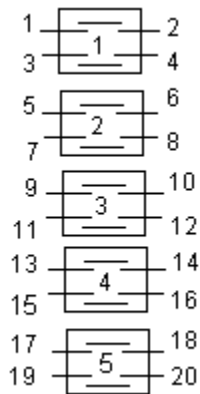


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	-	X	-
13 – 14	X	-	-
15 – 16	-	X	X
17 – 18	X	-	-
19 – 20	-	X	X
Маркировка	3	1	2




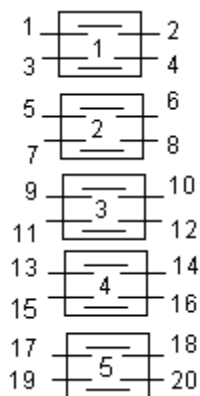


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	X	-	-	-	-
7 - 8	-	-	-	-	X
9 - 10	-	X	-	-	-
11 - 12	-	X	-	-	-
13 - 14	-	-	X	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	-	X	-
19 - 20	-	-	-	X	-
Маркировка	4	5	1	2	3

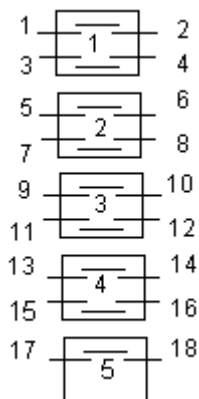


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	X	-	-	-
3 - 4	X	-	-	-
5 - 6	-	X	-	-
7 - 8	-	X	-	-
9 - 10	-	X	-	-
11 - 12	-	-	-	X
13 - 14	-	-	-	X
15 - 16	-	-	-	X
17 - 18	-	-	X	-
Маркировка	3	4	1	2

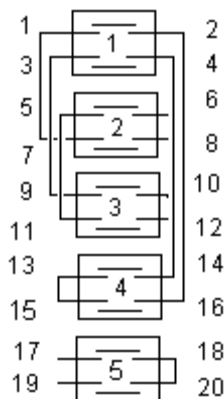


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	-	-	X
15 - 16	-	-	X
17 - 18	X	-	-
19 - 20	-	-	X
Маркировка	2	0	1

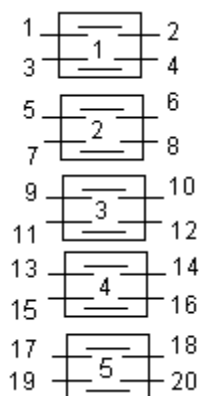

Соединяемые контакты	Способ фиксации: <b>Н</b> (без ограничения хода рукоятки)							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 – 2	X	X	X	-	X	X	X	X
3 – 4	-	-	-	-	X	X	X	X
5 – 6	X	X	-	-	-	-	-	-
7 – 8	-	-	X	-	-	-	-	-
9 – 10	-	X	X	-	-	-	-	-
11 – 12	X	-	-	-	-	-	-	-
13 – 14	-	-	-	-	-	-	-	X
15 – 16	-	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	X	-	-
19 – 20	-	-	-	-	X	-	-	-
Маркировка	6	7	8	1	2	3	4	5

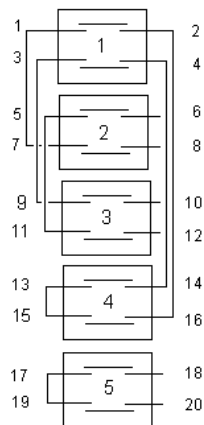

Соединяемые контакты	Способ фиксации: <b>С</b>		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
Маркировка	2	0	1

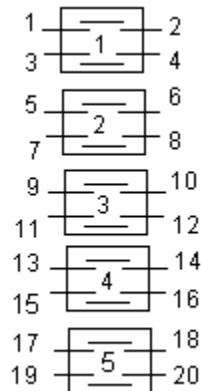

Соединяемые контакты	Способ фиксации: <b>Л</b>				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 – 2	X	-	-	-	-
3 – 4	X	-	-	-	-
5 – 6	-	X	-	-	-
7 – 8	-	X	-	-	-
9 – 10	-	-	X	-	-
11 – 12	-	-	X	-	-
13 – 14	-	-	-	X	-
15 – 16	-	-	-	X	-
17 – 18	-	-	-	-	X
19 – 20	-	-	-	-	X
Маркировка	4	5	1	2	3

Стр.

05-26

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

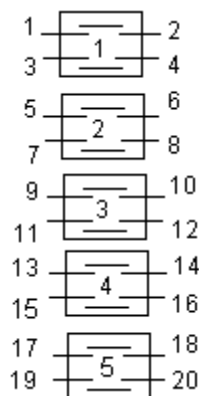


Соединяемые контакты	Способ фиксации: А		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	X	-
19 – 20	-	X	-

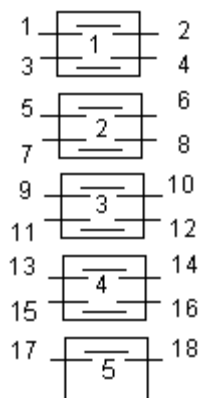


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	X	-
5 – 6	X	-	-
7 – 8	-	X	-
9 – 10	X	-	-
11 – 12	-	X	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
Маркировка	3	1	2

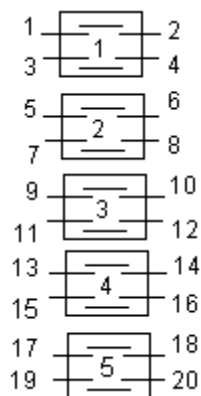


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	-	X	X	-
3 – 4	-	X	X	-	-	-	-
5 – 6	-	X	X	-	X	X	-
7 – 8	-	-	-	-	-	X	-
9 – 10	-	X	-	-	-	X	-
11 – 12	X	X	-	-	-	X	X
13 – 14	X	X	X	-	X	X	X
15 – 16	-	-	-	X	-	-	-
17 – 18	X	-	-	-	-	-	X
19 – 20	X	X	X	-	X	X	X
Маркировка	5	6	7	1	2	3	4

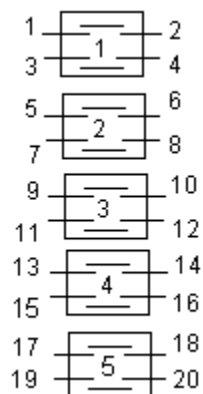

Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 – 2	X	-	-	-	-	-	-	-
3 – 4	-	X	-	-	-	-	-	-
5 – 6	-	-	X	-	-	-	-	-
7 – 8	-	-	-	X	-	-	-	-
9 – 10	-	-	-	-	X	-	-	-
11 – 12	-	-	-	-	-	X	-	-
13 – 14	-	-	-	-	-	-	X	-
15 – 16	-	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	-	X
19 – 20	-	-	-	-	-	-	-	X
Маркировка	6	7	8	1	2	3	4	5

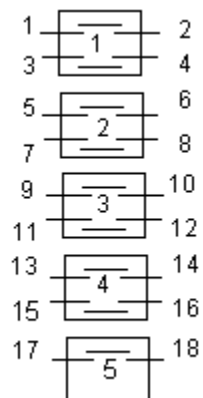

Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	X	X	X
3 – 4	-	X	X	X
5 – 6	-	X	X	X
7 – 8	-	X	X	X
9 – 10	-	-	X	X
11 – 12	-	-	X	-
13 – 14	-	-	X	X
15 – 16	-	-	X	-
17 – 18	-	-	X	-
Маркировка	0	1	2	3

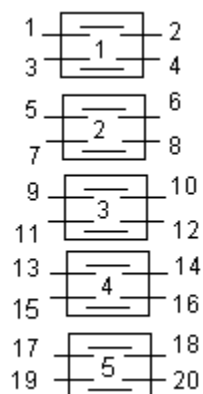

Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	-	-	-	-	-	X	X
3 – 4	-	-	-	-	X	-	-
5 – 6	X	X	-	-	-	-	-
7 – 8	-	-	-	-	X	-	-
9 – 10	-	-	X	X	-	-	-
11 – 12	-	X	-	-	-	-	-
13 – 14	X	-	-	-	-	-	-
15 – 16	-	-	X	-	-	X	-
17 – 18	-	-	-	X	-	-	X
19 – 20	-	-	-	-	X	-	-
Маркировка	5	6	7	1	2	3	4

Стр.

05-28

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

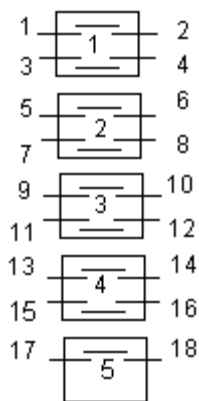


Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135
1 - 2	X	X	X	X	-	-
3 - 4	X	X	X	-	-	-
5 - 6	X	-	-	-	-	-
7 - 8	-	X	-	-	-	-
9 - 10	-	-	X	-	-	-
11 - 12	-	-	-	-	X	X
13 - 14	-	-	-	X	-	-
15 - 16	-	-	-	X	X	-
17 - 18	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

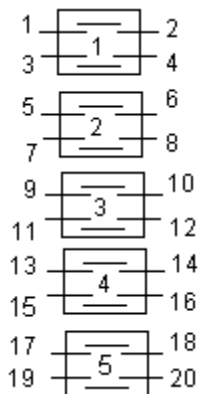


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	X	-	-	-
7 - 8	-	-	-	X	-
9 - 10	-	-	-	-	X
11 - 12	-	X	-	-	-
13 - 14	-	-	-	X	-
15 - 16	-	-	X	-	-
17 - 18	X	-	-	-	-
19 - 20	-	-	X	-	-
Маркировка	4	5	1	2	3

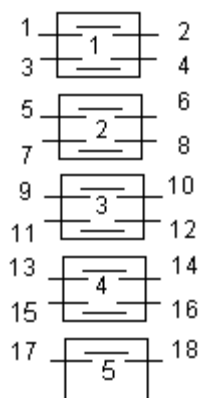


Соединяемые контакты	Способ фиксации: Д			
	Положение рукоятки			
	-90 <sup>0</sup>	0 <sup>0</sup>	+90 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	-	X	X	X
3 - 4	-	X	X	X
5 - 6	-	X	X	X
7 - 8	-	X	X	X
9 - 10	-	-	X	X
11 - 12	-	-	X	-
13 - 14	-	-	X	X
15 - 16	-	-	X	-
17 - 18	-	-	X	-
Маркировка	0	1	2	3

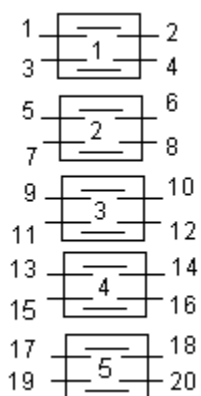


5097 Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0°	+45°	+90°	+135°
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	X	-	-
11 – 12	-	X	-	-
13 - 14	-	-	X	-
15 - 16	-	-	X	-
17 - 18	-	-	-	X
19 - 20	-	-	-	X
Маркировка	1	2	3	4

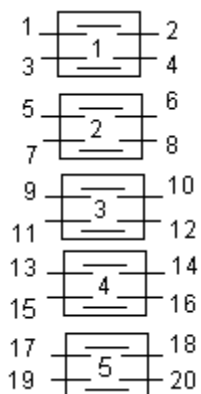


5098 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	-	-	-	X
3 – 4	-	-	X	-
5 – 6	X	-	X	X
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	X	-	-	-
13 - 14	X	-	-	-
15 - 16	-	-	-	X
17 - 18	-	-	X	-
19 - 20	-	-	X	X
Маркировка	3	0	1	2

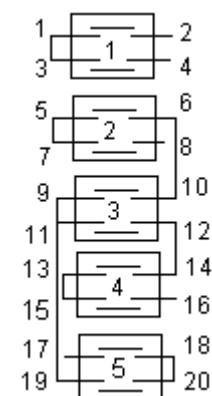


5099 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
17 - 18	-	-	X
19 - 20	X	-	-
Маркировка	2	0	1

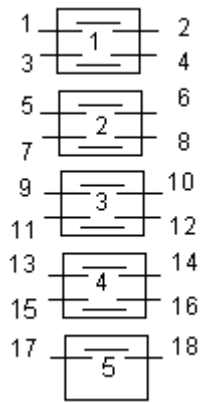


5100 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	X	X	-	X
3 - 4	-	-	-	-	X
5 - 6	-	-	X	X	-
7 - 8	-	-	-	X	-
9 - 10	-	-	X	-	-
11 - 12	-	-	X	-	-
13 - 14	-	X	X	-	-
15 - 16	-	X	-	-	-
17 - 18	-	X	-	-	-
Маркировка	0	1	2	3	4

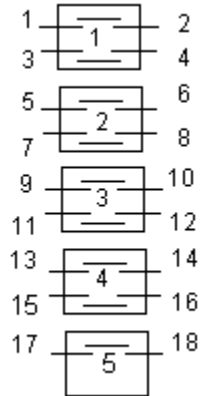


5101 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	-	X	X	-
3 - 4	-	X	X	-	X
5 - 6	-	-	X	-	-
7 - 8	X	-	-	-	X
9 - 10	-	X	X	-	-
11 - 12	-	-	X	-	-
13 - 14	-	X	-	-	-
15 - 16	-	-	-	X	-
17 - 18	-	X	-	-	-
Маркировка	1	2	3	4	5

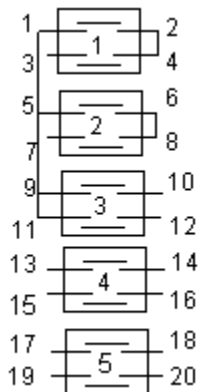


5103 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135
1 - 2	-	X	-	-	-	-
3 - 4	-	-	X	-	-	-
5 - 6	-	-	-	X	-	-
7 - 8	-	-	-	-	X	-
9 - 10	-	-	-	-	-	X
11 - 12	-	X	-	-	-	-
13 - 14	-	-	X	-	-	-
15 - 16	-	-	-	X	-	-
17 - 18	-	-	-	-	X	-
19 - 20	-	-	-	-	-	X
Маркировка	0	1	2	3	4	5

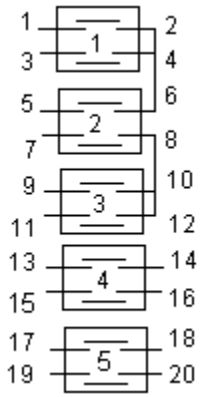

5104 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	X	-	X
11 – 12	X	-	X
13 – 14	-	X	X
15 – 16	X	X	-
17 – 18	X	-	-
19 – 20	-	-	X
Маркировка	3	1	2

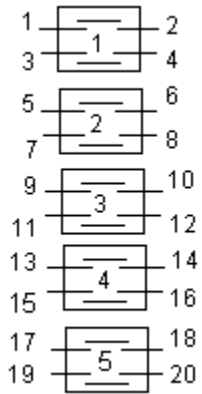


5105 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	-	-	-	-	X	X
3 – 4	-	-	-	-	X	-	-
5 – 6	-	X	-	-	-	-	-
7 – 8	-	-	-	-	-	X	-
9 – 10	-	-	X	-	-	-	-
11 – 12	-	-	-	-	-	-	X
13 – 14	-	-	-	X	-	-	-
15 – 16	X	X	X	-	-	-	-
17 – 18	-	-	-	X	X	-	-
19 – 20	-	-	-	-	-	X	X
Маркировка	5	6	7	1	2	3	4

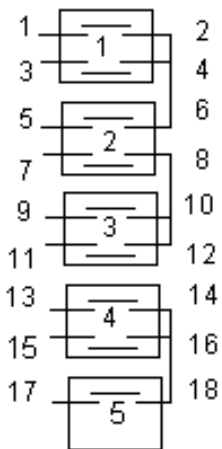


5107 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	X	-	-
3 – 4	-	-	X	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	-	X
13 – 14	-	X	-	-
15 – 16	-	-	X	-
17 – 18	-	-	-	X
Маркировка	0	3	1	2




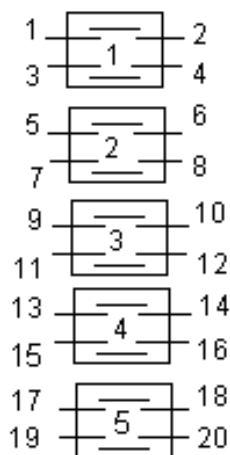


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	X	-	-	-	-	-
3 – 4	X	X	-	-	-	-	-
5 – 6	-	X	X	X	X	X	X
7 – 8	-	-	X	X	X	-	-
9 – 10	-	-	X	X	X	-	-
11 – 12	X	X	X	-	X	X	X
13 – 14	-	-	-	-	-	X	X
15 – 16	-	-	-	-	-	X	X
17 – 18	X	X	X	X	X	X	-
19 - 20	-	-	-	-	-	-	X
Маркировка	5	6	7	1	2	3	4

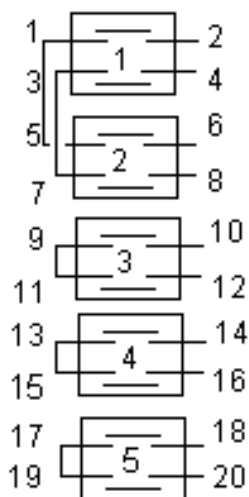


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 – 6	X	-	-	-	-
7 – 8	-	-	-	-	X
9 – 10	-	X	-	-	-
11 - 12	-	X	-	-	-
13 - 14	-	-	X	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	-	X	-
19 - 20	-	-	-	X	-
Маркировка	4	5	1	2	3

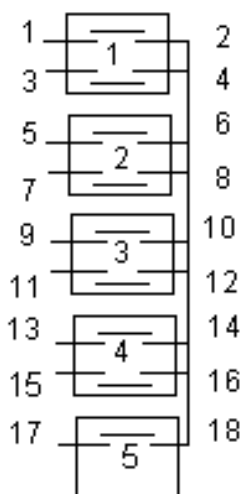


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	X	X	-	-	-	-
3 – 4	X	X	-	-	-	-	-
5 – 6	X	-	-	-	-	-	-
7 – 8	-	-	-	X	X	X	-
9 – 10	-	-	X	X	X	-	-
11 – 12	-	X	X	X	-	-	-
13 – 14	-	-	-	-	-	-	X
15 – 16	-	-	-	-	-	X	X
17 – 18	-	-	-	-	X	X	X
Маркировка	5	6	7	1	2	3	4

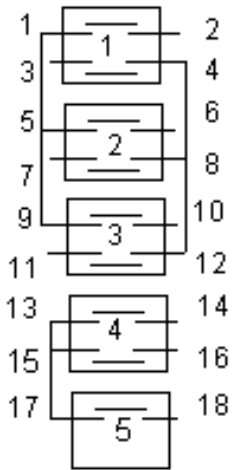


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	-	-	X
13 - 14	X	-	-
15 - 16	-	X	-
17 - 18	-	-	X
Маркировка	1	2	3

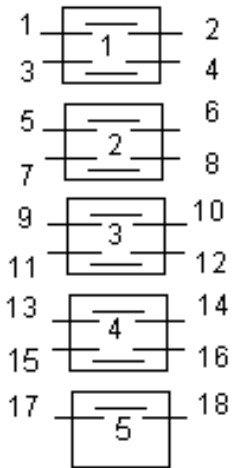


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	-	X	X	-
3 - 4	-	-	X	X	-
5 – 6	-	-	X	X	-
7 – 8	X	X	-	-	-
9 – 10	X	X	-	-	-
11 - 12	X	-	-	-	-
13 - 14	X	-	-	-	-
15 - 16	-	-	-	X	-
17 - 18	-	-	-	X	-
Маркировка	5	4	3	2	1

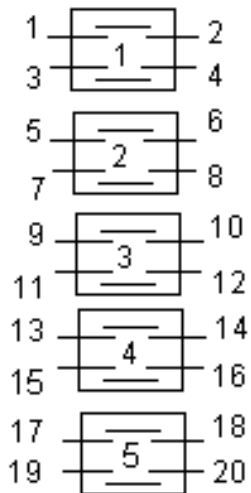


Соединяемые контакты	Способ фиксации: Д (без ограничения хода рукоятки)			
	Положение рукоятки			
	-90 <sup>0</sup>	0 <sup>0</sup>	+90 <sup>0</sup>	+180 <sup>0</sup>
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	X	-	-	-
13 - 14	-	X	-	-
15 - 16	-	X	-	-
17 - 18	-	-	X	-
19 - 20	-	-	X	-
Маркировка	4	1	2	3

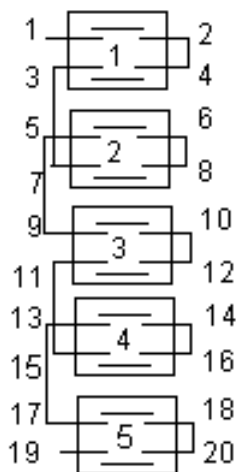


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	-	X	-	X	-	X	-	X
3 - 4	X	-	X	-	X	-	X	-
5 - 6	-	-	X	X	-	-	X	X
7 - 8	-	X	-	X	-	X	-	X
9 - 10	X	X	-	-	X	X	-	-
11 - 12	-	-	X	X	-	-	X	X
13 - 14	X	X	X	X	-	-	-	-
15 - 16	-	-	-	-	X	X	X	X
17 - 18	-	-	-	-	X	X	X	X
19 - 20	X	X	X	X	X	X	X	-
Маркировка	6	7	8	1	2	3	4	5

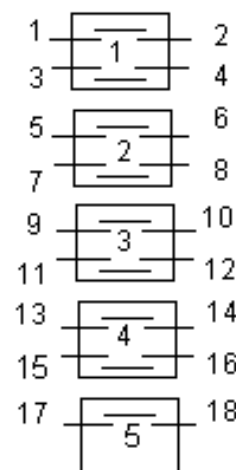

Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 - 2	-	X	-	-
3 - 4	-	-	X	-
5 - 6	-	-	-	X
7 - 8	-	-	-	X
9 - 10	-	-	X	-
11 - 12	-	X	-	-
13 - 14	-	X	-	-
15 - 16	-	-	X	-
17 - 18	-	-	-	X
Маркировка	0	1	2	3

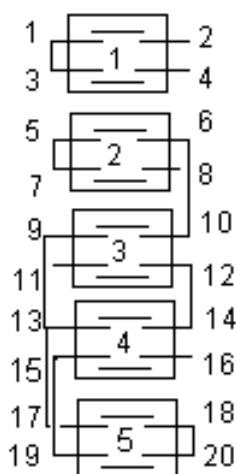


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
17 - 18	-	-	X
19 - 20	X	-	-
Маркировка	2	0	1

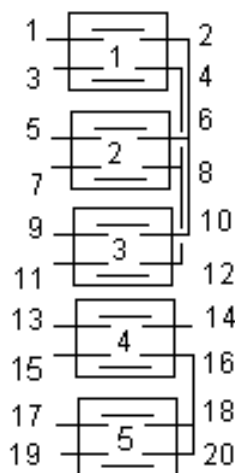

Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0°	+45°	+90°	+135°
1 – 2	-	X	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	X	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 – 14	X	-	-	-
15 – 16	-	X	-	-
17 – 18	-	-	X	-
19 – 20	-	-	-	X
Маркировка	0	1	2	3

(9)

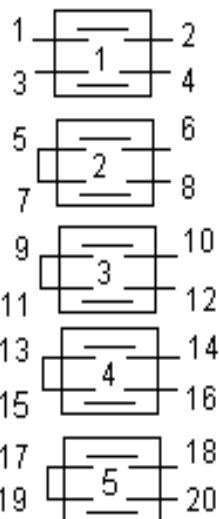


Соединяемые контакты	Способ фиксации: А		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	X
7 – 8	X	-	-
9 – 10	-	X	X
11 – 12	X	-	-
13 – 14	X	X	-
15 – 16	-	-	X
17 – 18	X	X	-
19 – 20	-	-	X

В скобках номера контактов ПМОВ 115566/Д60

(13)

(17)

(21)

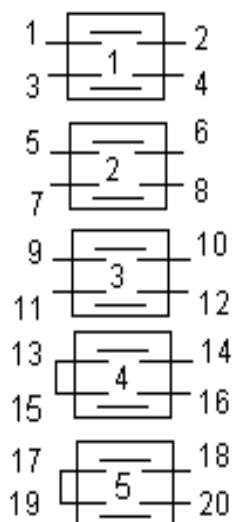

Соединяемые контакты	Способ фиксации: А		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	X	X
15 – 16	X	-	-
17 – 18	X	X	-
19 – 20	-	-	X
Маркировка	3	1	2

Стр.

05-36

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

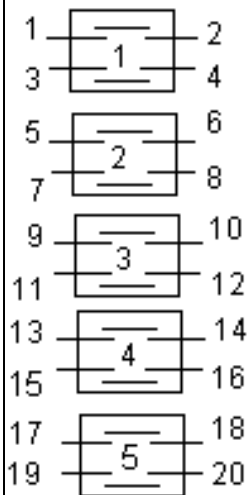


Соединяемые контакты	Способ фиксации: <b>Н</b>							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	-	-	-	X	-	-	-	-
3 - 4	-	-	-	X	X	-	-	-
5 - 6	-	-	-	-	X	X	X	X
7 - 8	X	-	-	-	-	-	-	X
9 - 10	-	-	-	-	X	X	X	X
11 - 12	X	X	X	-	-	-	-	-
13 - 14	X	-	-	X	X	X	-	X
15 - 16	-	-	X	-	-	X	-	X
17 - 18	X	X	-	-	-	-	-	X
19 - 20	X	X	X	-	X	X	X	X
Маркировка	6	7	8	1	2	3	4	5

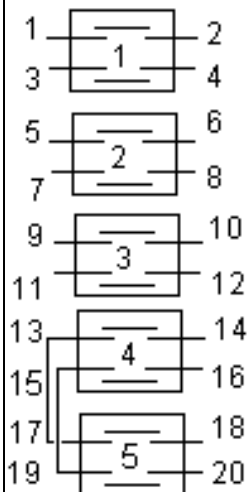


Соединяемые контакты	Способ фиксации: <b>У</b>			
	Положение рукоятки			
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	X	-	X	X
11 - 12	-	-	-	X
13 - 14	-	-	X	X
15 - 16	X	-	X	X
17 - 18	X	-	-	-
19 - 20	-	-	X	X
Маркировка	3	0	1	2

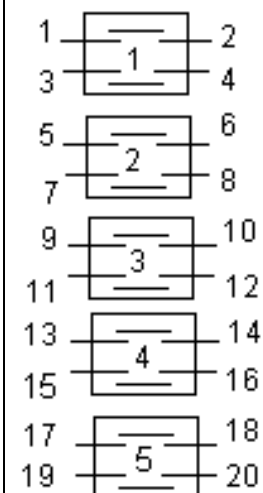


Соединяемые контакты	Способ фиксации: <b>А, С</b>		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	-	X	-
3 - 4	-	X	-
5 - 6	X	-	-
7 - 8	X	-	-
9 - 10	-	X	-
11 - 12	-	X	-
13 - 14	-	X	-
15 - 16	-	X	-
17 - 18	-	-	X
19 - 20	-	-	X
Маркировка	3	1	2

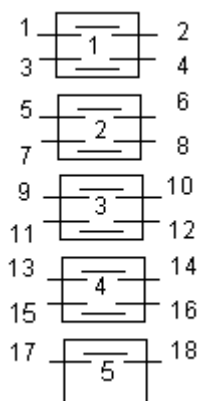


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	-	-	-	-	-	-
3 – 4	X	X	-	-	-	-	-
5 – 6	X	X	X	-	-	-	-
7 – 8	-	X	X	X	-	-	-
9 – 10	-	-	X	X	X	-	-
11 – 12	-	-	-	X	X	X	-
13 – 14	-	-	-	-	X	X	X
15 – 16	-	-	-	-	-	X	X
17 – 18	-	-	-	-	-	-	X
Маркировка	1	2	3	4	5	6	7

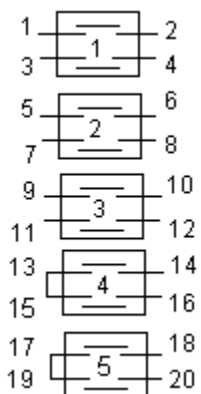


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	X	-
11 – 12	-	X	-
13 - 14	X	-	-
15 - 16	-	-	X
17 - 18	X	-	-
19 - 20	-	-	X
Маркировка	1	2	3

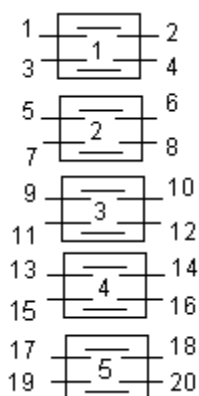


Соединяемые контакты	Способ фиксации: А,С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 - 14	X	-	-
15 - 16	X	-	-
17 - 18	-	-	X
19 - 20	-	-	X
Маркировка	1	2	3

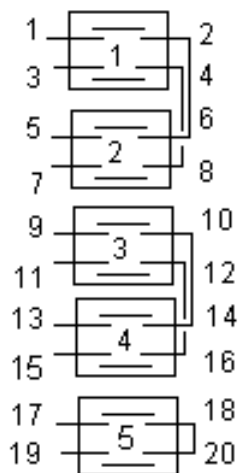


5126 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 <sup>0</sup>	0 <sup>0</sup>	+90 <sup>0</sup>
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
Маркировка	2	0	1

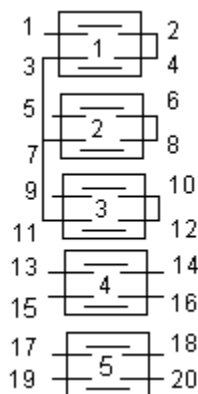


5127 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 – 2	-	-	X
3 – 4	X	X	-
5 – 6	-	-	X
7 – 8	X	X	-
9 – 10	-	-	X
11 – 12	X	X	-
13 – 14	X	X	-
15 – 16	X	X	-
17 – 18	X	X	-
19 – 20	-	X	X
Маркировка	1	2	3

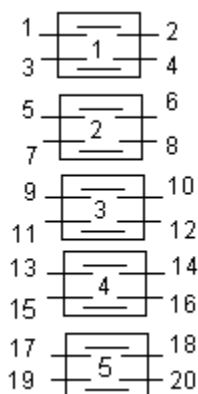

5128 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>
1 – 2	X	-	-	-	-	X	X
3 – 4	-	-	-	-	X	-	-
5 – 6	-	X	-	-	-	-	-
7 – 8	-	-	-	-	-	X	-
9 – 10	-	-	X	-	-	-	-
11 – 12	-	-	-	-	-	-	X
13 – 14	-	-	-	X	-	-	-
15 – 16	X	X	X	-	-	-	-
17 – 18	-	-	-	X	X	-	-
19 – 20	-	-	-	-	-	X	X
Маркировка	1	2	3	4	5	6	7

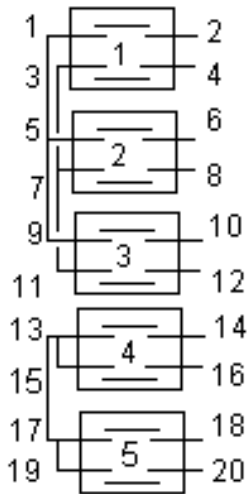

Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 <sup>0</sup>	-90 <sup>0</sup>	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>	+90 <sup>0</sup>	+135 <sup>0</sup>	+180 <sup>0</sup>
1 - 2	X	X	-	-	-	-	-	-
3 - 4	X	X	X	-	-	-	-	-
5 - 6	-	-	X	X	X	-	-	-
7 - 8	-	-	-	X	X	X	-	-
9 - 10	-	-	-	-	-	X	X	X
11 - 12	-	-	-	-	-	-	X	X
13 - 14	-	X	X	X	-	-	-	-
15 - 16	X	-	-	-	-	-	-	-
17 - 18	-	-	-	-	X	X	X	-
19 - 20	-	-	-	-	-	-	-	X
Маркировка	6	7	8	1	2	3	4	5

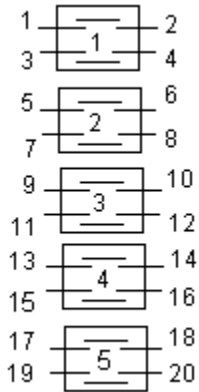

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 <sup>0</sup>	0 <sup>0</sup>	+45 <sup>0</sup>
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	X	-
11 - 12	-	X	X
13 - 14	X	-	-
15 - 16	-	X	X
17 - 18	X	-	-
19 - 20	X	-	X
Маркировка	3	1	2