




4001 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0°	←	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	X	X	-	-
9 - 10	X	X	-	-
11 - 12	X	X	-	-
13 - 14	-	X	X	
15 - 16	X	-	-	X

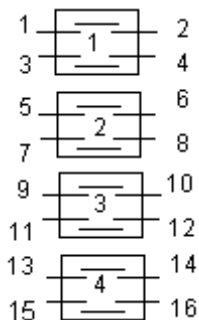


4002 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0°	←	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	X	X	-	-
9 - 10	X	X	-	-
11 - 12	-	X	X	-
13 - 14	-	-	-	X
15 - 16	X	-	-	-

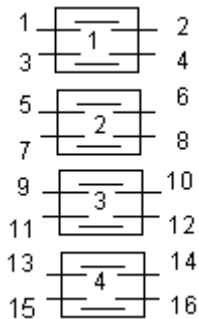


4003 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0°	←	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	X	X	-	-
9 - 10	-	X	X	-
11 - 12	-	-	-	X
13 - 14	-	-	-	X
15 - 16	X	-	-	-

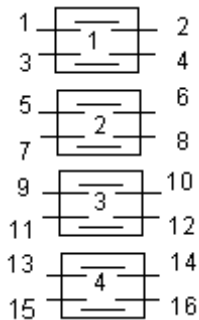


4004 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	→ 0°	←	+45°
1 - 2	X	X	X	-
3 - 4	-	-	-	X
5 - 6	-	-	-	X
7 - 8	-	-	X	X
9 - 10	-	-	X	X
11 - 12	X	X	-	-
13 - 14	X	-	-	-
15 - 16	X	-	-	-

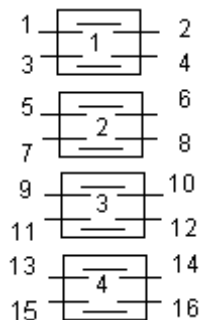


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	0°	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	X	X	-	-
7 - 8	-	X	X	-
9 - 10	-	-	-	X
11 - 12	-	-	-	X
13 - 14	X	-	-	-
15 - 16	X	-	-	-

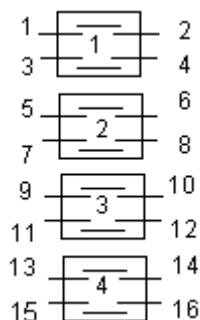


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	0°	+45°
1 - 2	X	X	X	-
3 - 4	-	X	X	X
5 - 6	-	X	X	X
7 - 8	-	-	X	X
9 - 10	X	X	-	-
11 - 12	-	X	X	-
13 - 14	-	-	-	X
15 - 16	X	-	-	-

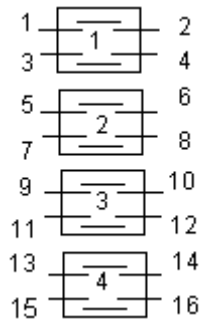


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	0°	+45°
1 - 2	X	-	-	-
3 - 4	-	-	-	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 - 10	X	X	-	-
11 - 12	X	X	-	-
13 - 14	X	X	-	-
15 - 16	-	X	X	-

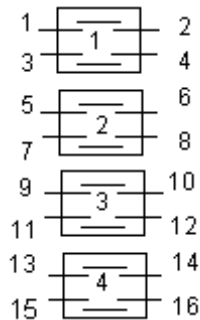


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	0°	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	X	X	-	-
7 - 8	-	X	X	-
9 - 10	-	X	X	-
11 - 12	-	-	-	X
13 - 14	-	-	-	X
15 - 16	X	-	-	-

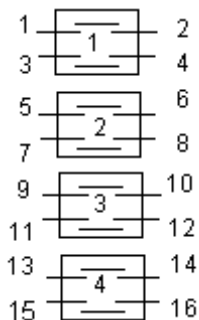


4011 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-	-
3 – 4	-	-	X	X
5 – 6	X	X	-	-
7 – 8	-	-	X	X
9 – 10	X	-	-	X
11 - 12		X	X	
13 - 14	X	-	-	X
15 – 16	-	X	X	-
Маркировка	3	4	1	2

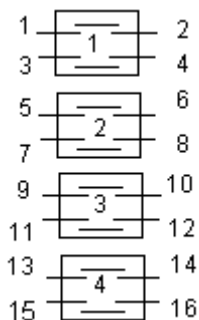


4012 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	X
5 - 6	X	-	X
7 - 8	X	-	X
9 – 10	X	-	X
11 - 12	-	-	X
13 - 14	-	X	-
15 – 16	-	X	-
Маркировка	3	1	2

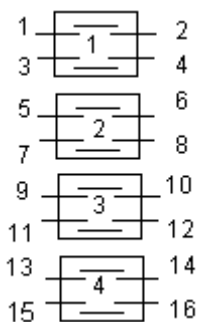


4013 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 – 6	X	-	-	X	X
7 – 8	X	X	-	-	X
9 – 10	-	-	-	X	X
11 - 12	X	X	-	-	-
13 - 14	X	X	-	-	-
15 – 16	-	-	-	X	X
Маркировка	3	4	0	1	2

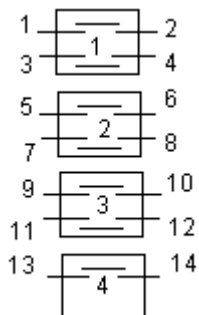


4015 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-	-
3 - 4	-	-	-	X	-
5 – 6	X	-	-	-	X
7 – 8	X	X	-	X	X
9 – 10	-	X	-	X	-
11 - 12	-	-	-	-	X
13 - 14	X	-	X	-	-
Маркировка	4	5	1	2	3

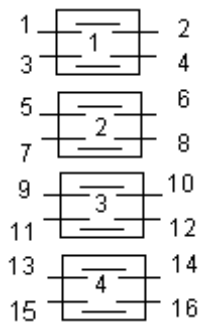


4016 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	-	-	-	X	-	-	-
3 - 4	-	-	-	X	-	-	-
5 - 6	-	-	-	-	X	-	-
7 - 8	X	X	X	-	X	X	X
9 - 10	-	-	-	-	X	X	X
11 - 12	X	X	X	-	-	-	-
13 - 14	X	X	-	-	-	X	X
15 - 16	X	-	-	-	-	-	X
Маркировка	5	6	7	1	2	3	4

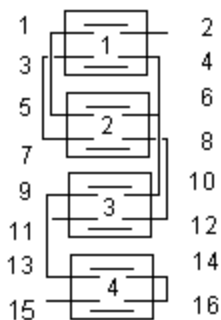


4017 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	X	-	X
13 - 14	-	-	X
15 - 16	X	-	X
Маркировка	2	0	1

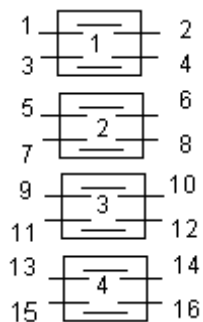


4018 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-
3 - 4	-	X	-
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	X	-	-
13 - 14	-	X	-
15 - 16	X	-	X
Маркировка	3	1	2

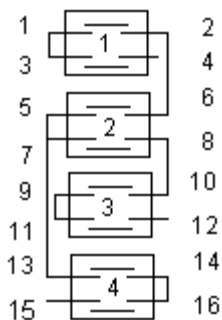


4019 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
Маркировка	2	0	1

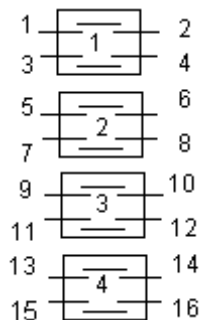


4020 Соединяемые контакты	Способ фиксации: Б, И	
	Положение рукоятки	
	0°	+45°
1 - 2	X	-
3 - 4	X	-
5 - 6	X	-
7 - 8	X	-
9 - 10	X	-
11 - 12	X	-
13 - 14	X	-
15 - 16	X	-
Маркировка	1	0

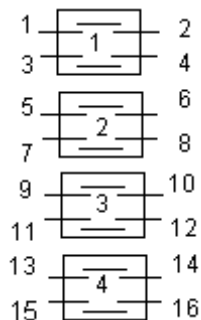


4021 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	X	X
3 - 4	X	-	-
5 - 6	X	X	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	X	X
13 - 14	-	-	X
15 - 16	X	-	-
Маркировка	3	1	2

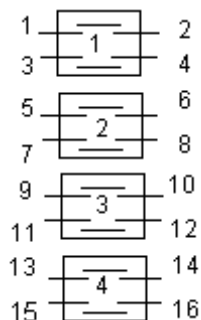


4022 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	-	-	-	X
7 - 8	X	-	-	-	-
9 - 10	-	X	-	-	-
11 - 12	-	-	-	X	-
13 - 14	-	-	-	X	-
15 - 16	-	X	-	-	-
Маркировка	3	4	0	1	2

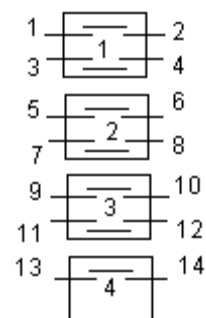


4024 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 - 2	X	X	-	-
3 - 4	X	-	X	-
5 - 6	X	X	-	-
7 - 8	X	-	X	-
9 - 10	X	X	-	-
11 - 12	-	-	X	-
13 - 14	X	X	X	-
Маркировка	2	3	1	0

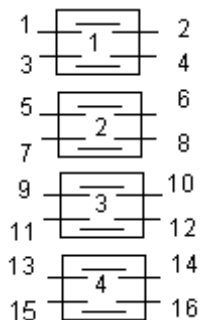


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	X	-
3 - 4	-	-	X
5 - 6	X	X	-
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	X	X
Маркировка	3	1	2

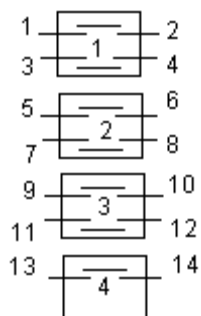


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	X	X	X	X	X	X	-
3 - 4	-	X	X	X	X	X	X	-
5 - 6	-	-	X	X	X	X	X	-
7 - 8	-	-	-	X	X	X	X	-
9 - 10	-	-	-	-	X	X	X	-
11 - 12	-	-	-	-	-	X	X	-
13 - 14	-	-	-	-	-	-	X	-
Маркировка	6	7	8	1	2	3	4	5

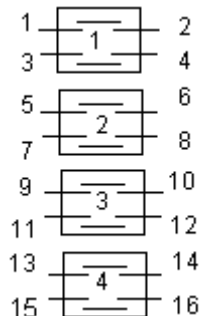


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	X	-	-
9 - 10	-	X	-
11 - 12	-	X	-
13 - 14	-	X	-
15 - 16	-	X	-
Маркировка	3	1	2

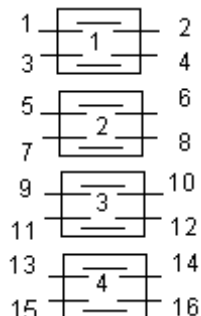


Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
Маркировка	2	0(-)	1

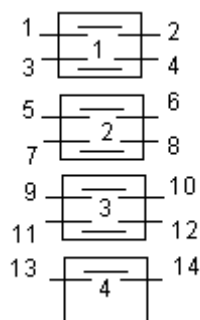


4030 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	X
3 – 4	-	-	X	-
5 – 6	X	-	-	X
7 – 8	-	-	X	-
9 – 10	-	-	-	X
11 - 12	X	-	-	-
13 - 14	X	-	-	X
Маркировка	3	0	1	2

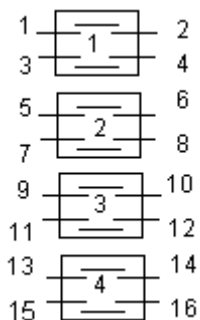


4031 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 - 16	X	-	-	-
Маркировка	3	4	1	2

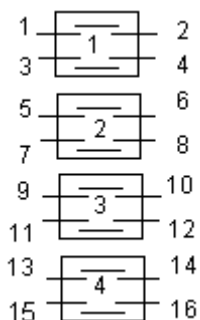


4032 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-
3 - 4	-	X	-
5 - 6	-	-	X
7 - 8	-	-	X
9 – 10	X	-	-
11 - 12	X	-	-
13 - 14	X	-	X
15 – 16	X	-	X
Маркировка	3	1	2

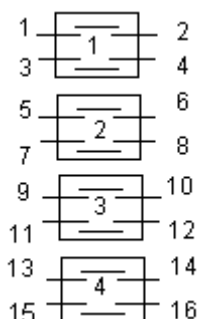


4034 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	-	-	-
3 - 4	-	-	-	X	X
5 – 6	X	X	-	-	-
7 – 8	-	-	-	X	X
9 – 10	X	-	-	-	X
11 - 12	X	-	-	-	X
13 - 14	-	X	-	X	-
15 – 16	-	X	-	X	-
Маркировка	3	4	0	1	2

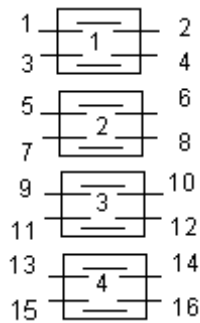


4036 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	X	-	-
13 - 14	X	-	-
15 - 16	X	-	X
Маркировка	2	0	1

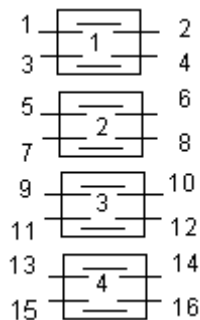


4037 Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	X	-	-
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	-	-	X
15 - 16	-	-	X
Маркировка	2	0(-)	1

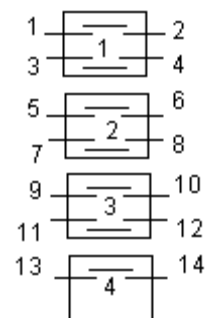


4038 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	-	-	X
Маркировка	2	0	1

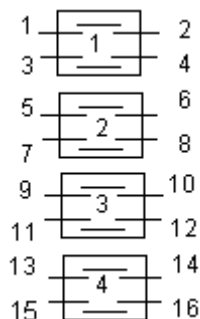


4040 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	X	X	-
3 - 4	-	-	-	X	-
5 - 6	-	X	X	X	-
7 - 8	-	-	-	X	-
9 - 10	-	X	X	-	-
11 - 12	X	-	-	-	X
13 - 14	-	X	-	-	-
15 - 16	-	-	X	-	-
Маркировка	4	5	1	2	3

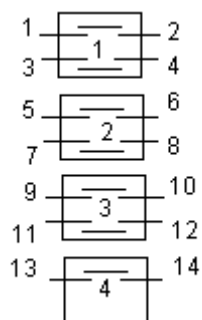


4041 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	-
3 – 4	-	X	-	-
5 – 6	-	-	X	X
7 – 8	-	-	-	X
9 – 10	-	-	X	-
11 – 12	-	X	X	-
13 – 14	X	X	-	X
Маркировка	4	1	2	3

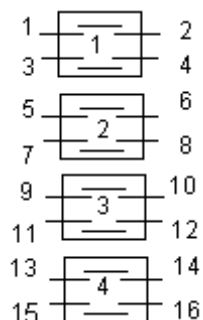


4042 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	X	-	-
5 - 6	-	X	X
7 - 8	X	-	-
9 – 10	X	X	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	X	-
Маркировка	3	1	2

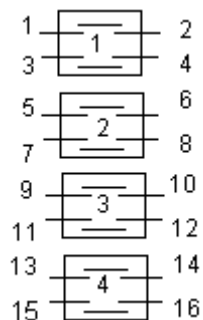


4043 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	X	-	-	-
7 – 8	-	X	-	-
9 – 10	X	-	-	-
11 – 12	-	-	X	X
13 – 14	-	X	X	-
15 - 16	-	X	X	X
Маркировка	3	4	1	2

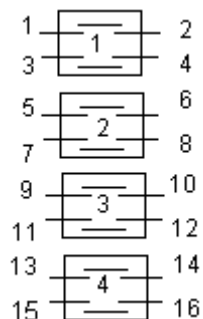


4044 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X	X
3 – 4	X	-	-	-
5 – 6	-	X	X	X
7 – 8	X	-	-	-
9 – 10	-	X	X	X
11 – 12	X	-	-	-
13 – 14	-	X	-	-
15 - 16	-	-	-	X
Маркировка	3	4	1	2

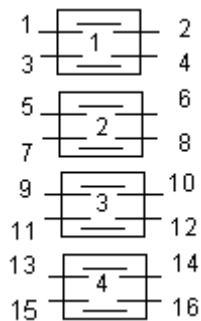


4045 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X	X
3 - 4	-	X	X	X
5 - 6	-	-	X	-
7 - 8	X	-	-	-
9 - 10	X	-	-	-
11 - 12	-	X	-	-
13 - 14	-	X	-	-
15 - 16	-	-	-	X
Маркировка	3	4	1	2

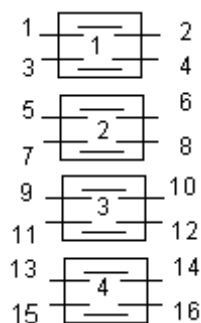


4046 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X	X
3 - 4	-	-	X	-
5 - 6	-	X	X	-
7 - 8	-	X	-	-
9 - 10	-	-	-	X
11 - 12	X	-	-	-
13 - 14	X	-	-	-
15 - 16	X	-	-	-
Маркировка	3	4	1	2

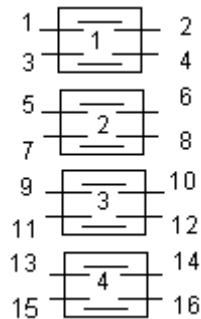


4047 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-	-
3 - 4	-	-	X	-
5 - 6	-	X	-	-
7 - 8	-	-	-	X
9 - 10	-	-	-	X
11 - 12	-	X	-	-
13 - 14	-	-	X	-
15 - 16	-	-	-	X
Маркировка	3	4	1	2

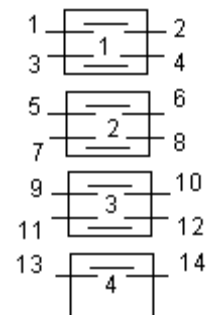


4048 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	X	-
3 - 4	-	X	X
5 - 6	-	-	X
7 - 8	-	X	-
9 - 10	-	-	X
11 - 12	-	X	-
13 - 14	-	-	X
Маркировка	3	1	2

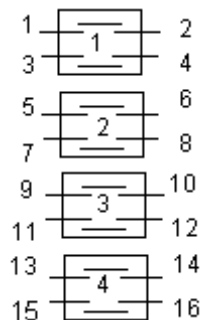


4049 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	-	X	-	-	-
3 - 4	-	-	-	X	-
5 - 6	X	-	-	-	-
7 - 8	-	-	-	-	X
9 - 10	-	-	X	-	-
11 - 12	X	X	-	X	-
13 - 14	X	X	-	X	-
15 - 16	X	X	-	X	-
Маркировка	4	5	1	2	3

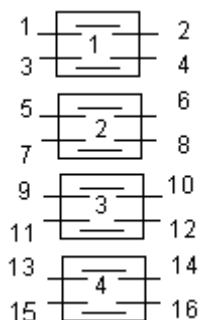


4050 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	-
3 - 4	-	X	X	X	X
5 - 6	X	X	-	-	-
7 - 8	-	-	X	X	X
9 - 10	X	-	X	-	-
11 - 12	-	-	-	X	X
13 - 14	X	-	-	X	-
15 - 16	-	-	-	-	X
Маркировка	4	5	1	2	3

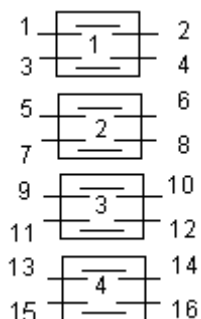


4051 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	-	X	-	-	-
3 - 4	X	-	-	-	-	-	-	-
5 - 6	-	-	-	-	-	X	-	-
7 - 8	-	X	-	-	-	-	-	-
9 - 10	-	-	-	-	-	-	X	-
11 - 12	-	-	X	-	-	-	-	-
13 - 14	-	-	-	-	-	-	-	X
15 - 16	-	-	-	X	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

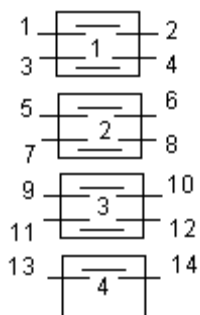


4052 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 - 2	-	-	X	-	-	-	-
3 - 4	-	-	-	X	-	-	-
5 - 6	-	-	-	-	X	-	-
7 - 8	-	-	-	-	-	X	-
9 - 10	-	-	-	-	-	-	X
11 - 12	X	-	-	-	-	-	-
13 - 14	X	X	X	X	X	X	-
Маркировка	5	6	7	1	2	3	4

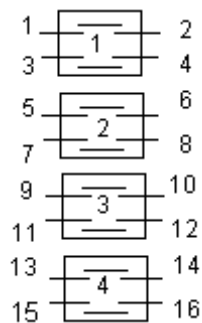


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	X	-	-
5 – 6	-	-	-	X
7 – 8	X	-	-	-
9 – 10	-	-	X	-
11 – 12	-	-	X	-
13 – 14	X	X	-	X
15 – 16	X	-	X	X
Маркировка	4	1	2	3

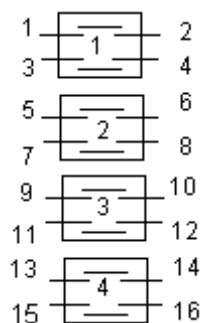


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-	-
3 - 4	-	-	X	-	-
5 – 6	X	-	-	-	X
7 – 8	X	-	-	-	X
9 – 10	X	X	-	-	-
11 - 12	-	-	-	X	X
13 - 14	X	X	-	-	-
15 – 16	-	-	-	X	X
Маркировка	4	5	1	2	3

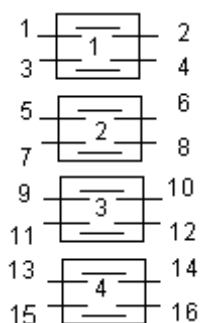


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-	-
3 - 4	-	-	-	X	-
5 – 6	-	X	-	-	-
7 – 8	-	-	-	-	X
9 – 10	-	-	X	-	-
11 - 12	-	-	-	X	-
13 - 14	-	X	-	-	-
15 – 16	-	-	-	-	X
Маркировка	0	4	1	2	3

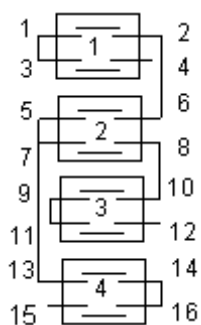


Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 – 2	-	X	-
3 – 4	-	-	X
5 – 6	-	-	X
7 - 8	-	-	X
9 – 10	-	X	-
11 - 12	-	-	X
13 - 14	-	X	-
15 – 16	-	-	X
Маркировка	0	1	2

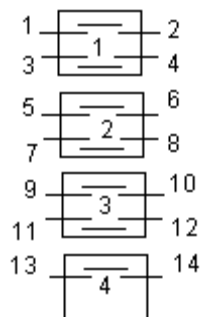


4057 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X	-
3 – 4	-	-	-	X
5 – 6	-	-	-	X
7 – 8	-	X	X	-
9 – 10	-	-	X	X
11 – 12	X	-	-	-
13 – 14	-	X	X	X
Маркировка	3	4	1	2

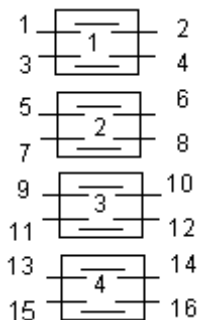


4058 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	-	X	-	-	-
3 – 4	-	-	-	-	-	X	-
5 – 6	-	X	-	X	-	-	-
7 – 8	-	-	-	-	-	-	X
9 – 10	X	-	-	-	-	-	-
11 – 12	X	-	-	-	-	-	-
13 – 14	X	X	X	X	-	-	X
15 - 16	-	X	X	-	-	-	-
Маркировка	3	4	5	6	0	1	2

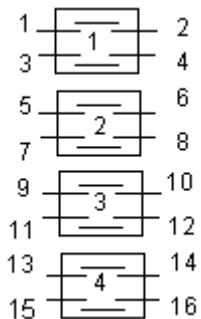


4059 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-	-
3 - 4	-	-	X	-	-
5 – 6	X	-	-	-	X
7 – 8	X	-	-	-	X
9 – 10	-	-	X	-	-
11 - 12	-	X	-	X	-
13 - 14	-	X	-	X	-
15 – 16	-	X	X	X	-
Маркировка	4	5	1	2	3

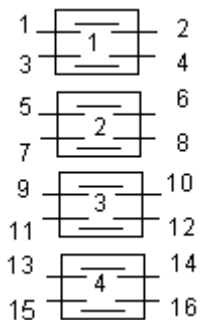


4060 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	X	-
3 - 4	X	X	-
5 - 6	X	X	-
7 - 8	X	X	-
9 – 10	-	X	X
11 - 12	-	X	X
13 - 14	-	X	X
15 - 16	-	X	X
Маркировка	3	1	2

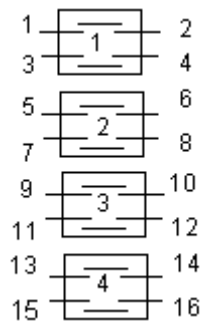


4061 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	X	-
13 - 14	X	-	X
15 - 16	X	-	X
Маркировка	3	1	2

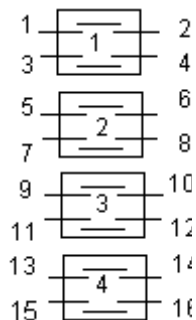


4062 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	X	X	-	X	X	X	X
3 - 4	X	X	X	-	-	X	X	X
5 - 6	X	X	X	-	-	-	X	X
7 - 8	X	X	X	-	-	-	-	X
9 - 10	X	X	X	-	-	-	-	-
11 - 12	-	X	X	-	-	-	-	-
13 - 14	-	-	X	-	-	-	-	-
15 - 16	-	-	-	X	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

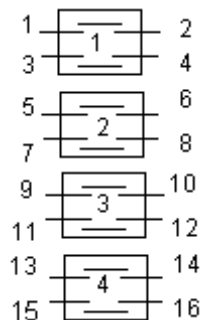


4063 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	-	X	X
3 - 4	-	-	-	X	X
5 - 6	-	X	-	X	-
7 - 8	-	X	-	X	-
9 - 10	X	-	-	X	-
11 - 12	X	-	-	X	-
13 - 14	-	-	-	X	-
15 - 16	X	X	-	X	X
Маркировка	3	4	0	1	2

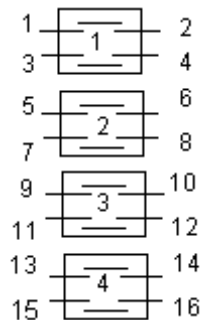


4064 Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	-	-	X
15 - 16	X	-	-
Маркировка	2	0(-)	1

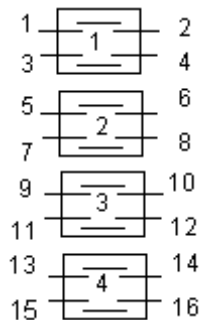


4065 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-	-	-
3 - 4	-	-	-	-	-	-	X
5 - 6	-	X	-	-	-	-	-
7 - 8	-	-	-	-	-	X	-
9 - 10	-	-	X	-	-	-	-
11 - 12	-	-	-	-	X	-	-
13 - 14	-	-	-	X	-	-	-
15 - 16	-	-	-	X	-	-	-
Маркировка	5	6	7	1	2	3	4

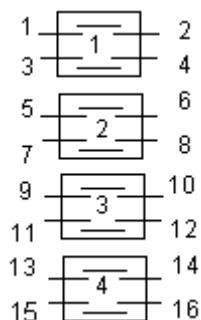


4067 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	X	-
3 - 4	X	-
5 - 6	X	-
7 - 8	X	-
9 - 10	X	-
11 - 12	X	-
13 - 14	-	X
15 - 16	-	X
Маркировка	1	2

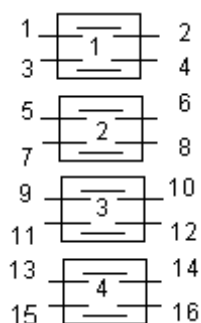


4068 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	-	-	X
5 - 6	X	-	X
7 - 8	-	-	X
9 - 10	X	-	X
11 - 12	-	-	X
13 - 14	X	-	X
15 - 16	-	-	X
Маркировка	2	0	1

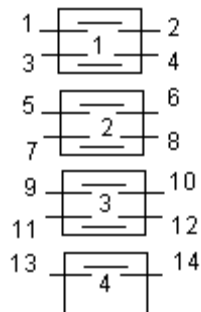


4069 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	X	-
11 - 12	-	X	-
13 - 14	-	X	-
Маркировка	0	1	2

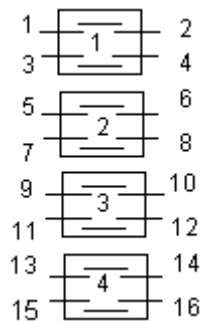


Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	-	X
3 – 4	-	X	X	-
5 – 6	-	-	-	X
7 – 8	-	X	X	-
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 – 16	-	X	-	X
Маркировка	0	3	1	2

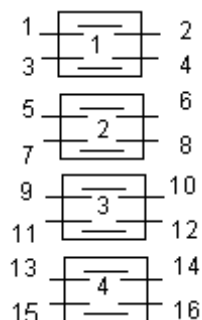


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	X	X
5 – 6	X	-	-
7 – 8	-	X	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	-	-	X
15 – 16	X	X	-
Маркировка	3	1	2

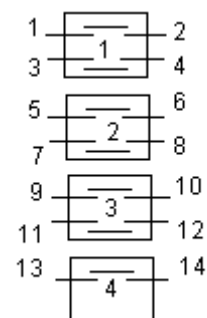


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 – 2	X	-
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
Маркировка	1	2

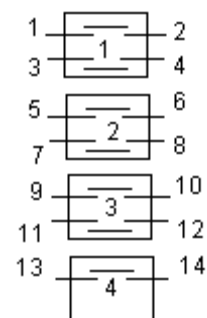


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	X	-
3 - 4	X	-
5 - 6	-	X
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
13 - 14	X	-
Маркировка	1	2

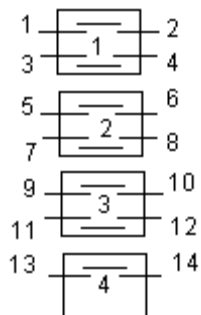


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	X	-	-
5 – 6	-	X	-	X
7 – 8	-	X	-	X
9 – 10	-	-	X	X
11 – 12	-	X	-	-
13 - 14	-	X	X	-
Маркировка	4	1	2	3

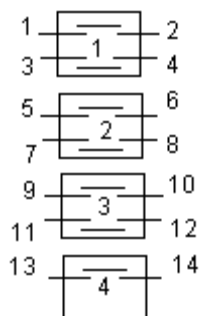


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	X	-	-
5 – 6	-	-	X	X
7 – 8	-	X	-	X
9 – 10	-	X	X	-
11 – 12	-	-	X	X
13 - 14	-	X	-	X
Маркировка	4	1	2	3

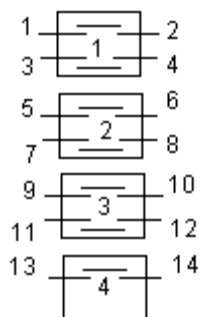


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	X	-	-	-
9 – 10	-	-	X	-
11 – 12	X	-	-	-
13 - 14	-	X	X	X
Маркировка	4	1	2	3

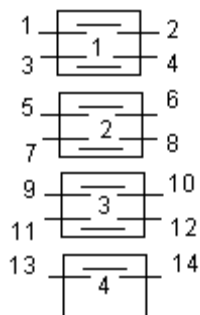


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	X	-	-	-
5 – 6	-	-	X	X
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	X	-
13 - 14	-	X	-	-
Маркировка	4	1	2	3

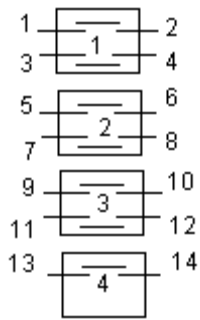


4082 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	X	-	X
3 – 4	-	X	-	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	X	-	X	X
13 - 14	X	X	X	-
Маркировка	4	1	2	3

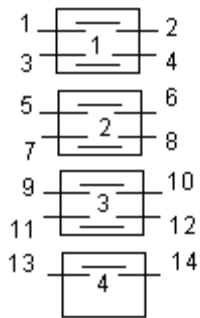


4083 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	-
9 – 10	-	X	-
11 – 12	-	X	-
13 - 14	-	X	-
Маркировка	0	1	2

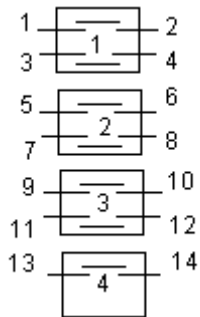


4084 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	X	X	-
3 – 4	-	-	-	X
5 – 6	X	X	X	-
7 – 8	X	X	X	-
9 – 10	X	-	X	-
11 – 12	-	-	-	X
13 - 14	-	X	-	X
Маркировка	4	1	2	3

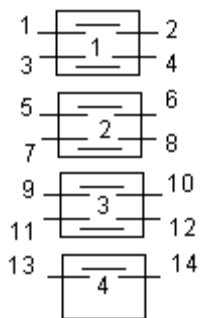


4085 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	X	X	X
5 – 6	X	X	X	-
7 – 8	X	X	X	-
9 – 10	X	-	X	-
11 – 12	X	-	X	-
13 - 14	X	-	-	-
Маркировка	4	1	2	3

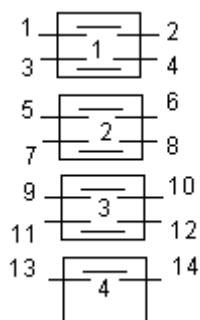


4086 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	X
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	X	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	X
Маркировка	2	0	1

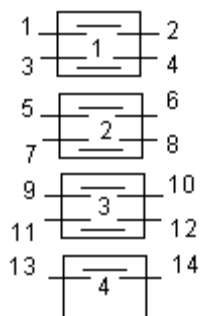


4087 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	X
3 – 4	-	-	X	-
5 – 6	-	-	X	-
7 – 8	-	X	-	X
9 – 10	X	-	-	-
11 – 12	X	-	-	-
13 – 14	-	X	-	X
Маркировка	4	1	2	3

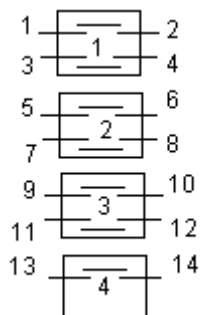


4088 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-
3 – 4	X	X	-	X
5 – 6	-	-	X	-
7 – 8	-	X	-	X
9 – 10	-	-	X	-
11 – 12	-	X	-	X
13 – 14	X	-	X	-
Маркировка	4	1	2	3

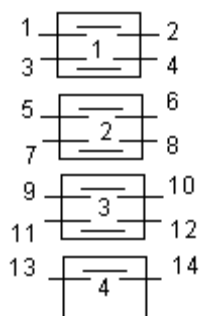


4089 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	-	X	-
5 – 6	X	X	X	-
7 – 8	X	X	X	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 – 14	X	-	X	-
Маркировка	4	1	2	3

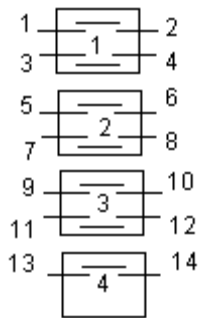


4090 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	-	X	-
5 – 6	X	X	X	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	-	X	-	-
13 - 14	X	-	X	-
Маркировка	4	1	2	3

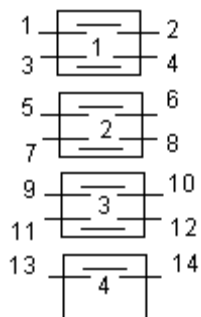


4091 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	-	-	X
5 – 6	X	-	-	-
7 – 8	-	-	X	-
9 – 10	X	-	-	-
11 – 12	-	-	X	-
13 - 14	-	X	-	-
Маркировка	4	1	2	3

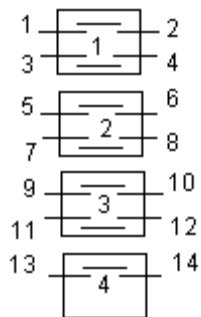


4092 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	-	X	X	-
11 – 12	-	-	X	-
13 – 14	-	X	X	X
Маркировка	0	3	1	2

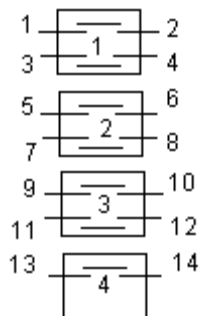


4093 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	X	-	-	-
5 – 6	-	-	-	X
7 – 8	X	-	-	-
9 – 10	-	-	-	X
11 – 12	-	-	X	-
13 - 14	X	X	X	-
Маркировка	4	1	2	3

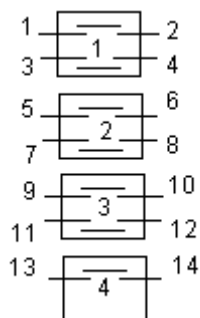


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	X	-
5 – 6	X	X	-	-
7 – 8	-	-	X	-
9 – 10	X	-	-	-
11 – 12	-	X	X	-
13 – 14	X	-	-	-
Маркировка	4	1	2	3

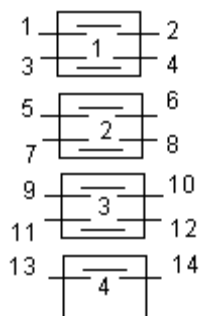


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	X	-	-	-
9 – 10	-	-	X	-
11 – 12	-	X	-	-
13 – 14	-	X	X	-
Маркировка	4	1	2	3

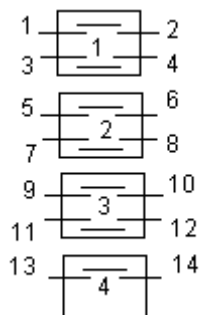


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	X	-	-	-
11 – 12	-	-	X	-
13 – 14	-	X	-	-
Маркировка	4	1	2	3

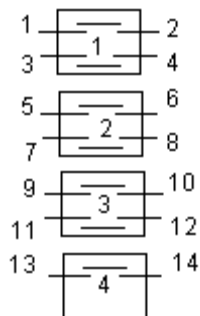


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	-	-	X	-
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	X	-	-
13 – 14	-	-	-	X
Маркировка	0	3	1	2

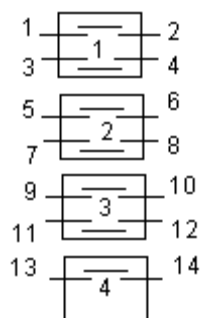


4098 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	-	X
5 – 6	-	-	X	-
7 – 8	-	-	X	-
9 – 10	-	X	-	-
11 – 12	-	X	-	-
13 – 14	-	-	-	X
Маркировка	0	3	1	2

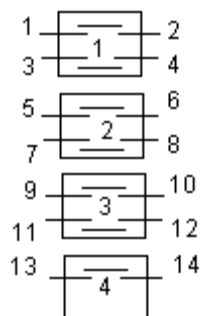


4099 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	X	-	X
3 – 4	-	-	X	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	X	X	X	-
11 – 12	X	X	X	-
13 - 14	X	-	X	X
Маркировка	4	1	2	3

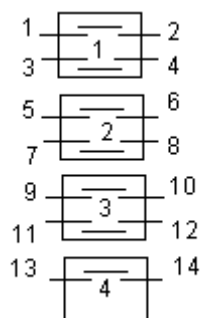


4100 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	-	-	-
5 – 6	-	X	-	-
7 – 8	-	X	-	X
9 – 10	-	-	X	-
11 – 12	X	-	X	-
13 - 14	-	-	-	X
Маркировка	4	1	2	3

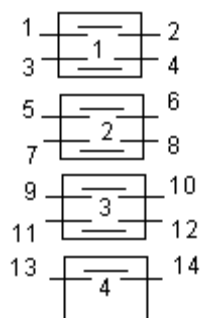


4101 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	X	-	-
5 – 6	X	X	-	-
7 – 8	-	-	X	-
9 – 10	X	-	-	-
11 – 12	-	X	X	-
13 - 14	X	-	-	-
Маркировка	4	1	2	3

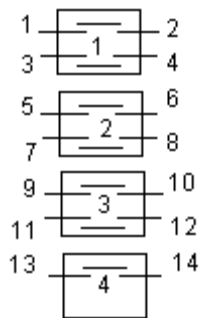


4102 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	-	X
5 – 6	X	X	X	-
7 – 8	X	X	X	-
9 – 10	X	X	X	-
11 – 12	X	X	X	-
13 - 14	-	X	-	-
Маркировка	4	1	2	3

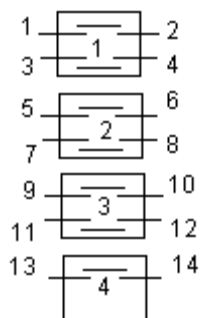


4103 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-
3 – 4	-	-	X	X
5 – 6	X	X	-	-
7 – 8	-	X	-	-
9 – 10	X	-	-	-
11 – 12	-	-	X	-
13 - 14	X	X	X	-
Маркировка	4	1	2	3

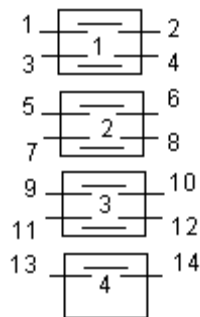


4104 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	-	X	-	-
5 – 6	-	X	-	-
7 – 8	X	-	X	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 - 14	X	-	X	-
Маркировка	4	1	2	3

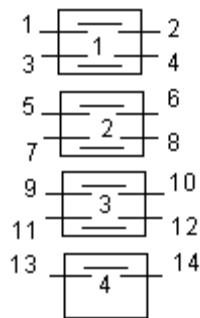


4105 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	X
3 – 4	-	X	-	X
5 – 6	X	X	X	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	X	-	X	-
13 - 14	X	-	X	X
Маркировка	4	1	2	3

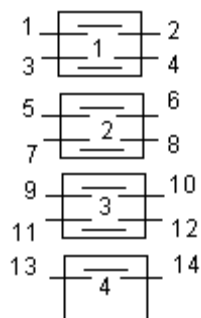


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	X	X	-
5 – 6	X	-	X	-
7 – 8	X	X	X	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 - 14	-	X	-	X
Маркировка	4	1	2	3

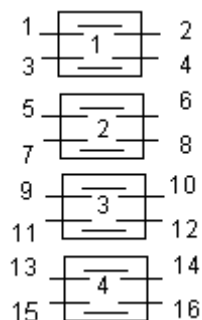


Соединяемые контакты	Способ фиксации: Б, И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 – 2	X	-
3 – 4	X	-
5 – 6	X	-
7 – 8	X	-
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 - 16	-	X
Маркировка	1	2

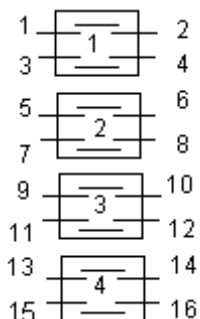


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	-	X
5 – 6	-	-	X	-
7 – 8	-	-	X	-
9 – 10	-	X	-	-
11 – 12	-	X	-	-
13 - 14	X	-	-	-
15 - - 16	X	-	-	-
Маркировка	4	1	2	3

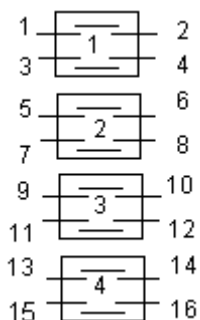


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	X	X	-
3 – 4	X	X	X	-
5 – 6	X	-	X	-
7 – 8	X	X	X	-
9 – 10	-	-	-	X
11 – 12	-	-	X	-
13 - 14	-	-	-	X
15 – 16	-	X	-	-
Маркировка	4	1	2	3

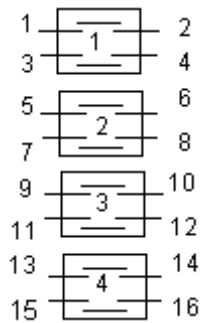


4111 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 - 14	X	X	-
15 - 16	-	X	X
Маркировка	3	1	2

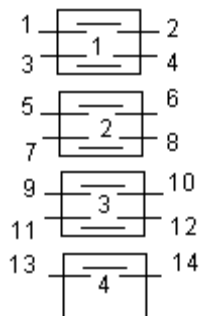


4112 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	X	-	-	X
5 – 6	-	-	X	-
7 – 8	X	X	-	-
9 – 10	-	-	X	X
11 – 12	-	X	X	-
13 - 14	X	-	-	X
Маркировка	4	1	2	3

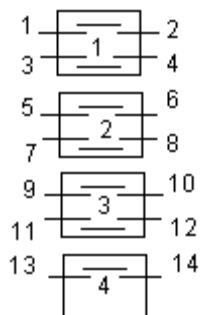


4113 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	-
3 – 4	-	X	X	-
5 – 6	-	-	-	X
7 – 8	-	X	X	-
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 - 14	-	-	X	-
Маркировка	0	1	2	3

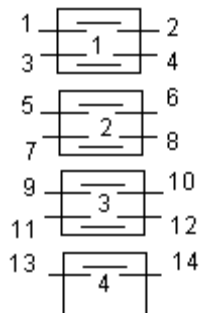


4114 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	-
3 – 4	-	X	-	X
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	-	-	X	-
11 – 12	-	-	-	X
13 - 14	-	X	X	-
Маркировка	0	1	2	3

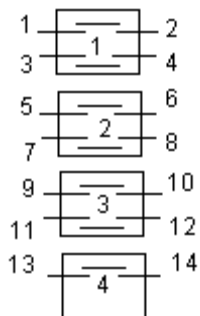


4115 Соединяемые контакты	Способ фиксации: (Е), Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	-	-	X	-
7 - 8	-	-	-	X	X
9 - 10	-	-	-	-	X
11 - 12	X	-	-	-	X
13 - 14	X	-	-	-	-
Маркировка	3(2)	0(-)	0	1(-)	2(1)

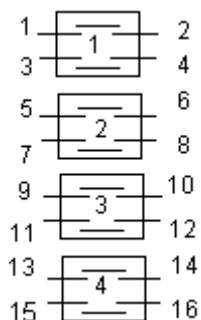


4116 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	-	X	-
7 - 8	-	-	-	X	-
9 - 10	-	X	X	-	-
11 - 12	-	-	X	X	-
13 - 14	-	X	X	X	-
15 - 16	X	-	-	-	X
Маркировка	4	5	1	2	3

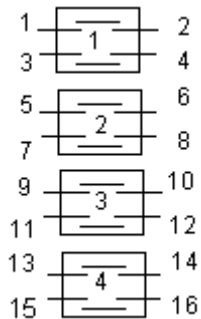


4117 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	X	-
3 - 4	-	X
5 - 6	X	-
7 - 8	-	X
9 - 10	X	-
11 - 12	-	X
13 - 14	X	-
15 - 16	-	X
Маркировка	1	2

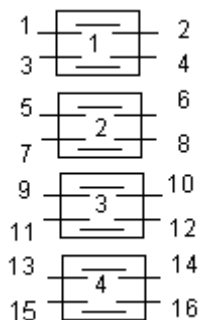


4118 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-
3 - 4	X	-	-	-
5 - 6	X	X	X	-
7 - 8	X	X	X	-
9 - 10	X	X	-	-
11 - 12	X	X	-	-
13 - 14	X	X	-	-
15 - 16	X	X	-	-
Маркировка	4	1	2	3

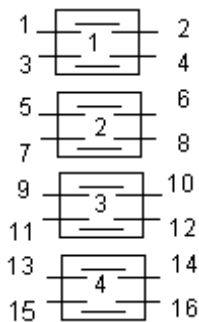


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	X	X	-	X	X	X	X
3 - 4	-	-	X	-	-	-	-	-
5 - 6	-	X	-	-	-	-	-	-
7 - 8	X	-	-	-	-	-	-	-
9 - 10	-	-	-	-	-	X	X	X
11 - 12	X	-	-	-	-	X	-	X
13 - 14	X	-	-	-	-	-	X	X
15 - 16	-	X	X	-	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

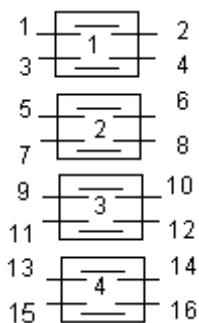


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	-	X
3 - 4	-	X
5 - 6	-	X
7 - 8	-	X
9 - 10	X	-
11 - 12	X	-
13 - 14	-	X
15 - 16	X	-
Маркировка	1	2

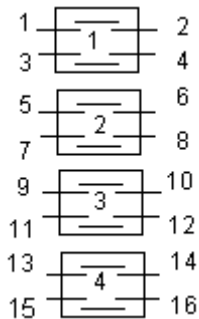


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	-	X
3 - 4	-	X
5 - 6	-	X
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
13 - 14	X	-
15 - 16	X	-
Маркировка	1	2

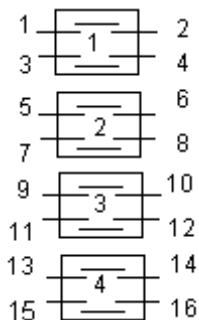


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-	-	-
3 - 4	-	-	-	-	-	-	X
5 - 6	-	X	-	-	-	-	-
7 - 8	-	-	-	-	-	X	X
9 - 10	-	-	-	-	X	-	-
11 - 12	-	-	-	-	X	-	-
13 - 14	-	-	-	-	X	-	-
15 - 16	X	X	X	-	X	X	X
Маркировка	4	5	6	0	1	2	3

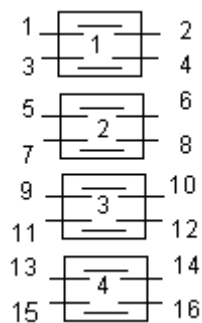


4123 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	X	-	X	X
5 – 6	-	-	X	X
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	X	-
13 – 14	-	-	-	X
15 – 16	-	X	-	-
Маркировка	4	1	2	3

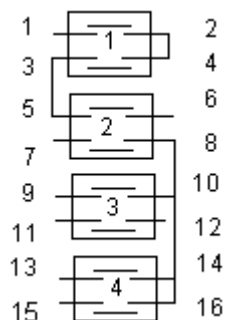


4124 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 – 6	-	-	X	-	-
7 – 8	-	-	-	X	-
9 – 10	-	X	-	-	-
11 - 12	-	-	X	-	-
13 - 14	-	-	-	-	X
15 - 16	X	-	-	-	-
Маркировка	4	5	1	2	3

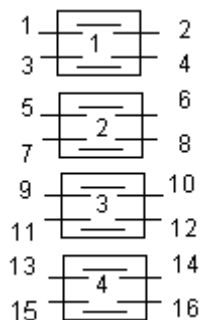


4125 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	X	-	X	X
5 – 6	X	-	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	X	-
13 - 14	-	-	-	X
15 – 16	-	X	-	-
Маркировка	4	1	2	3

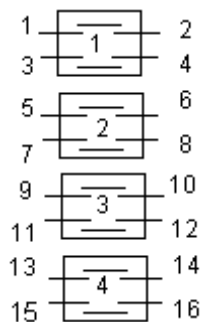


4126 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	X	X	X	-	X	X	X
5 – 6	X	X	X	-	X	X	X
7 – 8	-	-	-	-	X	X	X
9 – 10	X	X	X	-	-	-	-
11 – 12	X	-	-	-	-	-	X
13 – 14	X	-	-	-	-	-	X
15 - 16	X	X	-	-	-	X	X
Маркировка	5	6	7	1	2	3	4

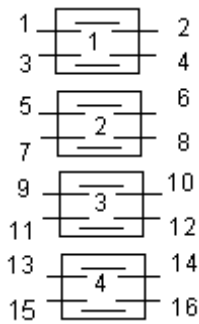


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	-	-	-	-	-	-	X
3 - 4	X	-	-	-	-	-	-	-
5 - 6	-	X	-	-	-	-	-	-
7 - 8	-	-	X	-	-	-	-	-
9 - 10	-	-	-	X	-	-	-	-
11 - 12	-	-	-	-	X	-	-	-
13 - 14	-	-	-	-	-	X	-	-
15 - 16	-	-	-	-	-	-	X	-
Маркировка	6	7	8	1	2	3	4	5

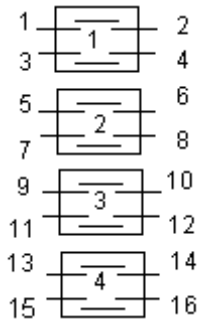


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 - 2	-	X
3 - 4	-	X
5 - 6	-	X
7 - 8	-	X
9 - 10	-	X
11 - 12	-	X
13 - 14	-	X
15 - 16	-	X
Маркировка	0	1

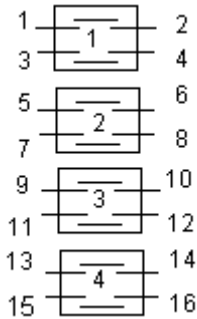


Соединяемые контакты	Способ фиксации: М							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	
1 - 2	-	-	-	X	-	-	-	
3 - 4	X	X	X	-	X	X	X	
5 - 6	-	-	-	-	X	X	X	
7 - 8	X	X	X	-	-	-	-	
9 - 10	X	X	-	-	-	-	X	
11 - 12	-	-	X	-	X	-	-	
13 - 14	-	-	-	X	X	X	X	
15 - 16	X	-	-	X	X	-	X	
Маркировка	5	6	7	1	2	3	4	

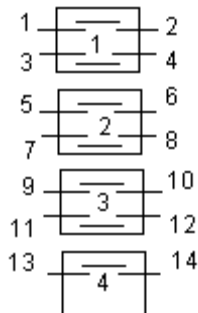


Соединяемые контакты	Способ фиксации: М							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	
1 - 2	X	-	-	-	-	-	-	
3 - 4	-	-	-	-	X	-	-	
5 - 6	-	X	-	-	-	-	-	
7 - 8	-	-	-	-	-	X	-	
9 - 10	-	-	X	-	-	-	-	
11 - 12	-	-	-	-	-	-	X	
13 - 14	-	-	-	X	-	-	-	
Маркировка	1	2	3	4	5	6	7	

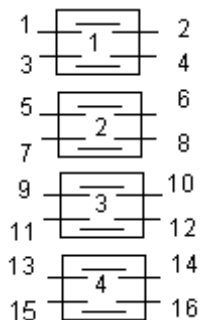


4132 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	X	-	-	-
7 - 8	-	-	-	X	-
9 - 10	-	-	X	-	-
11 - 12	-	-	X	-	-
13 - 14	-	-	X	X	X
15 - 16	X	X	-	-	-
Маркировка	4	5	1	2	3

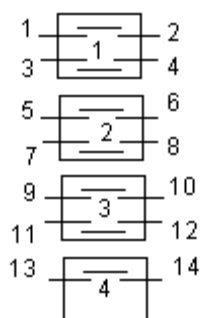

4133 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 - 2	X	-	-	-	-	-
3 - 4	X	X	-	-	-	-
5 - 6	X	X	X	-	-	-
7 - 8	-	-	X	-	-	-
9 - 10	-	-	-	-	X	X
11 - 12	-	-	-	-	-	X
13 - 14	-	-	-	X	-	-
Маркировка	5	6	1	2	3	4

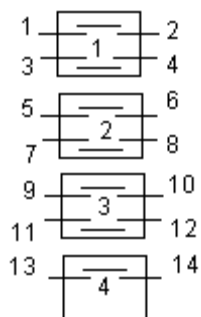

4134 Соединяемые контакты	Способ фиксации: А		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	X
11 - 12	X	-	-
13 - 14	-	-	X
Маркировка	2	0	1

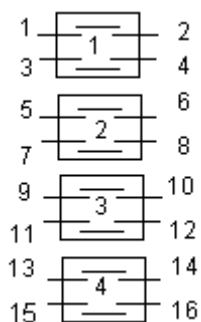

4135 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 - 2	X	-	-	-	-	-
3 - 4	-	X	-	-	-	-
5 - 6	-	-	X	-	-	-
7 - 8	-	-	-	X	-	-
9 - 10	-	-	-	-	X	-
11 - 12	-	-	-	-	X	-
13 - 14	-	-	-	-	-	X
15 - 16	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

Стр.

04-30

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

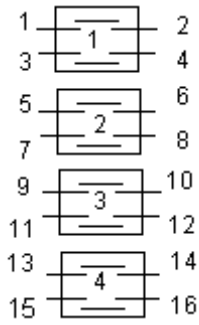


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	X	-
11 – 12	-	-	X
13 – 14	-	-	X
15 – 16	X	-	-
Маркировка	3	1	2

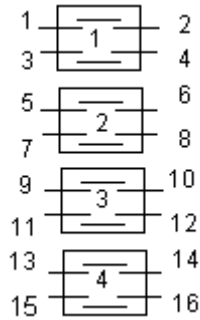


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	X	-	-
3 – 4	-	-	X	X
5 – 6	-	-	X	-
7 – 8	X	X	-	X
9 – 10	X	-	-	-
11 – 12	-	X	X	X
13 – 14	-	X	X	-
15 – 16	X	-	-	X
Маркировка	4	1	2	3

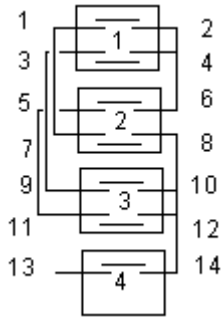


Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	X	-	-	X	-	-
3 – 4	-	X	-	-	X	-
5 – 6	-	-	X	-	-	X
7 – 8	-	-	-	-	-	X
9 – 10	-	-	-	X	-	-
11 – 12	-	-	-	-	X	-
13 – 14	X	X	X	-	-	-
Маркировка	5	6	1	2	3	4

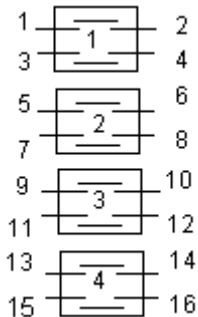


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	X	-	X	-	X	-	-
3 – 4	-	X	X	-	-	X	-
5 – 6	X	X	-	-	-	-	X
7 – 8	-	-	-	-	X	X	X
9 – 10	-	X	-	-	-	-	X
11 – 12	X	-	-	-	-	-	-
13 – 14	-	-	-	-	-	X	-
15 – 16	-	-	-	-	X	-	X
Маркировка	4	5	6	0	1	2	3

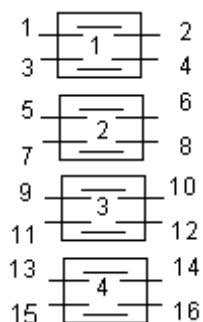


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	-	-	-	-	-	-	-
3 - 4	-	X	-	-	-	-	-	-
5 - 6	-	-	X	-	-	-	-	-
7 - 8	-	-	-	X	-	-	-	-
9 - 10	-	-	-	-	X	-	-	-
11 - 12	-	-	-	-	-	X	-	-
13 - 14	-	-	-	-	-	-	X	-
15 - 16	-	-	-	-	-	-	-	X
Маркировка	6	7	8	1	2	3	4	5

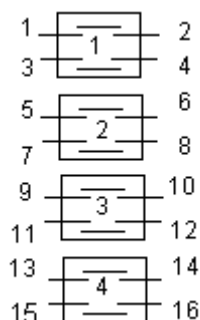

Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	-	X	X
9 - 10	X	-	-	-	X
11 - 12	-	X	X	X	X
13 - 14	X	-	-	-	X
15 - 16	X	X	X	X	-
Маркировка	1	2	3	4	5

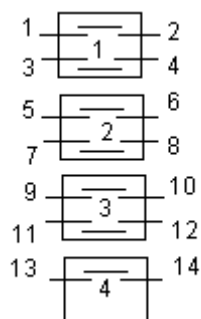

Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	X	-	-
3 - 4	-	-	-	X	-
5 - 6	-	-	X	X	-
7 - 8	-	-	-	-	X
9 - 10	-	X	X	-	X
11 - 12	-	-	-	-	X
13 - 14	-	X	-	-	-
Маркировка	0	4	1	2	3

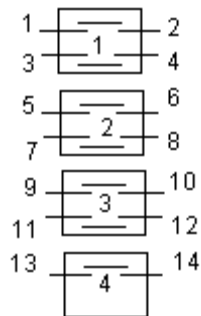

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	X	-	-
13 - 14	X	-	-
Маркировка	2	0	1

Стр.

04-32

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

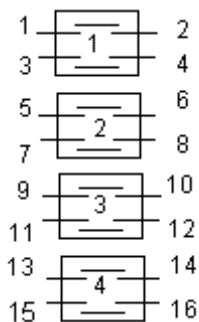


4144 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	-	X	X
9 - 10	-	-	-	-	X
11 - 12	-	X	X	X	X
13 - 14	X	-	-	-	X
15 - 16	X	X	X	X	-
Маркировка	1	2	3	4	5

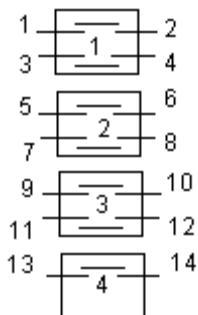


4145 Соединяемые контакты	Способ фиксации: (Е), Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	-	-	-
3 - 4	X	-	-	-	-
5 - 6	-	X	-	-	-
7 - 8	-	-	X	-	-
9 - 10	-	-	-	X	-
11 - 12	-	-	-	-	X
13 - 14	-	-	-	X	X
Маркировка	4	5(-)	1	2(-)	3

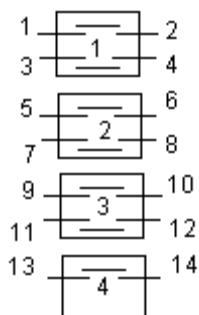


4146 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	X	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	-	-	X
Маркировка	2	0	1

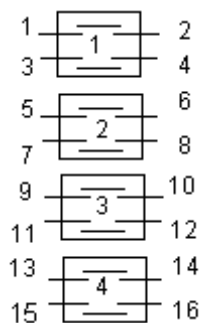


4147 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	X	-	-
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	X	-
13 - 14	X	-	X
15 - 16	X	-	X
Маркировка	3	1	2

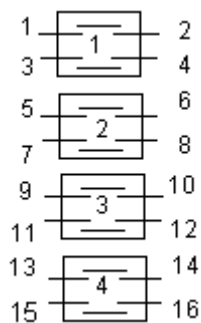


4148 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 - 14	-	X	-
15 - 16	-	X	-
Маркировка	3	1	2

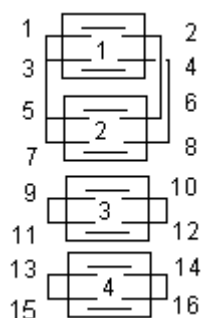


4149 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	X
11 – 12	X	-	X
13 - 14	X	-	X
15 - 16	X	-	X
Маркировка	2	0	1

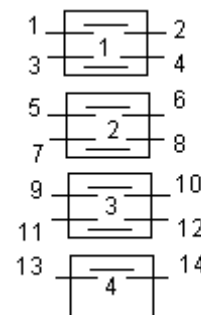


4150 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	X	-
11 – 12	-	-	X
13 - 14	X	-	-
Маркировка	3	1	2

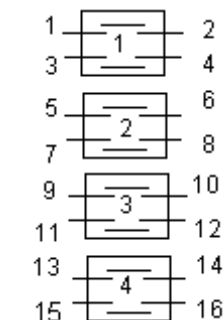


4151 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	X	-
13 – 14	-	-	-	X
15 - 16	-	-	-	X
Маркировка	3	4	1	2

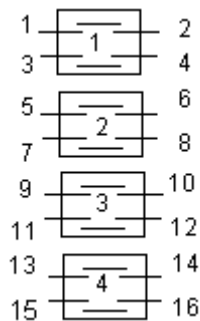


4152 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	X	-	-	-
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	-	X
13 – 14	-	-	X	-
15 – 16	-	-	-	X
Маркировка	4	1	2	3

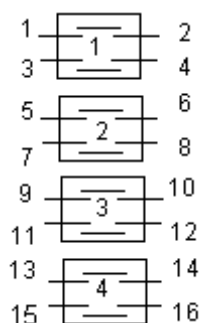


4153 Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0°	+45°	+90°	+135°
1 – 2	-	-	-	X
3 – 4	-	-	-	X
5 – 6	X	X	X	-
7 – 8	X	X	X	-
9 – 10	X	X	X	-
11 – 12	X	X	X	-
13 – 14	-	X	-	-
15 – 16	-	X	-	X
Маркировка	1	2	3	4

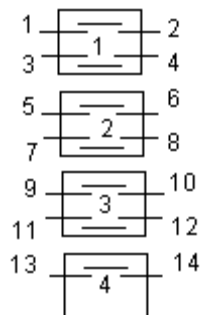


4154 Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0°	+45°	+90°	+135°
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	-	X	X	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	-	-	X	-
13 – 14	-	X	X	X
Маркировка	0	1	2	3

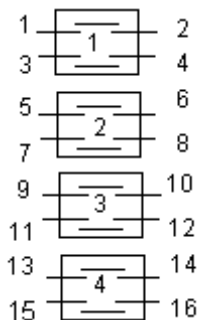


4155 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	-	-	X
3 – 4	-	-	X	-
5 – 6	-	-	-	X
7 – 8	-	-	X	-
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 – 16	-	X	-	-
Маркировка	0	1	2	3

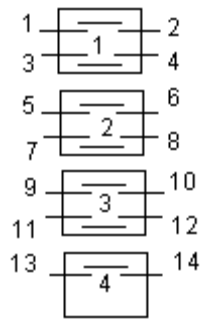


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	X	-	-
3 – 4	-	-	-	X
5 – 6	-	-	-	X
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	-	-	-	X
13 – 14	-	X	-	-
Маркировка	0	1	0	2

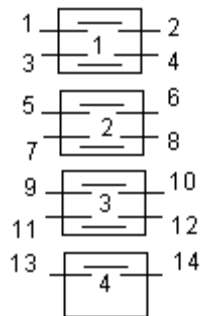


Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0°	+45°	+90°	+135°
1 – 2	-	-	X	X
3 – 4	-	-	X	X
5 – 6	-	X	X	X
7 – 8	-	X	X	X
9 – 10	-	-	X	X
11 – 12	-	-	X	-
13 – 14	-	X	X	X
Маркировка	0	1	2	3

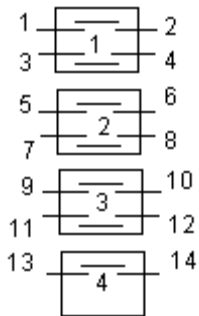


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	X	-	-	-	-	-	-
3 – 4	-	X	-	-	-	-	-
5 – 6	-	-	X	-	-	-	-
7 – 8	-	-	-	X	-	-	-
9 – 10	-	-	-	-	X	-	-
11 – 12	-	-	-	-	-	X	-
13 – 14	-	-	-	-	-	-	X
Маркировка	5	6	7	1	2	3	4

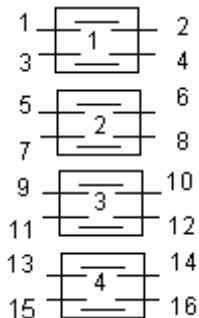


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	-	-	-	X
13 – 14	-	-	-	X
15 – 16	X	-	-	-
Маркировка	3	4	1	2

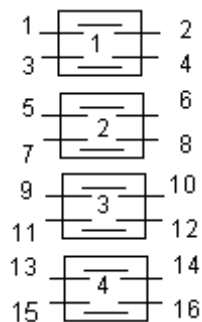


4160 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	X	-	-
5 – 6	-	-	X	X
7 – 8	-	X	-	X
9 – 10	X	X	-	-
11 – 12	-	-	X	X
13 - 14	X	-	X	-
15 - 16	-	X	-	X
Маркировка	1	2	3	4

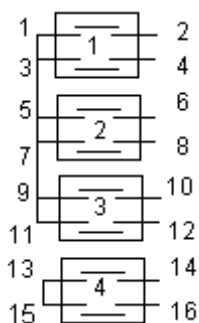


4161 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	X	-	-	-	-	-
3 – 4	-	X	-	-	-	-
5 – 6	-	-	X	-	-	-
7 – 8	-	-	-	X	-	-
9 - 10	-	-	-	-	X	-
11 - 12	-	-	-	-	-	X
13 - 14	X	X	X	X	-	-
15 - 16	-	-	-	-	X	X
Маркировка	5	6	1	2	3	4

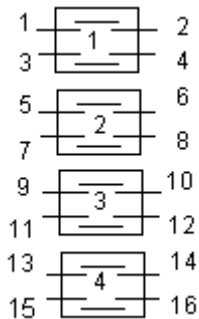


4162 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	X	X	X
5 – 6	-	X	X	X
7 – 8	-	-	X	X
9 – 10	-	-	X	X
11 – 12	-	-	X	X
13 - 14	-	-	X	X
15 - 16	-	-	X	-
Маркировка	0	1	2	3

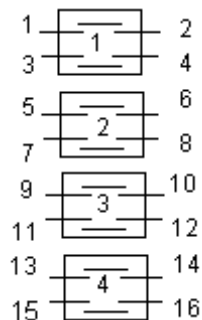


4163 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	-	X	X
5 – 6	-	-	X	-
7 – 8	-	-	X	X
9 – 10	-	X	X	X
11 – 12	-	X	X	X
13 - 14	-	-	X	X
15 - 16	-	-	X	X
Маркировка	0	1	2	3

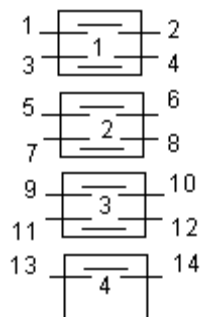


4164 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	X	X	X
5 – 6	-	X	X	X
7 – 8	-	-	X	X
9 – 10	-	-	X	X
11 – 12	-	-	X	-
13 – 14	-	-	X	-
Маркировка	0	1	2	3

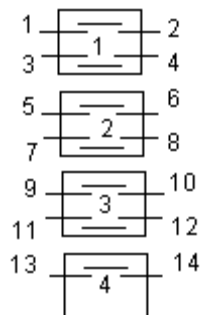

4165 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	X	X
3 – 4	-	X	X	X
5 – 6	-	-	X	-
7 – 8	-	X	-	-
9 – 10	-	X	-	-
11 – 12	-	-	-	X
13 – 14	-	-	-	X
Маркировка	0	1	2	3

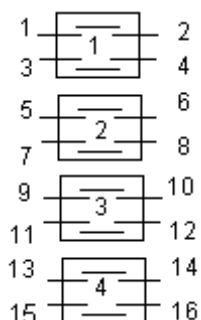

4166 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	-	-	-
3 - 4	-	-	X	-	-
5 – 6	-	-	-	X	-
7 – 8	-	-	-	-	X
9 – 10	-	X	-	-	-
11 - 12	-	-	X	-	-
13 - 14	-	-	-	X	-
15 - 16	-	-	-	-	X
Маркировка	1	2	3	4	5

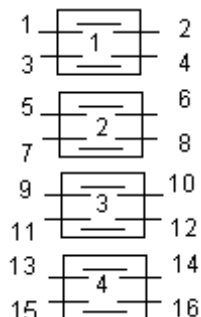

4167 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	X	X	-	X	X	X	X
3 - 4	-	X	-	-	-	-	-	-
5 – 6	X	-	-	-	-	-	-	-
7 - 8	-	-	-	-	-	-	-	X
9 – 10	-	-	-	-	X	X	X	-
11 - 12	-	-	-	-	X	-	X	X
13 - 14	-	-	-	-	-	X	X	X
15 - 16	X	X	-	-	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

Стр.

04-38

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

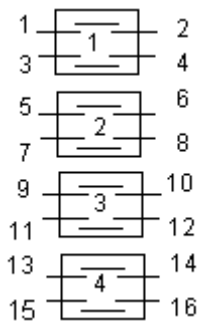


4168 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	X	X	X	-
7 – 8	X	X	X	-
9 – 10	X	X	-	-
11 – 12	X	X	-	-
13 - 14	X	X	-	-
15 - 16	X	X	-	-
Маркировка	3	1	2	0

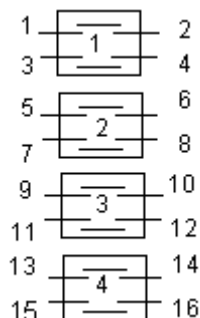


4169 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	X	-	-	-	-	-
3 – 4	-	-	-	-	X	-
5 – 6	-	X	-	-	-	-
7 – 8	-	-	-	-	-	X
9 - 10	-	-	X	-	-	-
11 - 12	-	-	-	X	-	-
13 - 14	X	X	X	-	-	-
15 - 16	-	-	-	X	X	X
Маркировка	5	6	1	2	3	4

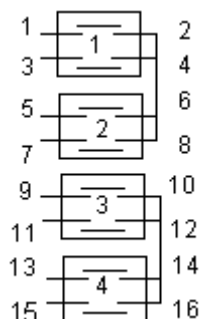


4170 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	-	X	-	-
5 – 6	-	-	-	X	-
7 – 8	-	-	-	-	X
9 – 10	-	X	-	-	-
11 - 12	-	-	X	-	-
13 - 14	-	-	-	X	-
15 - 16	-	-	-	-	X
Маркировка	0	1	2	3	4

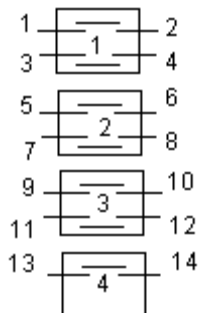


4171 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 - 14	X	-	X
Маркировка	1	0	2

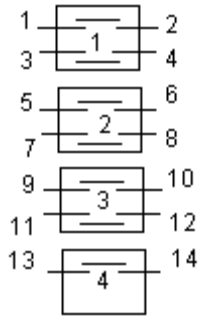


4172 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	X	-
3 – 4	X	X	-	-
5 – 6	-	-	X	X
7 – 8	-	X	-	X
9 – 10	-	X	X	-
11 – 12	-	-	X	X
13 – 14	-	X	-	X
Маркировка	1	2	3	4

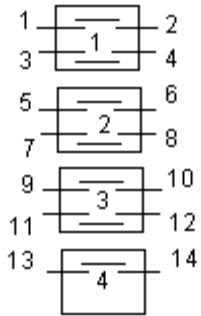


4173 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	X	X	X	X	X	X	X
3 - 4	-	-	X	X	X	X	X	X
5 – 6	-	-	-	X	X	X	X	X
7 - 8	-	-	-	-	X	X	X	X
9 – 10	-	-	-	-	-	X	X	X
11 – 12	-	-	-	-	-	-	X	X
13 - 14	-	-	-	-	-	-	-	X
Маркировка	0	1	2	3	4	5	6	7

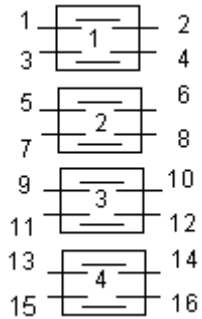


4174 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	-	-	X	-
13 – 14	-	X	-	-
15 – 16	-	-	-	X
Маркировка	3	4	1	2

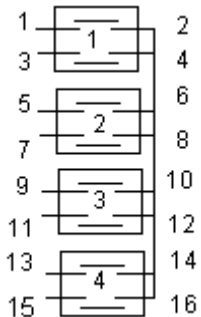


4175 Соединяемы е контакты	Способ фиксации: Н (без ограничения хода рукоятки)							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	-	-	-	X	-	-	-
3 - 4	X	-	-	-	-	-	-	-
5 – 6	-	-	-	-	-	X	-	-
7 - 8	-	X	-	-	-	-	-	-
9 – 10	-	-	-	-	-	-	X	-
11 - 12	-	-	X	-	-	-	-	-
13 - 14	-	-	-	-	-	-	-	X
15 - 16	-	-	-	X	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

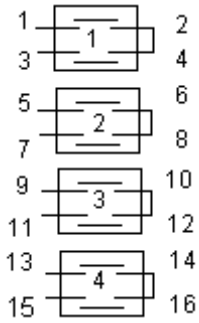


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	-	X	-	-	-
3 - 4	X	-	-	-	-	-	-	-
5 - 6	-	-	-	-	-	X	-	-
7 - 8	-	X	-	-	-	-	-	-
9 - 10	-	-	-	-	-	-	X	-
11 - 12	-	-	X	-	-	-	-	-
13 - 14	-	-	-	-	-	-	-	X
15 - 16	-	-	-	X	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

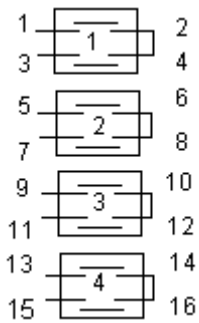


Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
Маркировка	2	0(-)	1

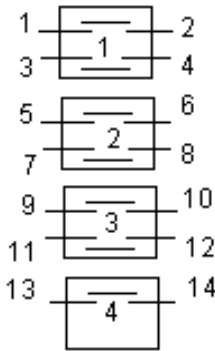


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	X	-
3 - 4	-	X	X
5 - 6	-	-	X
7 - 8	-	X	-
9 - 10	-	-	X
11 - 12	-	X	-
13 - 14	-	-	X
Маркировка	1	2	3

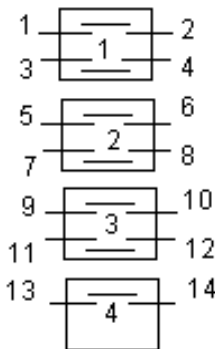


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	X	-	X
3 - 4	X	X	-
5 - 6	-	-	X
7 - 8	-	X	-
9 - 10	-	X	X
11 - 12	-	-	X
13 - 14	-	X	-
Маркировка	1	2	3

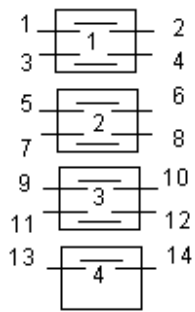


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	X	-	X	X	-	-	X	-
3 - 4	X	X	-	X	-	X	-	-
5 - 6	X	X	X	-	X	-	-	-
7 - 8	X	-	-	-	-	-	-	-
9 - 10	-	X	X	X	X	X	X	X
11 - 12	-	X	X	X	X	X	X	X
13 - 14	-	X	X	X	X	X	X	X
Маркировка	8	7	6	5	4	3	2	1

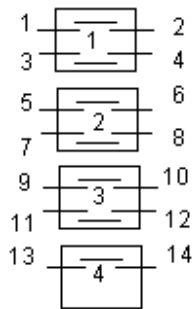


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 - 2	-	X	X	X
3 - 4	X	-	-	-
5 - 6	-	-	X	X
7 - 8	-	-	-	X
9 - 10	-	X	-	-
11 - 12	X	-	-	-
13 - 14	-	X	-	-
Маркировка	1	2	3	4

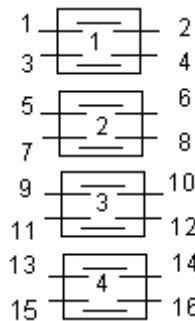


Соединяемые контакты	Способ фиксации: А		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	X	X
3 - 4	-	-	X
5 - 6	-	X	X
7 - 8	-	-	X
9 - 10	X	X	-
11 - 12	X	-	-
13 - 14	X	X	-
15 - 16	X	-	-

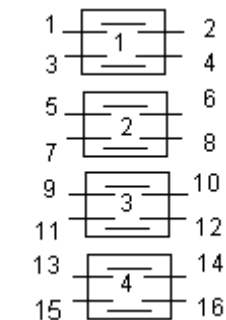


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	X	-	-
Маркировка	2	0	1

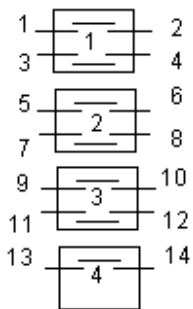


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	-	X	X	X	X	X	X
3 - 4	-	X	X	X	X	X	X
5 - 6	-	X	-	X	-	X	-
7 - 8	-	-	X	-	X	-	X
9 - 10	-	-	-	-	-	X	X
11 - 12	-	X	X	-	-	-	-
13 - 14	-	-	-	-	X	X	-
Маркировка	0	1	2	3	4	5	6

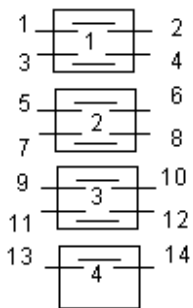


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	X	-
5 - 6	-	-	X
7 - 8	X	X	-
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	-	-	X
Маркировка	1	2	3

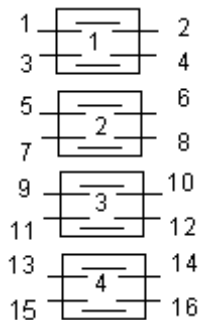


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	-
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	X	-	-
13 - 14	-	-	X
15 - 16	X	-	-
Маркировка	2	0	1

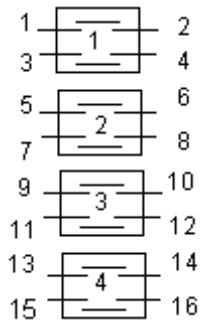


Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 - 2	-	X	-
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	X	-
11 - 12	-	-	X
13 - 14	-	X	-
15 - 16	-	-	X
Маркировка	0	1	2

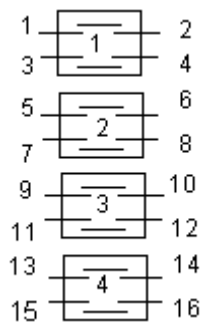


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	-
3 - 4	-	X	-
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	X	-	-
13 - 14	-	-	X
15 - 16	-	-	X
Маркировка	3	1	2

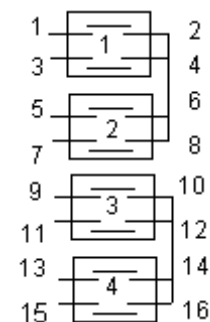


Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-
3 - 4	-	-	-	X
5 - 6	-	X	-	-
7 - 8	-	-	X	-
9 - 10	X	-	-	-
11 - 12	-	-	-	X
13 - 14	-	X	-	-
15 - 16	-	-	X	-
Маркировка	1	2	3	4

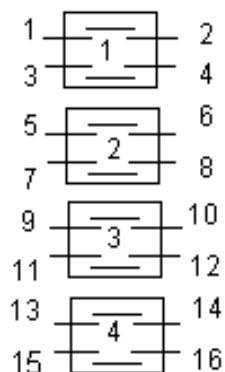


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	-	X	X
11 - 12	X	-	-
13 - 14	X	-	X
15 - 16	X	-	X
Маркировка	3	1	2

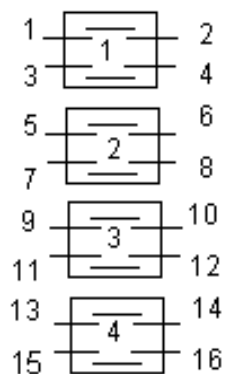


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-	-	-
3 - 4	-	X	-	-	-	-	-
5 - 6	-	-	X	-	-	-	-
7 - 8	X	X	X	-	-	-	-
9 - 10	-	-	-	-	X	-	-
11 - 12	-	-	-	-	-	X	-
13 - 14	-	-	-	-	-	-	X
15 - 16	-	-	-	-	X	X	X
Маркировка	6	5	4	0	1	2	3

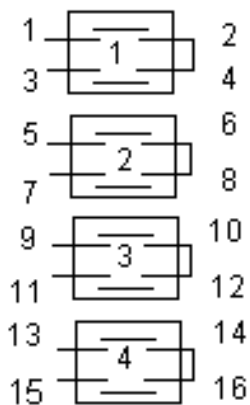


4192 Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	X	-	-
5 - 6	X	X	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	X	X
13 - 14	-	-	X
15 - 16	X	-	-
Маркировка	3	1(-)	2

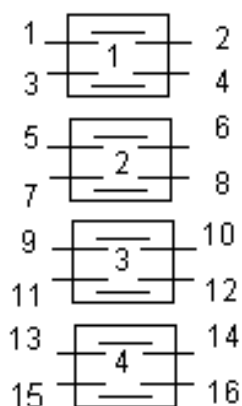


4193 Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45 ⁰	→ 0 ⁰	←	+45 ⁰
1 - 2	X	-	-	-
3 - 4	X	-	-	-
5 - 6	X	X	-	-
7 - 8	X	X	-	-
9 - 10	-	-	X	X
11 - 12	-	-	X	X
13 - 14	-	-	-	X
15 - 16	-	-	-	X

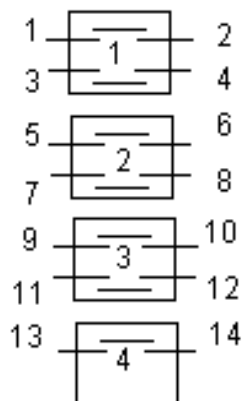


4194 Соединяемые контакты	Способ фиксации: АП		
	Положение рукоятки		
	-45 ⁰	0 ⁰ ←	+45 ⁰
1 - 2	-	X	-
3 - 4	X	-	-
5 - 6	-	X	-
7 - 8	X	-	-
9 - 10	-	X	-
11 - 12	X	-	-
13 - 14	-	-	X

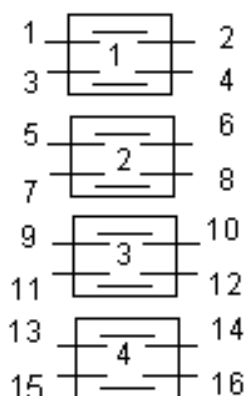


4195 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
Маркировка	1	0	2

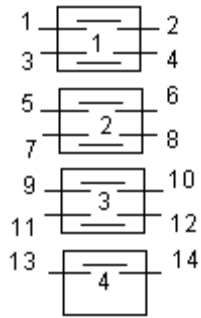


Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 – 2	-	X	-	-
3 – 4	-	X	-	X
5 – 6	-	-	X	-
7 – 8	-	-	X	<input type="checkbox"/>
9 – 10	-	-	-	X
11 - 12	-	-	-	X
13 - 14	-	-	-	X
Маркировка	0	1	2	3

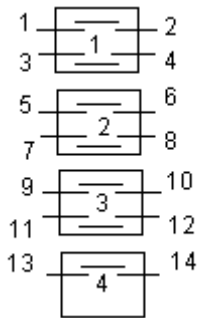


Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 – 2	-	-	X	X
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	-	-	X
11 - 12	-	-	-	X
13 - 14	-	X	X	-
Маркировка	0	1	2	3

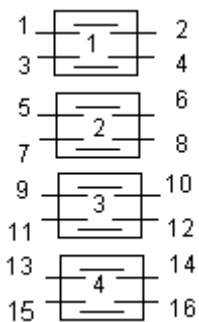


Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 – 2	-	-	X	X
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	-	-	X
11 - 12	-	-	-	X
13 - 14	-	X	X	-
15 - 16	-	-	-	X
Маркировка	0	1	2	3

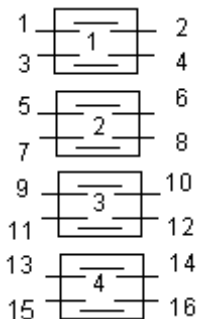


Соединяемые контакты	Способ фиксации: $\Delta\Pi$		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 - 2	-	X	-
3 - 4	X	-	-
5 - 6	-	X	-
7 - 8	X	-	-
9 – 10	-	X	-
11 - 12	X	-	-
13 - 14	-	-	X
15 - 16	-	-	X
Маркировка	3	1	2

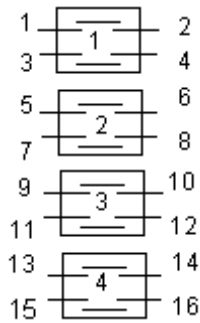


Соединяемые контакты	Способ фиксации: "		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	X	-
3 - 4	-	X	X
5 - 6	X	-	X
7 - 8	X	-	X
9 - 10	X	-	X
11 - 12	X	-	X
13 - 14	X	-	X
15 - 16	X	-	X
Маркировка	3	1	2

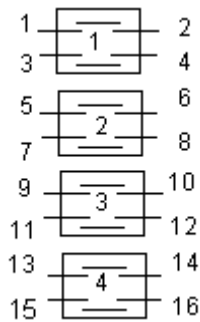

Соединяемые контакты	Способ фиксации: "							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	X	X	X	X	X	X	X
3 - 4	-	-	X	X	X	X	X	X
5 - 6	-	-	-	X	X	X	X	X
7 - 8	-	-	-	-	X	X	X	X
9 - 10	-	-	-	-	-	X	X	X
11 - 12	-	-	-	-	-	-	X	X
13 - 14	-	-	-	-	-	-	-	X
15 - 16	X	-	-	-	-	-	-	-
Маркировка	6	7	8	1	2	3	4	5

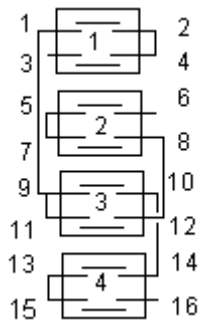

Соединяемые контакты	Способ фиксации: "		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
Маркировка	1	0	2

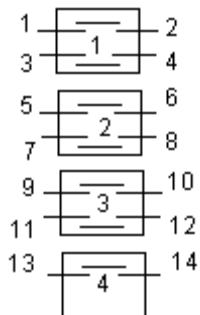

Соединяемые контакты	Способ фиксации: "			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	X	X
3 - 4	-	X	-	X
5 - 6	X	-	X	-
7 - 8	-	-	-	X
9 - 10	X	-	-	-
11 - 12	-	X	-	-
13 - 14	-	X	X	-
Маркировка	1	2	3	4