




6001 Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	-	X
21 – 22	-	-	X
23 – 24	-	-	X
Маркировка	2	(-) 0	1

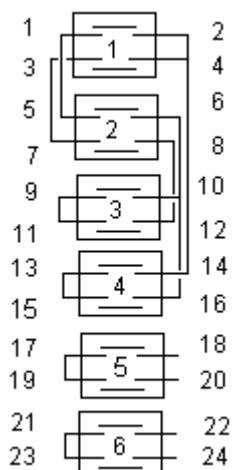


6002 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	X	-	-
23 – 24	-	-	X
Маркировка	2	0	1

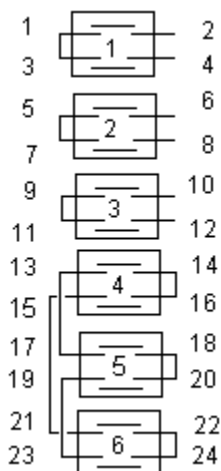


6003 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	X	-	-
23 – 24	-	-	X
Маркировка	2	0	1

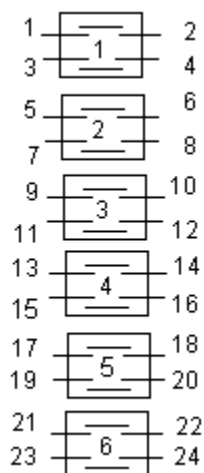


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	X	X
15 – 16	-	X	X
17 – 18	X	X	-
19 – 20	X	X	-
21 – 22	X	-	X
23 – 24	X	-	X
Маркировка	3	1	2

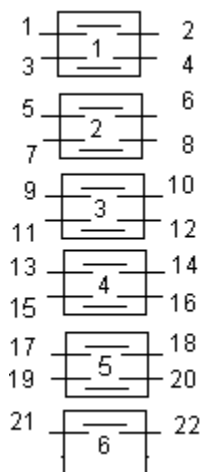


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	X	-
5 – 6	X	-	-
7 – 8	-	X	-
9 – 10	X	-	-
11 – 12	-	X	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	-	X
21 – 22	X	-	-
Маркировка	3	1	2

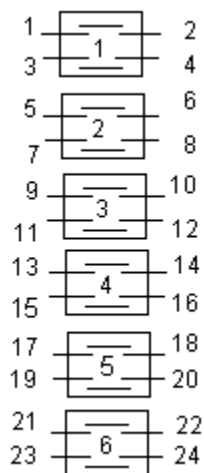


Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	X	-
3 – 4	X	-	-	-	-	-
5 – 6	-	-	-	-	-	X
7 – 8	-	X	-	-	-	-
9 – 10	-	-	-	X	-	-
11 – 12	-	-	X	-	-	-
13 – 14	-	-	X	-	-	-
15 – 16	-	-	-	X	-	-
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	-	-	X
21 – 22	X	-	-	-	-	-
23 – 24	-	-	-	-	X	-
Маркировка	4	5	6	1	2	3

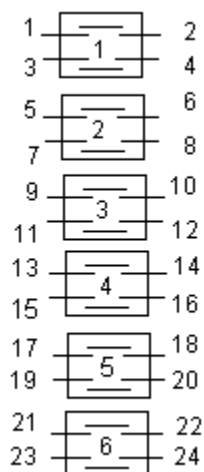


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135^0	-90^0	-45^0	0^0	$+45^0$	$+90^0$	$+135^0$
1 – 2	-	X	X	X	X	X	X
3 – 4	-	-	X	X	X	X	X
5 – 6	-	-	-	X	X	X	X
7 – 8	-	-	-	-	X	X	X
9 – 10	-	-	-	-	-	X	X
11 – 12	-	-	-	-	-	-	X
13 – 14	X	X	X	X	X	X	-
15 – 16	X	X	X	X	X	-	-
17 – 18	X	X	X	X	-	-	-
19 – 20	X	X	X	-	-	-	-
21 – 22	X	X	-	-	-	-	-
23 – 24	X	-	-	-	-	-	-
Маркировка	5	6	7	1	2	3	4

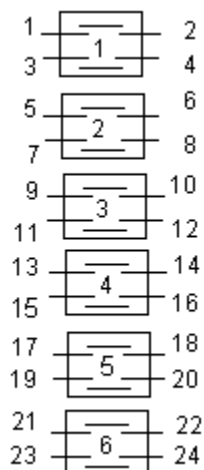


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	-	-	X
23 – 24	-	X	-
Маркировка	3	1	2

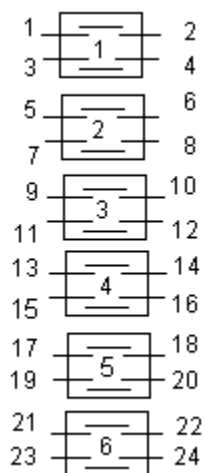


Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90^0	0^0	$+90^0$
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	X	-
11 – 12	-	X	-
13 – 14	-	X	-
15 – 16	-	X	-
17 – 18	-	X	-
19 – 20	-	X	-
21 – 22	-	X	-
23 – 24	X	-	X
Маркировка	3	1	2

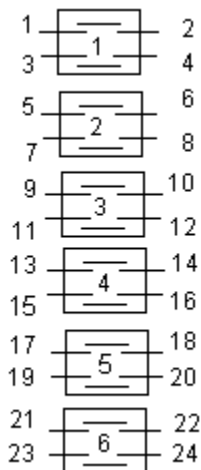


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-
3 – 4	-	X	X
5 – 6	X	X	-
7 – 8	-	X	X
9 – 10	X	X	-
11 – 12	-	X	X
13 – 14	-	X	X
15 – 16	X	X	-
17 – 18	-	X	X
19 – 20	X	X	-
21 – 22	-	X	X
23 – 24	X	X	-
Маркировка	3	1	2

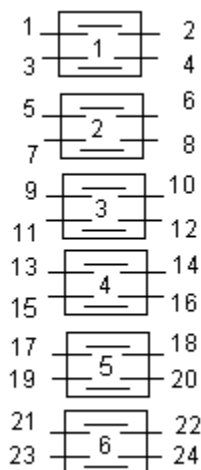


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 – 16	X	-	-	-
17 – 18	X	-	-	-
19 – 20	-	-	X	-
21 – 22	-	X	-	-
23 – 24	-	-	-	X
Маркировка	3	4	1	2

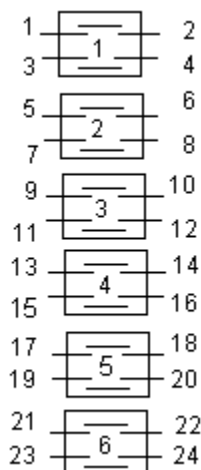


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	X	-
11 – 12	-	X	-
13 – 14	-	-	X
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	X	-	-
23 – 24	X	-	X
Маркировка	3	1	2

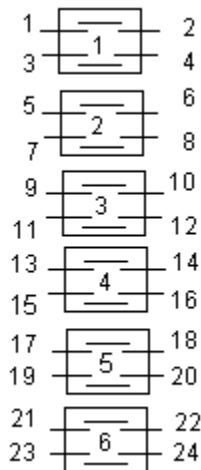


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	X	-
19 – 20	X	X	-
21 – 22	X	X	-
23 – 24	X	X	-
Маркировка	3	1	2

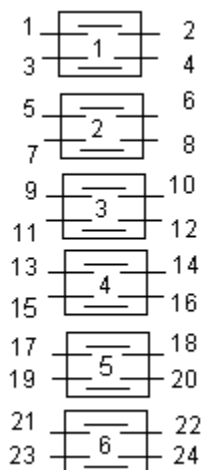


Соединяемые контакты	Способ фиксации: А			
	Положение рукоятки			
	-45°	0°	0°	+45°
1 - 2	-	-	X	X
3 - 4	-	-	X	X
5 - 6	-	-	X	X
7 - 8	-	-	X	X
9 – 10	X	X	-	-
11 - 12	X	X	-	-
13 - 14	X	X	-	-
15 – 16	-	X	X	-
17 - 18	-	-	-	X
19 - 20	-	-	-	X
21 – 22	X	-	-	-
23 - 24	X	-	-	-

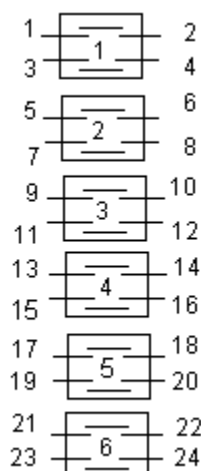


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135°	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	-	-	-	-	-	X	-
3 – 4	-	X	-	-	-	-	-
5 – 6	-	-	-	-	-	-	X
7 – 8	-	-	X	-	-	-	-
9 – 10	-	-	-	-	X	-	-
11 – 12	-	-	-	X	-	-	-
13 – 14	-	-	-	X	-	-	-
15 – 16	-	-	-	-	X	-	-
17 – 18	-	-	X	-	-	-	-
19 - 20	-	-	-	-	-	-	X
21 – 22	-	X	-	-	-	-	-
23 - 24	-	-	-	-	-	X	-
Маркировка	5	6	7	1	2	3	4

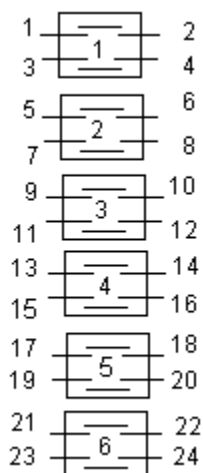


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X	-
3 – 4	-	-	-	X
5 – 6	-	-	X	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	X	-	-	-
13 – 14	X	-	-	-
15 – 16	-	-	X	X
17 – 18	X	-	-	-
19 – 20	-	-	X	X
21 – 22	X	X	-	-
23 – 24	-	X	-	X
Маркировка	3	4	1	2

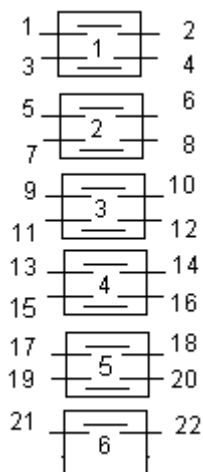


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	X	X	-	X	-
3 – 4	X	X	-	X	-	-	-
5 – 6	X	X	X	-	X	-	-
7 – 8	X	X	X	-	X	-	-
9 – 10	X	X	-	-	X	-	X
11 – 12	X	X	-	-	X	-	X
13 – 14	-	-	X	-	X	X	X
15 – 16	-	-	-	X	-	X	X
17 – 18	-	-	X	-	-	X	-
19 – 20	-	-	-	X	-	-	-
21 – 22	-	-	-	X	-	-	-
Маркировка	5	6	7	1	2	3	4

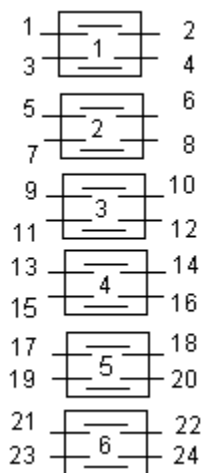


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	X	-	-	-
7 – 8	-	-	X	-
9 – 10	-	X	-	-
11 – 12	-	-	-	X
13 – 14	-	X	-	-
15 – 16	-	-	-	X
17 – 18	-	X	-	-
19 – 20	-	-	-	X
21 – 22	-	-	X	-
23 – 24	-	-	X	X
Маркировка	3	4	1	2

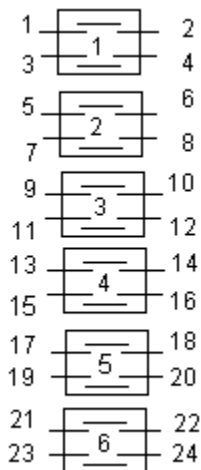


Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	X	X
5 – 6	X	X	-
7 – 8	-	-	X
9 – 10	X	X	-
11 – 12	-	-	X
13 – 14	-	X	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	-	-	X
23 – 24	-	X	X
Маркировка	3 (1)	1 (-)	2

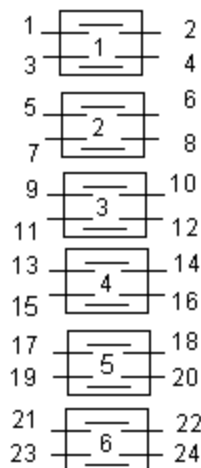


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	X	X	X	-	-	-	-
7 – 8	-	-	-	-	X	X	X
9 – 10	X	X	X	-	-	-	-
11 – 12	-	-	-	-	X	X	X
13 – 14	X	X	-	-	-	-	X
15 – 16	-	-	X	-	X	X	-
17 – 18	-	-	X	-	X	-	-
19 – 20	X	-	-	-	-	-	X
21 – 22	-	X	X	-	X	X	X
23 – 24	X	X	X	-	-	X	X
Маркировка	5	6	7	1	2	3	4

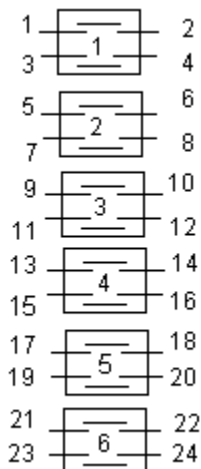


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	X	-
11 – 12	-	X	-
13 – 14	-	-	X
15 – 16	-	X	X
17 – 18	X	-	-
19 – 20	-	X	X
21 – 22	-	X	X
23 – 24	X	X	-
Маркировка	3	1	2

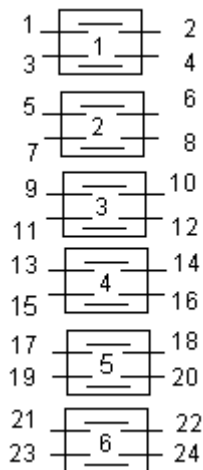


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	X	-	-	X	X
5 - 6	-	X	-	X	-
7 - 8	-	X	-	X	-
9 - 10	-	X	-	-	-
11 - 12	X	-	-	X	X
13 - 14	-	X	-	X	-
15 - 16	-	X	-	X	-
17 - 18	X	-	-	-	X
19 - 20	X	-	-	-	X
21 - 22	-	-	-	X	-
23 - 24	-	X	-	-	-
Маркировка	3	4	0	1	2

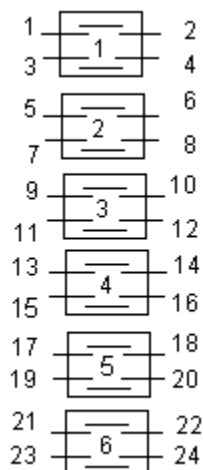


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	X	-
3 - 4	-	X	-	X	-
5 - 6	X	X	-	X	-
7 - 8	X	X	-	X	-
9 - 10	X	-	-	-	-
11 - 12	-	-	-	-	X
13 - 14	X	-	-	-	-
15 - 16	-	-	-	-	X
17 - 18	X	-	-	-	X
19 - 20	X	-	-	-	X
21 - 22	-	X	-	X	-
23 - 24	-	X	-	X	-
Маркировка	3	4	0	1	2

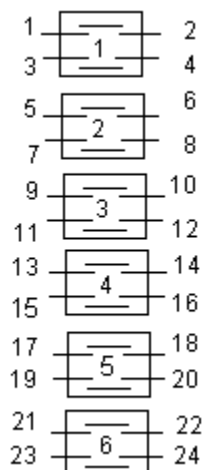


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	X	-	-
5 - 6	X	-	X
7 - 8	X	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
17 - 18	X	-	X
19 - 20	X	-	-
21 - 22	X	-	-
23 - 24	X	-	-
Маркировка	2	0	1

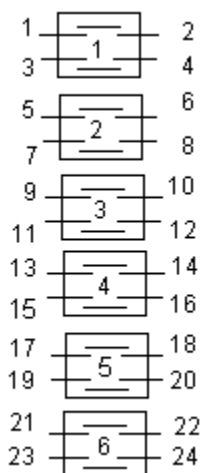


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	-	X	X
15 – 16	-	-	X
17 – 18	X	X	-
19 – 20	-	X	-
21 – 22	X	-	X
23 – 24	X	-	X
Маркировка	3	1	2

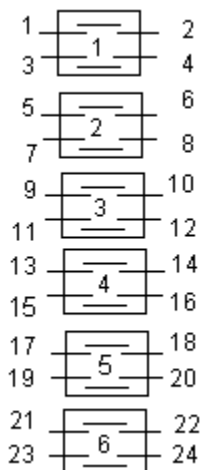


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	-	X
5 – 6	-	-	X
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	X	-	-
19 – 20	X	-	-
21 – 22	X	-	-
23 – 24	X	-	X
Маркировка	3	1	2

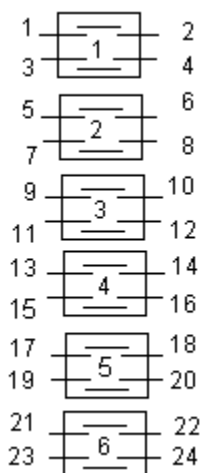


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	X	X	X	-	X	X	X
7 – 8	X	X	X	-	X	X	X
9 – 10	-	-	-	-	X	X	X
11 – 12	X	X	X	-	-	-	-
13 – 14	X	X	-	-	-	X	X
15 – 16	X	-	-	-	-	-	X
17 – 18	-	-	-	-	X	X	X
19 – 20	X	X	X	-	-	-	-
21 – 22	-	-	X	-	X	-	-
23 – 24	-	-	-	X	-	-	-
Маркировка	5	6	7	1	2	3	4

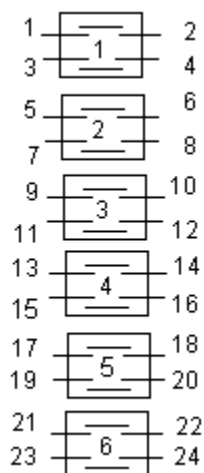


6029 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	X	-	-	-
3 - 4	-	-	-	X	X
5 - 6	-	-	X	X	-
7 - 8	-	X	X	-	-
9 - 10	X	X	-	-	-
11 - 12	-	-	-	X	X
13 - 14	-	-	X	X	-
15 - 16	-	X	X	-	-
17 - 18	X	X	-	-	-
19 - 20	-	-	-	X	X
21 - 22	-	-	X	X	-
23 - 24	-	X	X	-	-
Маркировка	4	5	1	2	3

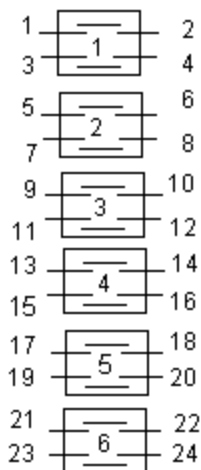


6030 Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 - 2	X	-	X
3 - 4	X	-	X
5 - 6	X	-	X
7 - 8	X	-	X
9 - 10	X	-	X
11 - 12	X	-	X
13 - 14	X	-	X
15 - 16	X	-	X
17 - 18	X	-	X
19 - 20	-	X	-
21 - 22	-	X	-
23 - 24	-	X	-
Маркировка	3	1	2

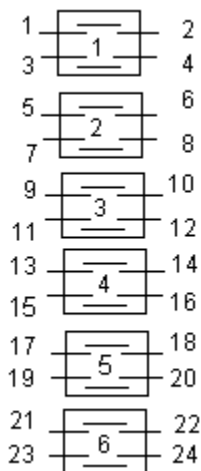


6031 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	-	X
3 - 4	-	-	X
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	-	-	X
11 - 12	-	-	X
13 - 14	-	-	X
15 - 16	-	-	X
17 - 18	-	X	-
19 - 20	-	X	-
21 - 22	X	-	-
23 - 24	X	-	-
Маркировка	3	1	2

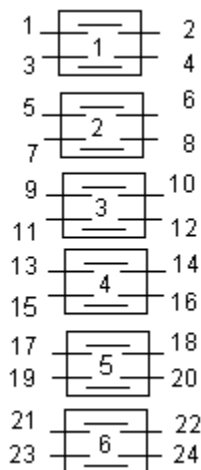


6032 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	X	-
21 – 22	-	X	X
23 – 24	-	X	X
Маркировка	3	1	2

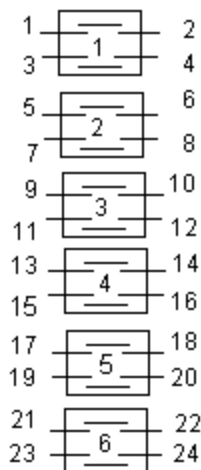


6033 Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	X
9 – 10	-	-	X
11 – 12	-	X	X
13 – 14	-	-	X
15 – 16	-	X	X
17 – 18	X	-	-
19 – 20	X	X	-
21 – 22	X	-	-
23 – 24	X	X	-
Маркировка	3	1 (-)	2

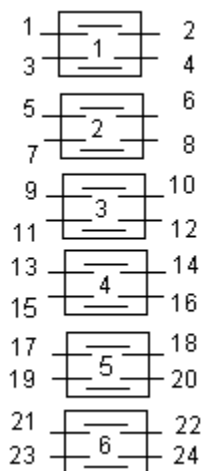


6034 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	-	X	-
23 – 24	-	X	-
Маркировка	3	1	2

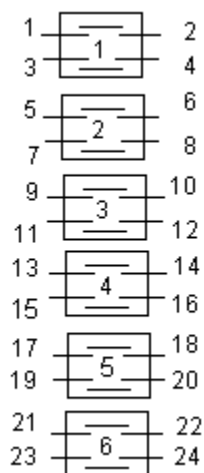


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	X	-
11 – 12	-	X	-
13 – 14	-	X	-
15 – 16	-	X	-
17 – 18	-	-	X
19 – 20	-	-	X
21 – 22	-	-	X
23 – 24	-	-	X
Маркировка	3	1	2

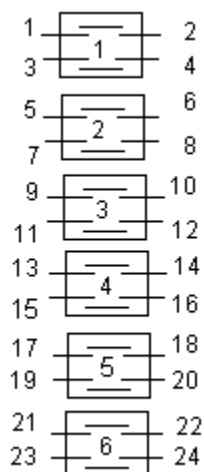


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 – 16	X	-	-	-
17 – 18	-	X	X	X
19 – 20	X	X	-	X
21 – 22	X	-	X	X
23 – 24	X	X	X	-
Маркировка	3	4	1	2

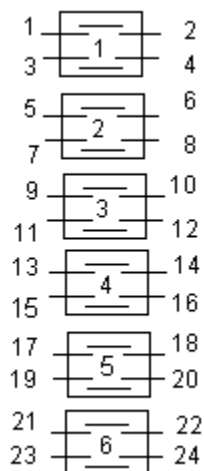


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-	-
3 – 4	-	-	-	-	X
5 – 6	-	X	-	-	-
7 – 8	-	-	-	X	-
9 – 10	X	-	-	-	-
11 – 12	-	-	-	-	X
13 – 14	-	X	-	-	-
15 – 16	-	-	-	X	-
17 – 18	X	-	-	-	-
19 – 20	-	-	-	-	X
21 – 22	-	X	-	-	-
23 – 24	-	-	-	X	-
Маркировка	3	4	0	1	2

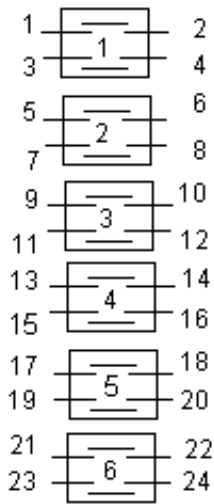


6039 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
21 – 22	-	X
23 – 24	-	X
Маркировка	0	1

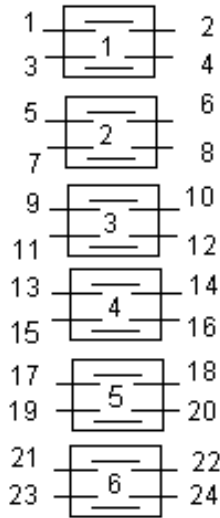


6040 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	-	-	X
23 – 24	X	-	-
Маркировка	2	0	1

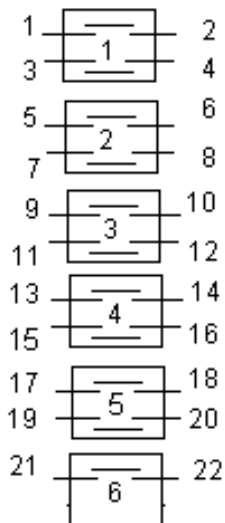


6041 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	-	X	-	-	-	-
3 – 4	-	-	-	-	-	X
5 – 6	-	-	-	X	-	-
7 – 8	-	-	-	-	-	X
9 – 10	-	-	-	X	-	-
11 – 12	-	-	-	-	-	X
13 – 14	-	X	-	-	-	-
15 – 16	-	-	-	-	-	X
17 – 18	-	-	-	X	-	-
19 – 20	-	X	-	-	-	-
21 – 22	-	-	-	-	-	X
Маркировка	0	3	0	1	0	2

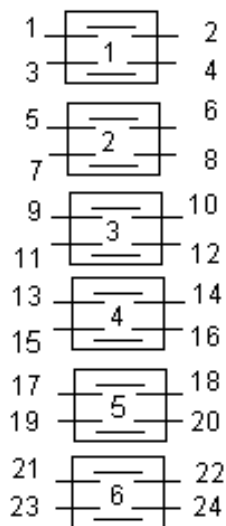


6042 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	X
9 – 10	-	-	X
11 – 12	-	X	X
13 – 14	-	-	X
15 – 16	-	X	X
17 – 18	-	-	X
19 – 20	-	X	X
21 – 22	-	-	X
23 – 24	-	X	X
Маркировка	0	1	2

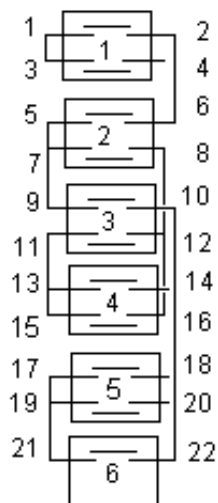

6043 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	-	-	-	X
3 – 4	-	-	-	X	-	-
5 – 6	-	-	-	X	-	X
7 – 8	-	-	-	X	-	-
9 – 10	-	-	-	X	-	-
11 – 12	-	-	-	X	-	-
13 – 14	-	X	-	-	-	-
15 – 16	-	-	-	-	-	X
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	X	-	-
21 – 22	-	-	-	-	-	X
Маркировка	0	3	0	1	0	2

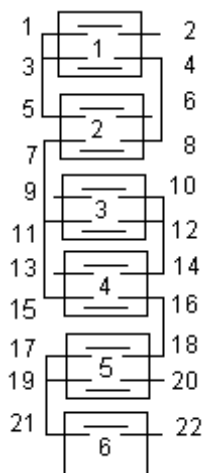


6044 Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	-	X
3 – 4	-	X	-	-	-	-
5 – 6	-	-	-	X	-	-
7 – 8	-	-	-	-	-	X
9 – 10	-	-	-	X	-	-
11 – 12	-	X	-	-	-	-
13 – 14	-	-	-	-	-	X
15 – 16	-	-	-	-	-	X
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	X	-	-
21 – 22	-	-	-	-	-	X
Маркировка	0	3	0	1	0	2

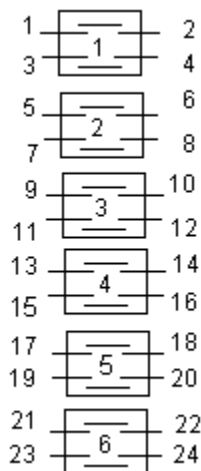


Соединяемые контакты	6045*	
	Без рукоятки, без фиксации положений коммутации	
	-90 ⁰	0 ⁰
1 – 2	-	X
3 – 4	X	-
5 – 6	-	X
7 – 8	X	-
9 – 10	-	X
11 – 12	X	-
13 – 14	-	X
15 – 16	X	-
17 – 18	-	X
19 – 20	X	-
21 – 22	-	X
23 – 24	X	-


* применяется в приводе высоковольтного электромагнитного выключателя

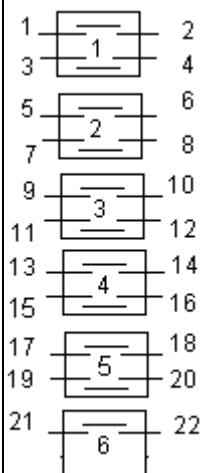


Соединяемые контакты	6046						
	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	X	X	X	-	X	X	X
5 – 6	-	-	-	-	X	X	X
7 – 8	-	-	-	-	X	X	X
9 – 10	X	X	X	-	-	-	-
11 – 12	X	-	-	-	-	-	X
13 – 14	-	-	-	X	X	-	-
15 – 16	X	X	-	-	-	-	X
17 – 18	-	-	-	X	-	-	-
19 – 20	X	-	-	X	X	X	-
21 – 22	X	-	-	X	X	-	X
Маркировка	5	6	7	1	2	3	4

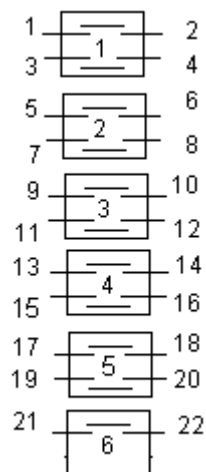


Соединяемые контакты	6047							
	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	X	-	-	-	-
3 – 4	X	X	X	-	X	X	X	X
5 – 6	X	X	-	-	-	-	-	X
7 – 8	X	X	X	-	-	-	-	-
9 – 10	-	-	-	X	-	-	-	-
11 – 12	-	-	-	-	X	X	X	X
13 – 14	X	-	-	-	-	-	-	X
15 – 16	-	-	-	-	X	X	X	X
17 – 18	-	-	-	X	X	-	-	-
19 – 20	X	-	-	X	X	X	-	X
21 – 22	X	-	-	X	X	-	-	X
Маркировка	6	7	8	1	2	3	4	5

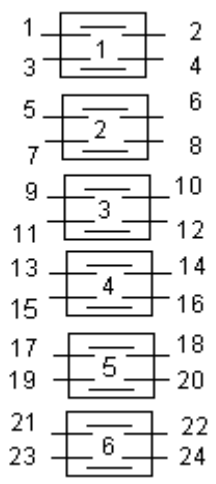


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	-	X	X	X
5 – 6	X	X	X	-	-	-	-
7 – 8	X	X	X	X	-	-	-
9 – 10	-	-	-	X	X	X	X
11 – 12	X	X	X	-	X	X	X
13 – 14	-	-	X	-	X	-	-
15 – 16	X	X	-	-	-	X	X
17 – 18	X	-	X	X	X	-	X
19 – 20	X	-	X	X	X	-	X
21 – 22	-	-	X	X	X	-	-
23 – 24	-	-	-	X	-	-	-
Маркировка	5	6	7	1	2	3	4

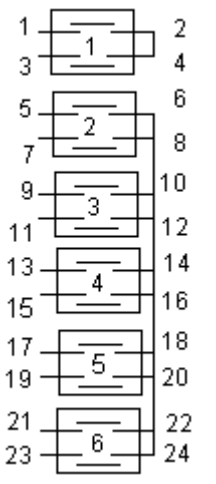


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	X	-	-	-	-
3 – 4	-	-	-	X	-	-	-	-
5 – 6	X	X	X	-	X	X	X	X
7 – 8	X	X	-	-	-	-	-	X
9 – 10	X	X	X	-	-	-	-	-
11 – 12	-	-	-	X	-	-	-	-
13 – 14	-	-	-	-	X	X	X	X
15 – 16	X	-	-	-	-	-	-	X
17 – 18	-	-	-	-	X	X	X	X
19 – 20	-	-	-	X	X	-	-	-
21 – 22	X	-	-	X	X	X	-	X
23 – 24	X	-	-	X	X	-	-	X
Маркировка	6	7	8	1	2	3	4	5

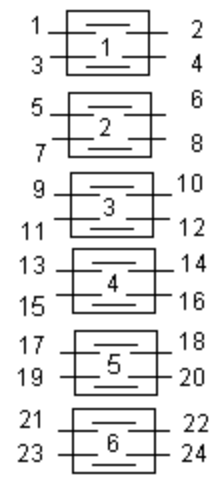


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	X	-	-	-	-
3 – 4	-	-	-	X	-	-	-	-
5 – 6	X	X	X	-	X	X	X	X
7 – 8	-	-	-	-	X	X	X	X
9 – 10	X	X	X	-	-	-	-	-
11 – 12	X	X	-	-	-	-	-	X
13 – 14	-	-	-	X	-	-	-	-
15 – 16	-	-	-	-	X	X	X	X
17 – 18	-	-	-	X	X	-	-	-
19 – 20	X	-	-	-	-	-	-	X
21 – 22	X	-	-	X	X	X	-	X
23 – 24	-	-	X	-	-	X	-	-
Маркировка	6	7	8	1	2	3	4	5

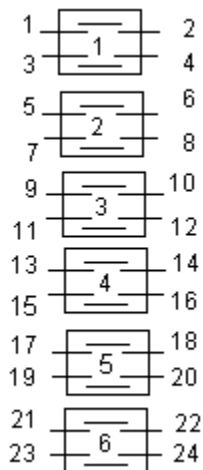


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 – 2	-	X
3 – 4	X	-
5 – 6	-	X
7 – 8	X	-
9 – 10	-	X
11 – 12	X	-
13 – 14	-	X
15 – 16	X	-
17 – 18	-	X
19 – 20	X	-
21 – 22	-	X
23 – 24	X	-
Маркировка	1	2

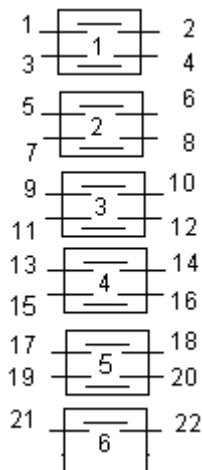


Соединяемые контакты	Способ фиксации: П						
	Положение рукоятки						
	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 – 2	-	-	-	-	-	-	X
3 – 4	-	X	X	X	X	-	-
5 – 6	-	-	-	-	-	-	X
7 – 8	-	X	-	-	-	-	-
9 – 10	-	-	X	-	-	-	-
11 – 12	-	-	-	X	-	-	-
13 – 14	-	-	-	-	X	-	-
15 – 16	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	X
19 – 20	-	-	-	-	-	X	-
21 – 22	-	-	-	-	-	-	X
Маркировка	6	5	0	1	2	3	4

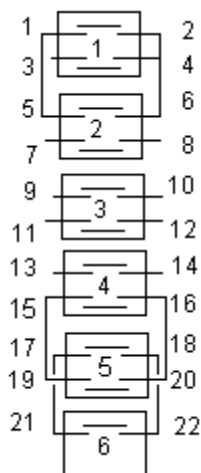


Соединяемые контакты	Способ фиксации: П						
	Положение рукоятки						
	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 – 2	-	-	-	-	-	-	X
3 – 4	-	X	X	X	X	-	-
5 – 6	-	-	-	-	-	-	X
7 – 8	-	X	-	-	-	-	-
9 – 10	-	-	X	-	-	-	-
11 – 12	-	-	-	X	-	-	-
13 – 14	-	-	-	-	X	-	-
15 – 16	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	X
19 – 20	-	-	-	-	-	X	-
21 – 22	-	-	-	-	-	-	X
Маркировка	6	5	0	1	2	3	4

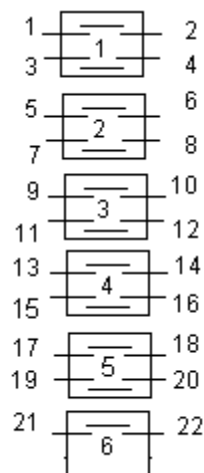


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	-	X
21 – 22	-	-	X
Маркировка	3	1	2

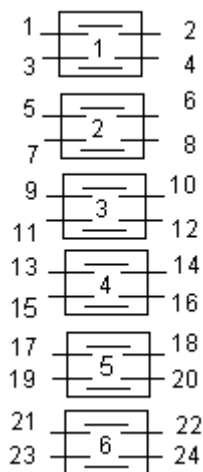


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	X
9 – 10	-	-	X
11 – 12	-	X	X
13 – 14	-	-	X
15 – 16	-	X	X
17 – 18	-	X	X
19 – 20	-	X	X
21 – 22	-	X	X
23 – 24	-	X	X
Маркировка	0	1	2

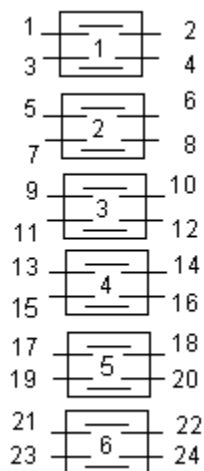


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 – 2	X	-
3 – 4	X	-
5 – 6	X	-
7 – 8	X	-
9 – 10	X	-
11 – 12	X	-
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
21 – 22	-	X
23 – 24	-	X
Маркировка	1	2

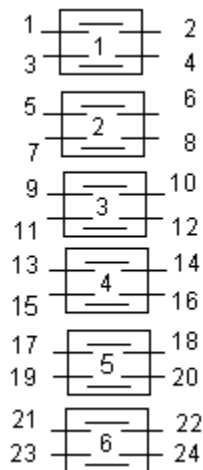


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	X	X	-	-	-	-
3 – 4	X	X	-	-	-	-	-
5 – 6	X	-	-	-	-	-	-
7 – 8	-	-	-	X	X	X	-
9 – 10	-	-	X	X	X	-	-
11 – 12	-	X	X	X	-	-	-
13 – 14	-	-	-	-	-	-	X
15 – 16	-	-	-	-	-	X	X
17 – 18	-	-	-	-	X	X	X
19 – 20	X	X	X	-	-	-	-
21 – 22	-	-	-	X	X	X	-
23 – 24	-	-	-	-	-	-	X
Маркировка	5	6	7	1	2	3	4

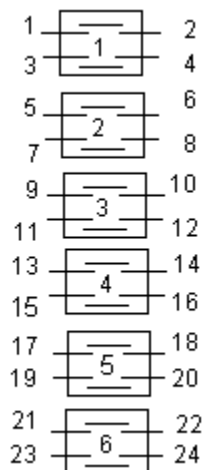


Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	-	-	X
23 – 24	X	-	-
Маркировка	1	(-) 0	2

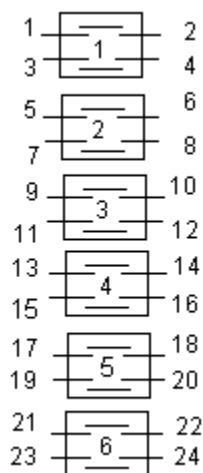


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	-	-	-	-	-	-
3 – 4	-	X	-	-	-	-	-
5 – 6	-	-	X	-	-	-	-
7 – 8	-	-	-	-	X	-	-
9 – 10	-	-	-	-	-	X	-
11 – 12	-	-	-	-	-	-	X
13 – 14	X	-	-	-	-	-	-
15 – 16	-	X	-	-	-	-	-
17 – 18	-	-	X	-	-	-	-
19 – 20	-	-	-	-	X	-	-
21 – 22	-	-	-	-	-	X	-
23 – 24	-	-	-	-	-	-	X

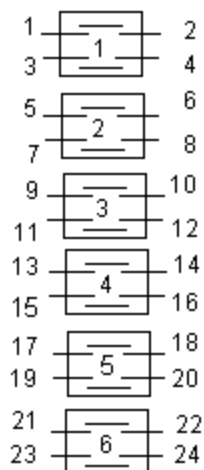


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	-	-	X	-
5 - 6	-	X	-	-	-
7 - 8	-	-	-	X	-
9 - 10	-	X	-	-	-
11 - 12	-	-	-	X	-
13 - 14	-	-	X	-	-
15 - 16	-	-	-	-	X
17 - 18	-	-	X	-	-
19 - 20	-	-	-	-	X
21 - 22	-	-	X	-	-
23 - 24	-	-	-	-	X
Маркировка	0	4	1	2	3

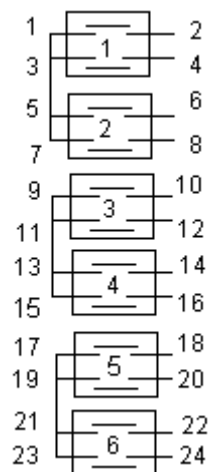


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-
3 - 4	-	X	-	-
5 - 6	-	-	X	-
7 - 8	-	-	-	X
9 - 10	X	-	-	-
11 - 12	-	X	-	-
13 - 14	-	-	X	-
15 - 16	-	-	-	X
17 - 18	X	-	-	-
19 - 20	-	X	-	-
21 - 22	-	-	X	-
23 - 24	-	-	-	X
Маркировка	4	1	2	3

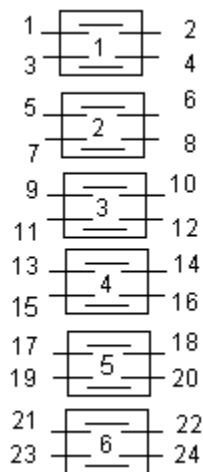


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	X
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	X	-	-
13 - 14	-	-	X
15 - 16	-	-	X
17 - 18	-	-	X
19 - 20	X	-	-
21 - 22	X	-	-
23 - 24	-	-	X
Маркировка	1	0	2

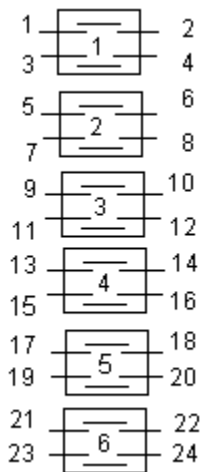


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-
3 – 4	-	-	X
5 – 6	X	X	-
7 – 8	-	-	X
9 – 10	-	X	X
11 – 12	X	-	-
13 – 14	-	X	X
15 – 16	X	-	-
17 – 18	-	X	X
19 – 20	X	-	-
21 – 22	-	X	X
23 – 24	X	-	-
Маркировка	3	1	2

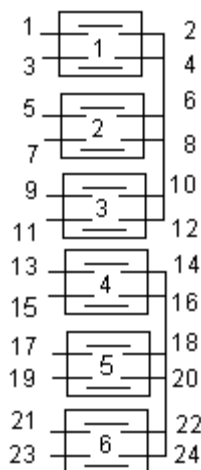


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	X	-	-	-	-	-	-	-
3 – 4	-	-	-	-	X	-	-	-
5 – 6	-	X	-	-	-	-	-	-
7 – 8	-	-	-	-	-	X	-	-
9 – 10	-	-	X	-	-	-	-	-
11 – 12	-	-	-	-	-	-	X	-
13 – 14	X	-	-	-	-	-	-	-
15 – 16	-	-	-	-	X	-	-	-
17 – 18	-	X	-	-	-	-	-	-
19 – 20	-	-	-	-	-	X	-	-
21 – 22	-	-	X	-	-	-	-	-
23 – 24	-	-	-	-	-	-	X	-
Маркировка	4	5	6	0	1	2	3	0

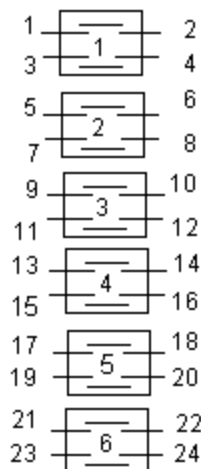


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-	-
3 – 4	-	-	X	-	-
5 – 6	-	-	-	X	-
7 – 8	-	-	-	-	X
9 – 10	-	X	-	-	-
11 – 12	-	-	X	-	-
13 – 14	-	-	-	X	-
15 – 16	-	-	-	-	X
17 – 18	-	X	-	-	-
19 – 20	-	-	X	-	-
21 – 22	-	-	-	X	-
23 – 24	-	-	-	-	X
Маркировка	0	4	1	2	3

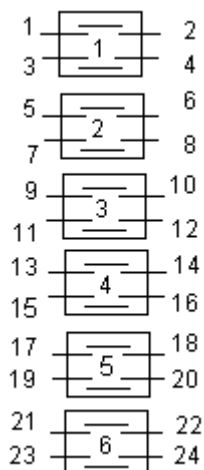


Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 – 2	X	-
3 – 4	-	X
5 – 6	X	-
7 – 8	-	X
9 – 10	X	-
11 – 12	-	X
13 – 14	X	-
15 – 16	-	X
17 – 18	X	-
19 – 20	-	X
21 – 22	X	-
23 – 24	-	X
Маркировка	1	2

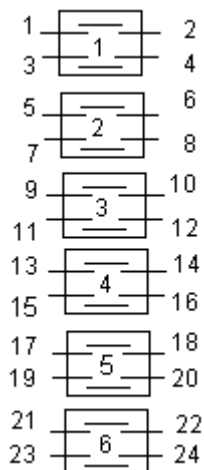


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	X	-	-	-
7 – 8	-	X	-	-
9 – 10	-	X	-	-
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 – 16	-	-	X	-
17 – 18	-	-	X	-
19 – 20	-	-	-	X
21 – 22	-	-	-	X
23 – 24	-	-	-	X
Маркировка	4	1	2	3

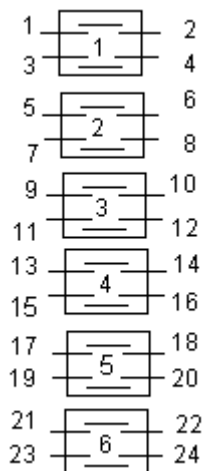


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45°	0°	+45°	+90°
1 – 2	-	X	-	-
3 – 4	-	-	-	X
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	X	-	-
11 – 12	-	-	-	X
13 – 14	-	-	X	-
15 – 16	X	-	-	-
17 – 18	-	-	X	-
19 – 20	X	-	-	-
21 – 22	-	-	X	-
23 – 24	X	-	-	-
Маркировка	4	1	2	3

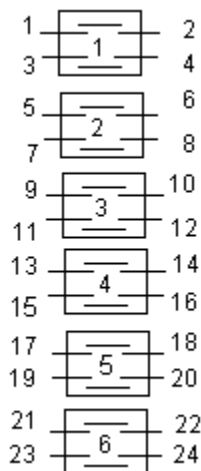


Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 – 2	-	-	-	-	X	-
3 – 4	X	-	-	-	-	-
5 – 6	-	-	-	-	-	X
7 – 8	-	X	-	-	-	-
9 - 10	-	-	-	X	-	-
11 - 12	-	-	X	-	-	-
13 - 14	-	-	X	-	-	-
15 - 16	-	-	-	X	-	-
17 - 18	-	X	-	-	-	-
19 – 20	-	-	-	-	-	X
21 – 22	X	-	-	-	-	-
23 - 24	-	-	-	-	X	-
Маркировка	5	6	1	2	3	4

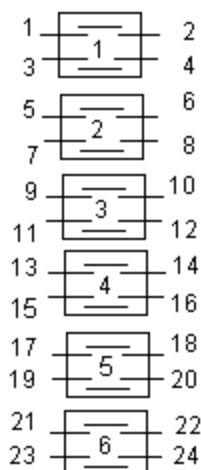


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	-	X	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	X	X
19 - 20	X	X	-
21 – 22	X	-	X
23 - 24	X	-	X
Маркировка	3	1	2

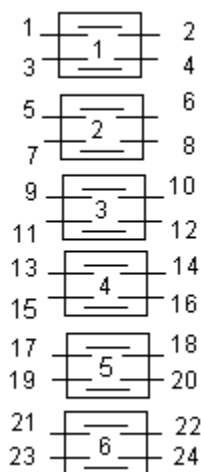


Соединяемые контакты	Способ фиксации: Г			
	Положение рукоятки			
	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	X	-	X
3 – 4	X	-	-	-
5 – 6	-	X	X	-
7 – 8	X	X	-	X
9 – 10	X	X	X	-
11 – 12	X	X	-	X
13 - 14	X	X	X	-
15 - 16	X	-	-	-
17 - 18	-	X	-	X
19 - 20	X	-	-	-
21 – 22	-	X	X	-
23 - 24	X	-	-	-
Маркировка	1	2	3	4

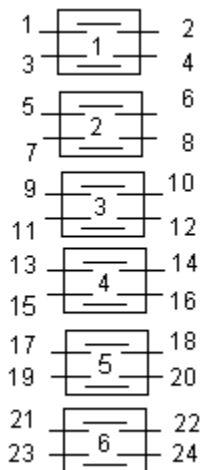


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	-	-	X
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	-	-	X	-
13 – 14	X	-	-	-
15 – 16	-	-	X	-
17 – 18	X	X	-	-
19 – 20	-	-	X	X
21 – 22	X	X	-	-
23 – 24	-	-	X	X
Маркировка	4	1	2	3

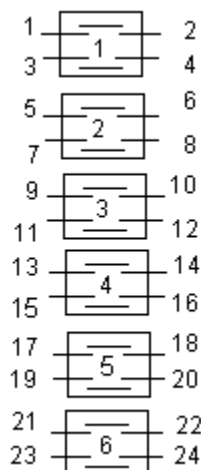


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	-	X	-	-
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	X	-
13 – 14	-	-	-	X
15 – 16	-	-	-	X
17 – 18	X	-	-	-
19 – 20	-	X	-	-
21 – 22	-	-	X	-
23 – 24	-	-	-	X
Маркировка	3	4	1	2

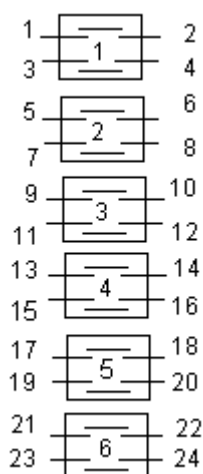


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	-	-	-	-	-
3 – 4	-	X	-	-	-	-	-
5 – 6	-	X	-	-	-	-	-
7 – 8	-	-	-	X	-	-	-
9 – 10	-	-	-	X	-	-	-
11 – 12	-	-	-	X	-	-	-
13 – 14	-	-	-	-	-	X	-
15 – 16	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	X	-
19 – 20	-	-	-	-	-	X	-
21 – 22	-	-	-	-	-	X	-
23 – 24	-	X	-	X	-	X	-
Маркировка	0	1	0	2	0	3	0

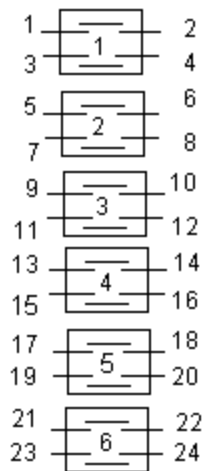


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	-	X	-	-
5 – 6	X	-	-	-
7 – 8	-	X	-	-
9 – 10	-	-	X	-
11 – 12	-	-	-	X
13 – 14	-	-	X	-
15 – 16	-	-	-	X
17 – 18	X	-	-	-
19 – 20	-	X	-	-
21 – 22	-	-	X	-
23 – 24	-	-	-	X
Маркировка	4	1	2	3

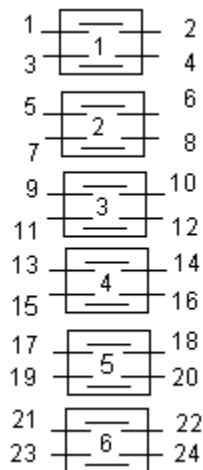


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	-	-	-	X	-
3 – 4	-	-	X	-	-	-	-	-
5 – 6	-	-	-	-	-	-	-	X
7 – 8	-	-	-	X	-	-	-	-
9 – 10	-	-	-	-	-	X	-	-
11 – 12	-	-	-	-	X	-	-	-
13 – 14	-	-	-	-	-	-	-	X
15 – 16	X	-	-	-	-	-	-	-
17 – 18	-	-	-	X	-	-	-	-
19 – 20	-	-	-	-	-	-	-	X
21 – 22	-	X	-	-	-	-	-	-
23 – 24	-	-	-	-	-	X	-	-
Маркировка	6	7	8	1	2	3	4	5

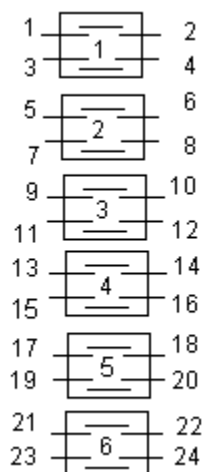


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	X	-	-	-
7 – 8	X	-	-	-
9 – 10	X	-	-	-
11 – 12	X	-	-	-
13 – 14	X	-	-	-
15 – 16	X	-	-	-
17 – 18	X	-	-	-
19 – 20	X	-	-	-
21 – 22	-	-	X	-
23 – 24	-	-	-	X
Маркировка	3	0	1	2

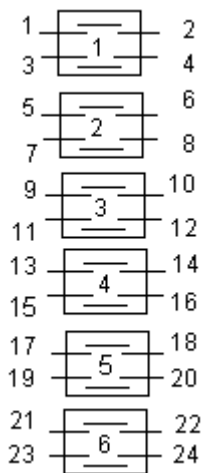


Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	X	-
3 – 4	-	X	-	X
5 – 6	-	-	X	X
7 – 8	X	X	-	-
9 – 10	X	-	X	-
11 – 12	-	X	-	X
13 – 14	-	-	X	X
15 – 16	X	X	-	-
17 – 18	X	-	X	-
19 – 20	-	X	-	X
21 – 22	-	-	X	X
23 – 24	X	X	-	-
Маркировка	1	2	3	4

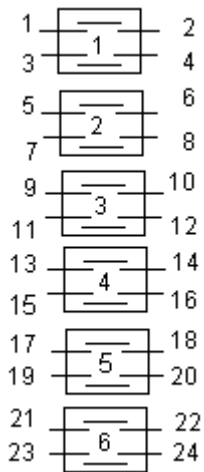


Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	X	X	-	-	-
3 – 4	-	-	-	X	X	X
5 – 6	X	X	X	-	-	-
7 – 8	-	-	-	X	X	X
9 – 10	X	X	X	-	-	-
11 – 12	-	-	-	X	X	X
13 – 14	-	-	X	-	-	X
15 – 16	-	-	X	-	-	X
17 – 18	-	X	-	-	X	-
19 – 20	-	X	-	-	X	-
21 – 22	X	-	-	X	-	-
23 – 24	X	-	-	X	-	-
Маркировка	1	2	3	4	5	6

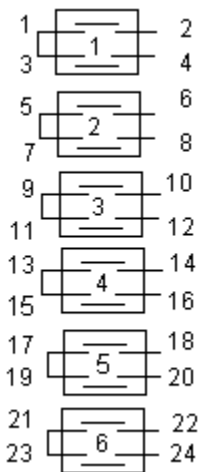


Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	-	-	-	-	-
3 – 4	X	-	-	-	-	-
5 – 6	-	X	-	-	-	-
7 – 8	-	X	-	-	-	-
9 – 10	-	-	X	-	-	-
11 – 12	-	-	X	-	-	-
13 – 14	-	-	-	X	-	-
15 – 16	-	-	-	X	-	-
17 – 18	-	-	-	-	X	-
19 – 20	-	-	-	-	X	-
21 – 22	-	-	-	-	-	X
23 – 24	-	-	-	-	-	X
Маркировка	5	6	1	2	3	4

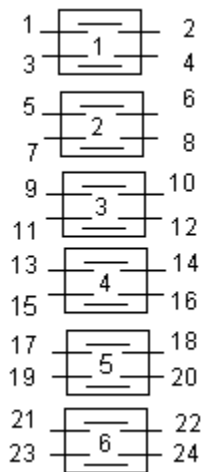


Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	X	-	-	-	-	-
3 – 4	X	-	X	-	-	-	-
5 – 6	X	X	-	-	-	-	-
7 – 8	-	-	X	X	X	-	-
9 – 10	-	X	-	X	-	X	-
11 – 12	-	-	X	X	X	-	-
13 – 14	-	-	-	-	-	X	X
15 – 16	-	-	-	-	X	-	X
17 – 18	-	-	-	-	-	X	X
19 – 20	X	-	X	-	-	-	-
21 – 22	-	X	-	X	-	X	-
23 – 24	-	-	-	-	X	-	X
Маркировка	5	6	7	1	2	3	4

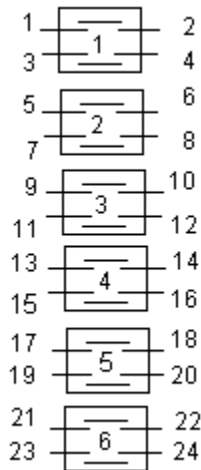


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	-	X
5 – 6	X	-	-	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	-	-	-	X
13 – 14	-	X	-	-
15 – 16	-	-	X	-
17 – 18	-	X	-	-
19 – 20	-	-	X	-
21 – 22	-	X	-	-
23 – 24	-	-	X	-
Маркировка	1	2	3	4

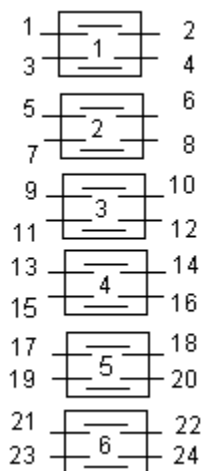


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	-	X	-
5 – 6	-	-	X
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	-	X	-
13 – 14	-	X	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	-	X	-
21 – 22	-	X	-
23 – 24	-	-	X
Маркировка	0	1	2

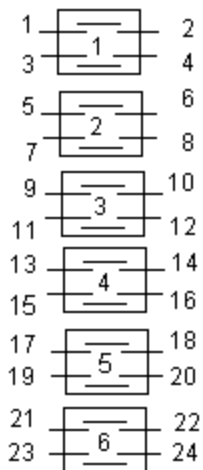

Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 – 2	-	-	-	X
3 – 4	-	X	-	-
5 – 6	-	-	-	X
7 – 8	-	X	-	-
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	X
15 – 16	X	X	-	-
17 – 18	-	-	X	X
19 – 20	X	X	-	-
21 – 22	-	-	X	X
23 – 24	X	X	-	-
Маркировка	4	3	1	2

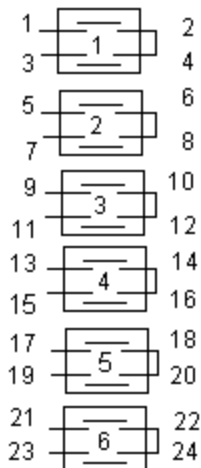


Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	X	-	-
23 – 24	-	-	X
Маркировка	2	0(-)	1

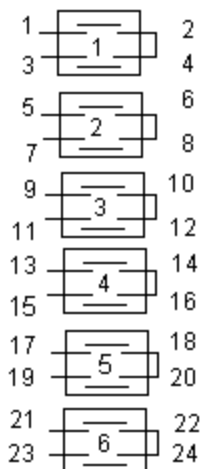


Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 – 2	-	X	-
3 – 4	-	X	-
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	-	X	-
23 – 24	-	X	-
Маркировка	3	1	2


Стр.	АВКГ 1848				
06-28		Изм.	Лист	№ докум.	Подпись
					Дата

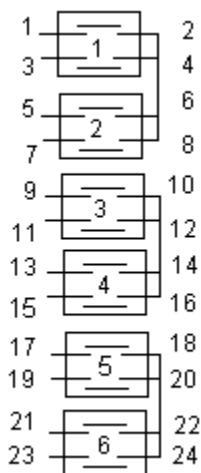


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	-	X	-	-	-
7 - 8	-	-	-	X	-
9 - 10	X	-	-	-	-
11 - 12	-	-	-	-	X
13 - 14	-	X	-	-	-
15 - 16	-	-	-	X	-
17 - 18	X	-	-	-	-
19 - 20	-	-	-	-	X
21 - 22	-	X	-	-	-
23 - 24	-	-	-	X	-
Маркировка	3	4	0	1	2

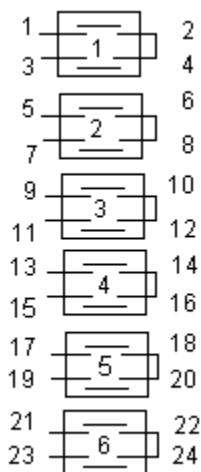


Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135
1 - 2	-	-	-	-	X	-
3 - 4	X	-	-	-	-	-
5 - 6	-	-	-	-	-	X
7 - 8	-	X	-	-	-	-
9 - 10	-	-	-	X	-	-
11 - 12	-	-	X	-	-	-
13 - 14	-	-	X	-	-	-
15 - 16	-	-	-	X	-	-
17 - 18	-	X	-	-	-	-
19 - 20	-	-	-	-	-	X
21 - 22	X	-	-	-	-	-
23 - 24	-	-	-	-	X	-
Маркировка	4	5	6	1	2	3

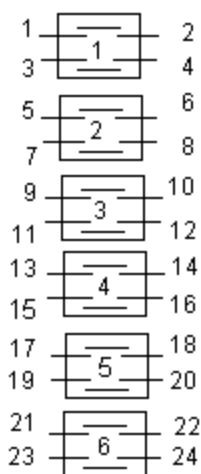


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	X	-	-	-	-
5 - 6	-	X	-	-	-
7 - 8	-	X	-	-	-
9 - 10	X	-	X	-	-
11 - 12	-	-	X	-	-
13 - 14	-	X	-	X	-
15 - 16	-	-	-	X	-
17 - 18	-	-	-	-	X
19 - 20	-	-	-	-	X
21 - 22	X	X	X	-	-
23 - 24	-	-	-	X	X
Маркировка	1	2	3	4	5

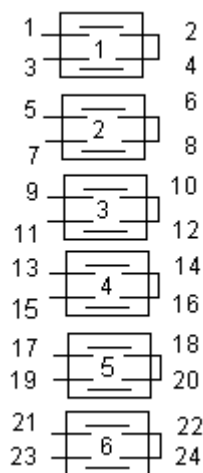

Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	X	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	X	X	X	-	-	-	-
7 – 8	-	-	-	-	X	X	X
9 – 10	X	X	X	-	-	-	-
11 – 12	-	-	-	-	X	X	X
13 – 14	X	X	-	-	-	-	X
15 – 16	-	-	X	-	X	X	-
17 – 18	-	-	X	-	X	-	-
19 – 20	X	-	-	-	-	-	X
21 – 22	-	X	X	-	X	X	X
23 – 24	X	X	X	-	-	X	X
Маркировка	5	6	7	1	2	3	4

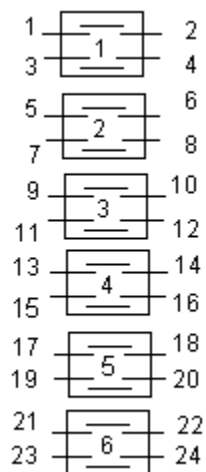

Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	-	-	X	X	X
3 – 4	-	-	-	-	-	X	X	X
5 – 6	-	-	X	X	-	-	-	-
7 – 8	-	-	X	X	-	-	-	-
9 – 10	-	X	-	-	X	-	-	-
11 – 12	-	X	-	-	X	-	-	-
13 – 14	-	X	X	-	-	-	-	X
15 – 16	-	X	X	-	-	-	-	X
17 – 18	-	-	-	-	X	X	-	-
19 – 20	-	-	-	-	X	X	-	-
21 – 22	-	-	-	X	-	-	X	-
23 – 24	-	-	-	X	-	-	X	-
Маркировка	8	7	6	5	4	3	2	1

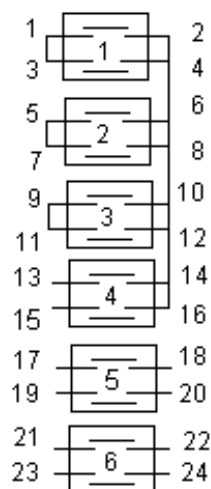

Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0 ⁰	+45 ⁰
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
21 – 22	-	X
23 – 24	X	-
Маркировка	1	2

Стр.

06-30

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

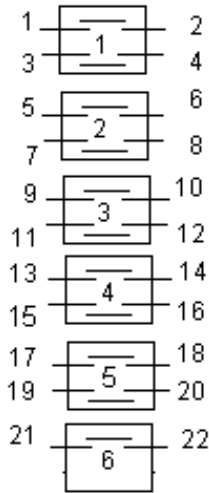


Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	-	-	-	-
3 – 4	-	X	-	-	-	-
5 – 6	-	-	X	-	-	-
7 – 8	-	-	-	X	-	-
9 – 10	-	-	-	X	-	-
11 – 12	-	-	-	-	X	-
13 – 14	-	-	-	-	X	-
15 – 16	-	-	-	-	X	-
17 – 18	-	-	X	X	X	-
19 – 20	-	-	X	X	X	-
21 – 22	-	-	-	-	-	X
Маркировка	0	1	2	3	4	5

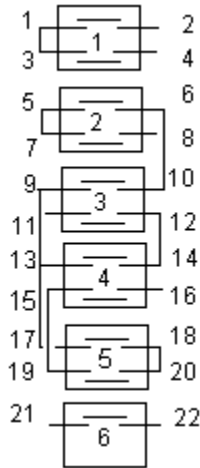


Соединяемые контакты	Способ фиксации: E		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	X	X	X
Маркировка	2	0	1

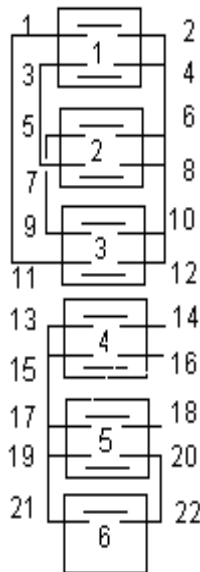


Соединяемые контакты	Способ фиксации: M						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	X	-	-
3 – 4	-	-	-	-	-	-	X
5 – 6	-	-	-	-	-	X	-
7 – 8	X	-	-	-	-	-	-
9 – 10	-	-	X	-	-	-	-
11 – 12	-	X	-	-	-	-	-
13 – 14	-	-	-	-	-	-	X
15 – 16	-	-	-	-	X	-	-
17 – 18	-	-	-	-	-	X	-
19 – 20	X	-	X	-	-	-	-
21 – 22	-	X	-	-	-	-	-
Маркировка	4	5	6	0	1	2	3

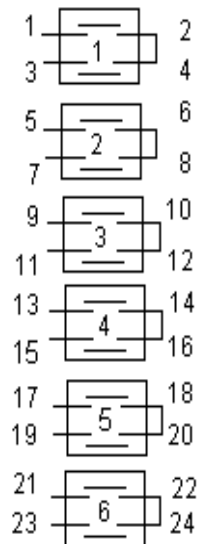

Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	X	X
5 – 6	X	X	-
7 – 8	-	-	X
9 – 10	X	X	-
11 – 12	-	-	X
13 – 14	-	X	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	-	-	X
23 – 24	-	X	X
Маркировка	3 (1)	1 (-)	2

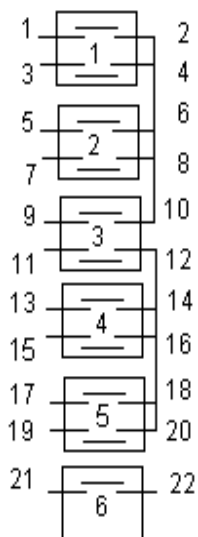

Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	-	-	-	-
3 – 4	-	-	X	-	-	-
5 – 6	-	-	-	X	-	-
7 – 8	-	-	-	-	X	-
9 – 10	-	-	-	-	-	X
11 – 12	-	X	-	-	-	-
13 – 14	-	-	X	-	-	-
15 – 16	-	-	-	X	-	-
17 – 18	-	-	-	-	X	-
19 – 20	-	-	-	-	-	X
21 – 22	-	X	X	X	X	X
Маркировка	0	1	2	3	4	5

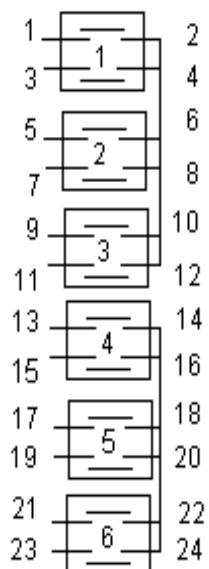

Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	X	-
3 – 4	X	-	-	-	-	-
5 – 6	-	-	-	-	-	X
7 – 8	-	X	-	-	-	-
9 – 10	-	-	-	X	-	-
11 – 12	-	-	X	-	-	-
13 – 14	-	-	X	-	-	-
15 – 16	-	-	-	X	-	-
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	-	-	X
21 – 22	X	-	-	-	-	-
23 – 24	-	-	-	-	X	-
Маркировка	1	2	3	4	5	6

Стр.

06-32

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

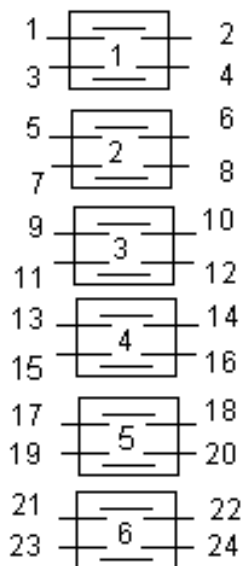


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	-	-	X
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	X	-
11 – 12	X	-	-	-
13 – 14	-	-	X	-
15 – 16	X	-	-	-
17 – 18	X	X	-	-
19 – 20	-	-	X	X
21 – 22	X	X	-	-
23 – 24	-	-	X	X
Маркировка	1	2	3	4

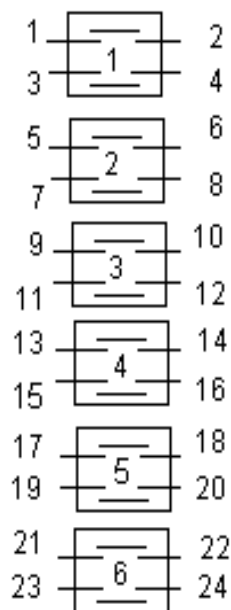


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	X	-	-
3 – 4	-	-	X	-	-
5 – 6	X	X	-	-	-
7 – 8	X	X	-	-	-
9 – 10	-	-	X	-	-
11 – 12	-	-	X	-	-
13 – 14	X	-	-	-	X
15 – 16	X	-	-	-	X
17 – 18	-	-	X	-	-
19 – 20	-	-	X	-	-
21 – 22	-	-	-	X	X
23 – 24	-	-	-	X	X
Маркировка	1	2	3	4	5

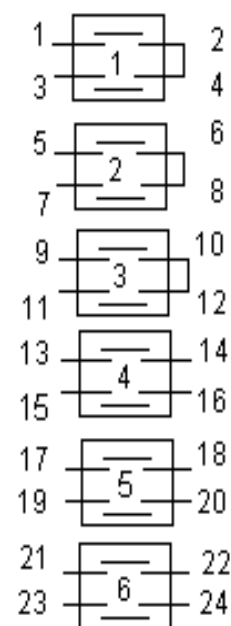


Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	X	-
3 – 4	X	-	-	-	-	-
5 – 6	-	-	-	-	-	X
7 – 8	-	X	-	-	-	-
9 – 10	-	-	-	X	-	-
11 – 12	-	-	X	-	-	-
13 – 14	-	-	X	-	-	-
15 – 16	-	-	-	X	-	-
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	-	-	X
21 – 22	X	-	-	-	-	-
23 – 24	-	-	-	-	X	-
Маркировка	5	6	1	2	3	4

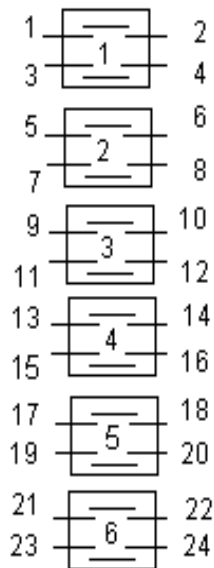


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	X	-	-	X	X
5 - 6	-	X	-	X	-
7 - 8	-	X	-	X	-
9 - 10	-	X	-	-	-
11 - 12	X	-	-	X	X
13 - 14	-	X	-	X	-
15 - 16	-	X	-	X	-
17 - 18	X	-	-	-	X
19 - 20	X	-	-	-	X
21 - 22	-	-	-	X	X
23 - 24	X	X	-	-	-
Маркировка	3	4	0	1	2

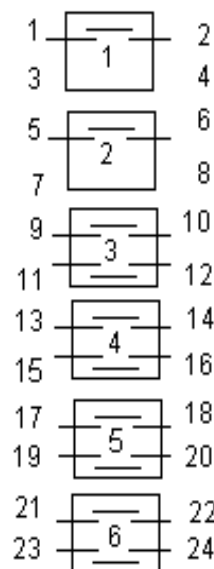


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	X	-	-	-	-	-	-	-
3 - 4	-	-	-	-	-	-	-	-
5 - 6	-	X	X	X	X	X	X	X
7 - 8	-	-	-	-	-	-	-	-
9 - 10	X	-	-	-	-	-	-	-
11 - 12	-	-	-	-	X	-	-	-
13 - 14	-	X	-	-	-	-	-	-
15 - 16	-	-	-	-	-	X	-	-
17 - 18	-	-	X	-	-	-	-	-
19 - 20	-	-	-	-	-	-	X	-
21 - 22	-	-	-	X	-	-	-	-
23 - 24	-	-	-	-	-	-	-	X
Маркировка	1	2	3	4	5	6	7	8

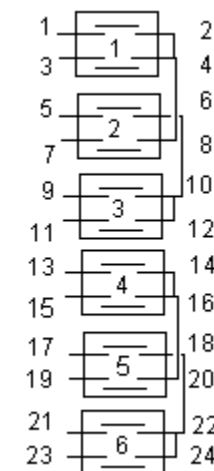


Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90 ⁰	0 ⁰	+90 ⁰
1 - 2	X	-	-
3 - 4	-	X	-
5 - 6	-	-	X
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	X	-
13 - 14	X	-	-
15 - 16	-	X	-
17 - 18	-	-	X
19 - 20	-	-	X
21 - 22	X	-	-

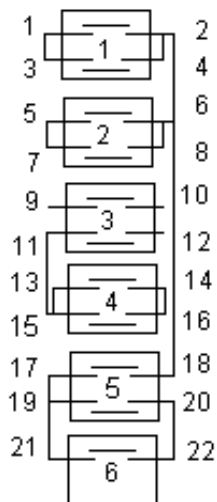


6112 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0^0	$+45^0$
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
21 – 22	-	X
23 – 24	X	-
Маркировка	1	2

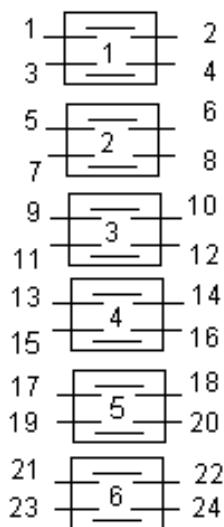


6113 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45^0	0^0	$+45^0$
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	-	X	X
15 – 16	X	-	-
17 – 18	-	X	X
19 – 20	X	-	-
21 – 22	-	X	X
23 – 24	X	-	-
Маркировка	1	2	3

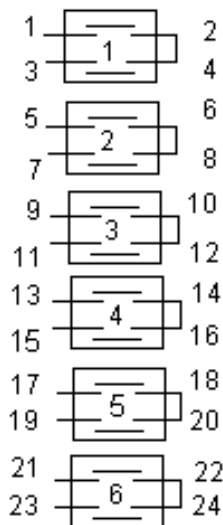


6114 Соединяемые контакты	Способ фиксации: Д			
	Положение рукоятки			
	-90^0	0	$+90^0$	$+180^0$
1 – 2	X	-	X	-
3 – 4	-	X	-	X
5 – 6	X	X	-	-
7 – 8	-	-	X	X
9 – 10	X	-	X	-
11 – 12	-	X	-	X
13 – 14	X	X	-	-
15 – 16	-	-	X	X
17 – 18	X	-	X	-
19 – 20	-	X	-	X
21 – 22	X	X	-	-
23 – 24	-	-	X	X
Маркировка	1	2	3	4

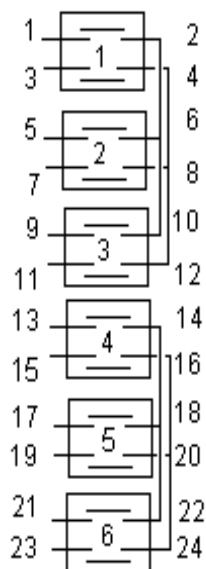


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0	+45 ⁰	+90 ⁰
1 – 2	-	X	-	-
3 – 4	-	X	-	-
5 – 6	-	-	X	-
7 – 8	-	-	X	-
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 – 14	-	X	-	-
15 – 16	-	X	-	-
17 – 18	-	-	X	-
19 – 20	-	-	X	-
21 – 22	-	-	-	X
23 – 24	-	-	-	X
Маркировка	0	1	2	3

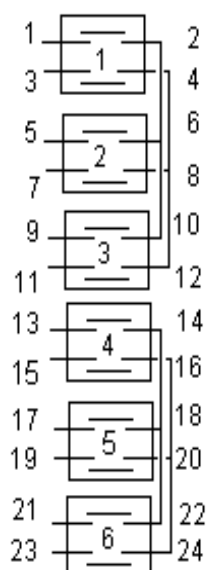

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	-	X	-
7 – 8	-	X	-
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	X	-
19 – 20	-	X	-
21 – 22	-	-	X
23 – 24	-	-	X
Маркировка	1	2	3

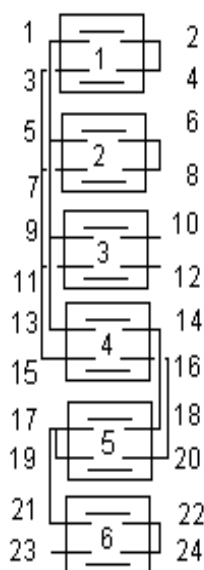

Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	-	X	X
3 - 4	X	X	-	-	-
5 – 6	X	X	-	-	-
7 – 8	-	-	-	X	X
9 – 10	X	-	-	-	X
11 - 12	X	-	-	-	X
13 - 14	-	X	-	X	-
15 - 16	-	X	-	X	-
17 - 18	X	-	-	-	X
19 - 20	X	-	-	-	X
21 – 22	-	X	-	X	-
23 - 24	X	-	-	-	X
Маркировка	4	3	0	1	2

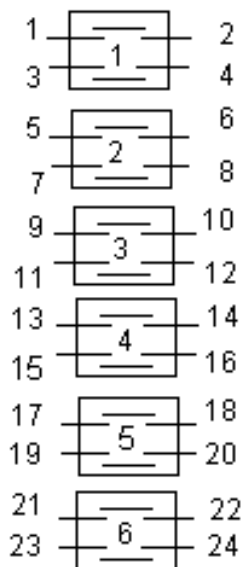

6118 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	X	X	-	-
15 – 16	X	-	-	-
17 – 18	X	-	-	-
19 – 20	-	-	X	-
21 – 22	-	X	-	-
23 – 24	-	-	-	X
Маркировка	3	4	1	2