




8001 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	X	-	-	-
5 - 6	-	X	-	-	-
7 - 8	-	-	X	-	-
9 - 10	-	-	-	-	X
11 - 12	-	-	-	-	X
13 - 14	X	-	-	X	-
15 - 16	-	-	X	-	-
17 - 18	-	X	-	-	-
19 - 20	-	-	-	X	-
21 - 22	-	X	-	-	-
23 - 24	-	X	-	-	X
25 - 26	X	-	X	X	-
27 - 28	X	X	X	-	X
29 - 30	X	-	X	-	X

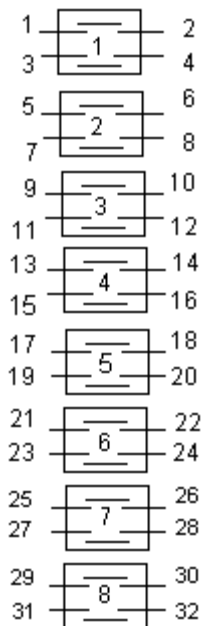


8002 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 - 2	-	-	-	-	-	-	-	X
3 - 4	-	-	-	X	-	-	-	-
5 - 6	X	-	-	-	-	-	-	-
7 - 8	-	-	-	-	X	-	-	-
9 - 10	-	X	-	-	-	-	-	-
11 - 12	-	-	-	-	-	X	-	-
13 - 14	-	-	X	-	-	-	-	-
15 - 16	-	-	-	-	-	-	X	-
17 - 18	-	-	-	-	-	-	-	X
19 - 20	-	-	-	X	-	-	-	-
21 - 22	X	-	-	-	-	-	-	-
23 - 24	-	-	-	-	X	-	-	-
25 - 26	-	X	-	-	-	-	-	-
27 - 28	-	-	-	-	-	X	-	-
29 - 30	-	-	X	-	-	-	-	-
31 - 32	-	-	-	-	-	-	X	-

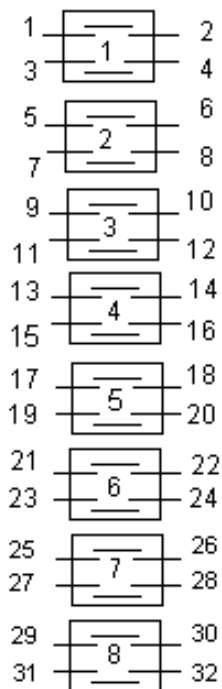


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	X
3 - 4	X	-	-	-	X
5 - 6	X	-	-	-	X
7 - 8	X	-	-	-	X
9 - 10	X	-	-	-	X
11 - 12	X	-	-	-	X
13 - 14	X	-	-	-	X
15 - 16	X	-	-	-	X
17 - 18	X	-	-	-	X
19 - 20	X	-	-	-	X
21 - 22	X	-	-	-	X
23 - 24	X	-	-	-	X
25 - 26	X	-	-	-	X
27 - 28	X	-	-	-	X
29 - 30	X	-	-	-	X
31 - 32	-	-	X	-	-

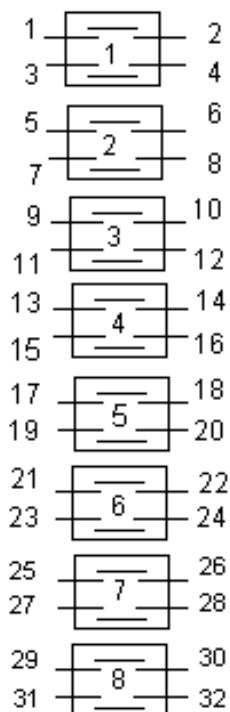


Соединяемые контакты	Способ фиксации: А, (Ж), С		
	Положение рукоятки		
	-45 ⁰	0 ⁰ (-)	+45 ⁰
1 - 2	-	-	X
3 - 4	X	-	-
5 - 6	-	-	X
7 - 8	X	-	-
9 - 10	-	-	X
11 - 12	X	-	-
13 - 14	-	-	X
15 - 16	X	-	-
17 - 18	-	-	X
19 - 20	X	-	-
21 - 22	-	-	X
23 - 24	X	-	-
25 - 26	-	-	X
27 - 28	X	-	-
29 - 30	-	-	X
31 - 32	X	-	-

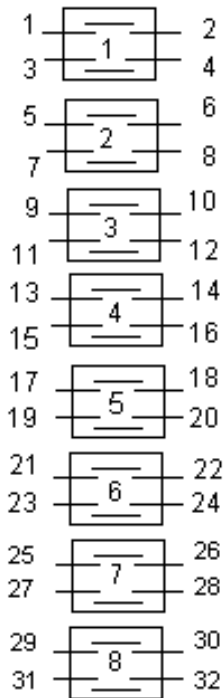


8005 Соединяемые контакты	Способ фиксации: Л, Е				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-	X	-	-
3 - 4	-	-	X	-	-
5 - 6	-	-	X	-	-
7 - 8	-	-	X	-	-
9 - 10	-	-	X	-	-
11 - 12	X	-	-	-	X
13 - 14	-	-	-	-	X
15 - 16	X	-	X	-	-
17 - 18	-	-	-	-	X
19 - 20	X	-	X	-	-
21 - 22	-	-	-	-	X
23 - 24	X	-	X	-	-
25 - 26	-	-	-	-	X
27 - 28	X	-	X	-	-
29 - 30	-	-	-	-	X
31 - 32	X	-	X	-	-

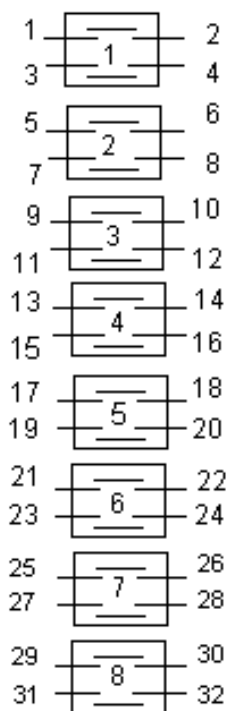


8007 Соединяемые контакты	Способ фиксации: Л, (Е)				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	X	-	X
5 - 6	X	-	-	-	-
7 - 8	-	-	X	-	X
9 - 10	X	-	-	-	-
11 - 12	-	-	X	-	X
13 - 14	X	-	-	-	-
15 - 16	-	-	X	-	X
17 - 18	X	-	-	-	-
19 - 20	-	-	X	-	X
21 - 22	-	-	-	-	X
23 - 24	-	-	X	-	X
25 - 26	-	-	X	-	-
27 - 28	-	-	X	-	-
29 - 30	-	-	X	-	-
31 - 32	-	-	X	-	-

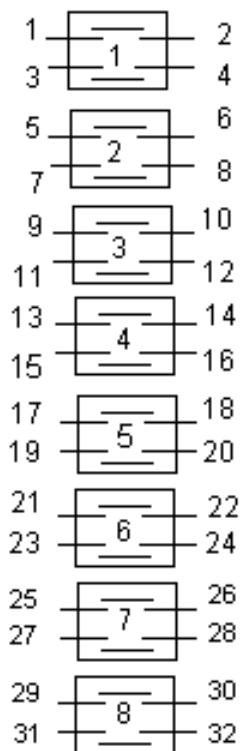


8008 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 - 20	-	-	X
21 – 22	X	-	-
23 - 24	-	-	X
25 - 26	X	-	-
27 - 28	-	X	X
29 – 30	-	X	-
31 - 32	-	X	X

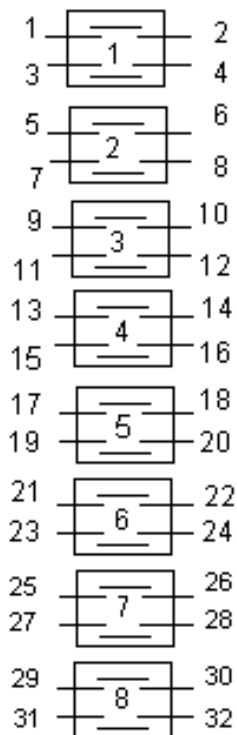


8009 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	-	X
19 - 20	-	-	X
21 – 22	-	-	X
23 - 24	-	-	X
25 - 26	-	X	-
27 - 28	-	X	X
29 – 30	-	X	X
31 - 32	-	X	X

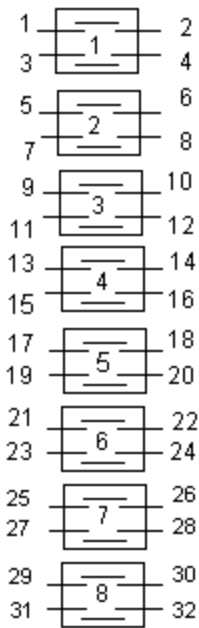


8010 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-		X	-
3 - 4	-	X	-	-	-
5 - 6	-	-	-	-	X
7 - 8	X	-	-	-	-
9 - 10	-	-	-	X	-
11 - 12	-	X	-	-	-
13 - 14	-	-	-	-	X
15 - 16	X	-	-	-	-
17 - 18	-	-	-	X	-
19 - 20	-	X	-	-	-
21 - 22	-	-	-	-	X
23 - 24	X	-	-	-	-
25 - 26	-	-	-	X	-
27 - 28	-	X	-	-	-
29 - 30	-	-	-	-	X
31 - 32	X	-	-	-	-

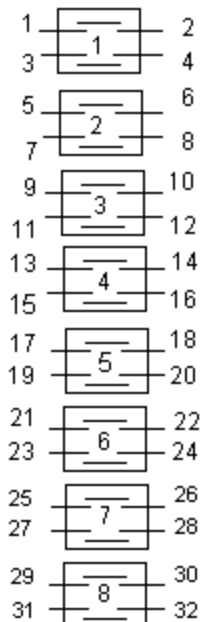


8011 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 - 2	X	-	-	-	-	-	X
3 - 4	-	-	X	-	X	-	-
5 - 6	X	-	X	-	X	-	X
7 - 8	X	-	X	-	X	-	X
9 - 10	-	-	-	-	X	-	-
11 - 12	X	-	-	-	-	-	-
13 - 14	-	-	-	-	-	-	X
15 - 16	-	-	X	-	-	-	-
17 - 18	X	-	-	-	-	-	-
19 - 20	-	-	-	-	X	-	-
21 - 22	-	-	X	-	-	-	-
23 - 24	-	-	-	-	-	-	X
25 - 26	X	-	X	-	X	-	X
27 - 28	X	-	-	-	-	-	X
29 - 30	X	-	-	-	-	-	X
31 - 32	X	-	-	-	-	-	X

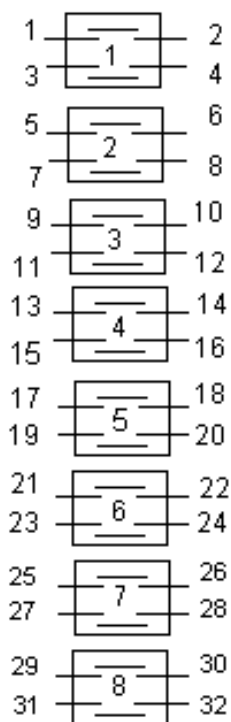


8012 Соединяемые контакты	Способ фиксации: Ж, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	X	-	-
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	X	-	-
11 – 12	X	-	-
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	-	-	X
21 – 22	-	-	X
23 – 24	-	-	X
25 – 26	-	-	X
27 – 28	-	-	X
29 – 30	-	-	X
31 – 32	-	-	X

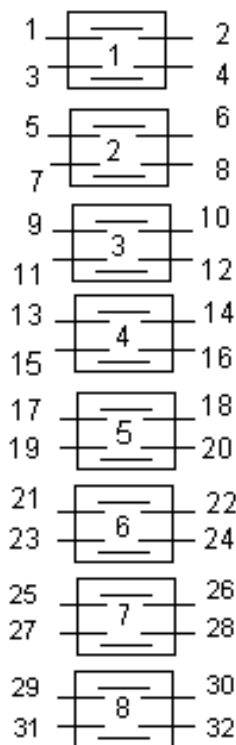


8013 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	-		X	-
3 - 4	-	-	X	-	-
5 – 6	X	X	-	X	X
7 – 8	X	X	-	X	X
9 – 10	-	-	X	-	-
11 - 12	-	-	X	-	-
13 - 14	X	-	-	-	-
15 - 16	X	-	-	-	-
17 - 18	-	X	-	-	-
19 - 20	-	-	-	X	-
21 – 22	X	-	-	X	X
23 - 24	X	-	-	X	X
25 – 26	-	-	-	X	X
27 – 28	X	X	-	X	X
29 – 30	X	X	-	X	X
31 - 32	-	X	-	X	X

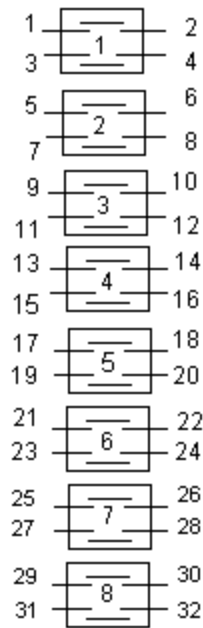


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	X
3 – 4	X	X	-
5 – 6	-	X	X
7 – 8	X	X	-
9 – 10	-	X	X
11 – 12	X	X	-
13 – 14	-	-	X
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	X	-	-
21 – 22	-	-	X
23 – 24	X	-	-
25 – 26	-	-	X
27 – 28	X	-	-
29 – 30	-	-	X
31 – 32	X	-	-

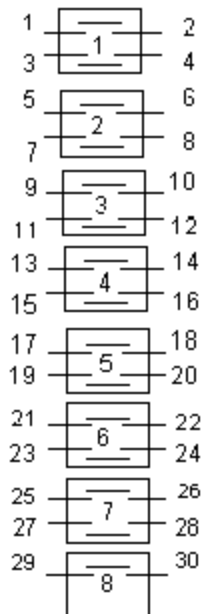


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 – 2	-	X	-	-	-	-	-	-
3 – 4	-	-	-	-	-	X	-	-
5 – 6	-	-	-	X	-	-	-	-
7 – 8	-	X	-	X	-	X	-	-
9 – 10	-	X	-	X	-	X	-	-
11 – 12	-	-	-	X	-	-	-	-
13 – 14	-	-	-	-	-	X	-	-
15 – 16	-	X	-	-	-	-	-	-
17 – 18	-	-	-	X	-	-	-	-
19 – 20	-	X	-	X	-	X	-	-
21 – 22	-	-	-	-	-	X	-	-
23 – 24	-	X	-	-	-	-	-	-
25 – 26	-	-	-	-	-	X	-	-
27 – 28	-	-	-	-	-	X	-	-
29 – 30	-	-	-	-	-	X	-	-

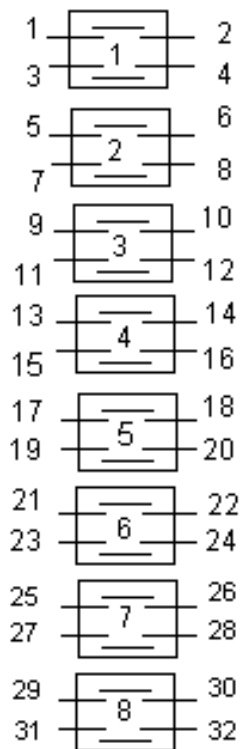


Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90^0	-45^0	0^0	$+45^0$
1 – 2	X	X	-	X
3 – 4	X	-	-	X
5 – 6	X	X	-	X
7 – 8	X	-	-	X
9 – 10	X	X	-	-
11 – 12	-	-	-	X
13 – 14	-	X	-	-
15 – 16	-	-	-	X
17 – 18	-	X	-	-
19 – 20	-	-	-	X
21 – 22	X	-	-	-
23 – 24	-	-	X	-
25 – 26	X	-	-	-
27 – 28	-	-	X	-
29 – 30	X	-	-	-
31 – 32	-	-	X	-

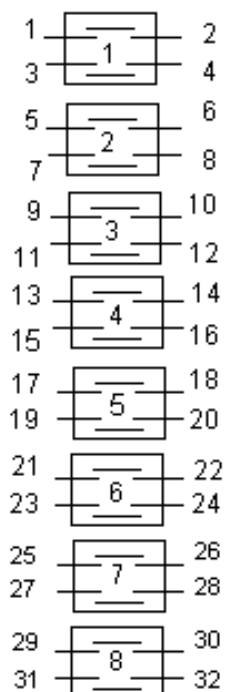


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90^0	-45^0	0^0	$+45^0$	$+90^0$
1 - 2	-	X	-	-	-
3 - 4	-	X	X	-	-
5 – 6	-	-	X	X	-
7 – 8	-	-	-	X	-
9 – 10	-	X	X	X	-
11 - 12	-	X	X	X	-
13 - 14	-	X	X	X	-
15 - 16	-	X	X	X	-
17 - 18	-	X	-	-	-
19 - 20	-	-	X	X	-
21 – 22	-	X	-	-	-
23 - 24	-	-	X	X	-
25 – 26	-	X	-	-	-
27 – 28	-	-	X	X	-
29 – 30	-	X	-	-	-
31 - 32	-	-	X	X	-

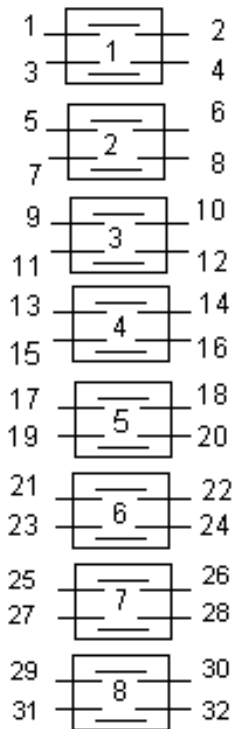


8018 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	X	-
15 – 16	X	-
17 – 18	X	-
19 – 20	X	-
21 – 22	X	-
23 – 24	X	-
25 – 26	X	-
27 – 28	X	-
29 – 30	X	-
31 – 32	X	-

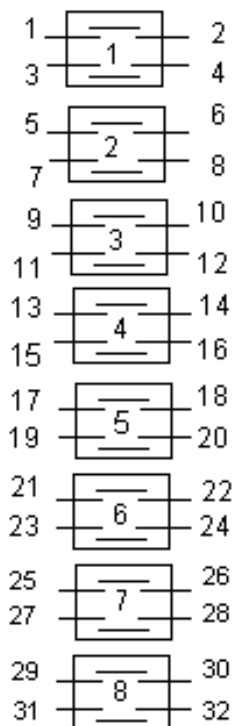


8019 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 – 6	X	-	-	-	-
7 – 8	-	-	-	-	X
9 – 10	X	-	-	-	-
11 - 12	-	-	-	-	X
13 - 14	X	-	-	-	-
15 - 16	-	-	-	-	X
17 - 18	-	-	-	-	X
19 - 20	X	-	-	-	-
21 – 22	-	-	-	X	-
23 - 24	-	-	-	X	-
25 – 26	-	X	-	-	-
27 – 28	-	X	-	-	-
29 – 30	X	X	-	-	-
31 - 32	-	-	-	X	X

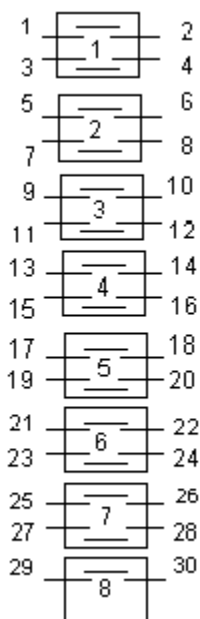


8020 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	X	-	-	-	-
7 - 8	-	-	-	-	X
9 - 10	X	-	-	-	-
11 - 12	-	-	-	-	X
13 - 14	-	-	-	X	-
15 - 16	-	-	X	-	-
17 - 18	-	-	-	X	-
19 - 20	-	-	X	-	-
21 - 22	-	X	-	-	-
23 - 24	-	-	-	-	X
25 - 26	X	-	-	X	X
27 - 28	X	-	-	X	X
29 - 30	-	-	-	X	X

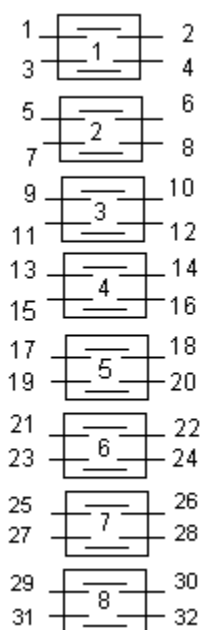


8021 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	-	X	X
3 - 4	X	X	-
5 - 6	-	X	X
7 - 8	X	X	-
9 - 10	-	X	X
11 - 12	X	X	-
13 - 14	-	X	X
15 - 16	X	X	-
17 - 18	X	-	-
19 - 20	-	-	X
21 - 22	X	-	-
23 - 24	-	-	X
25 - 26	X	-	X
27 - 28	-	X	-
29 - 30	X	-	X
31 - 32	-	X	-

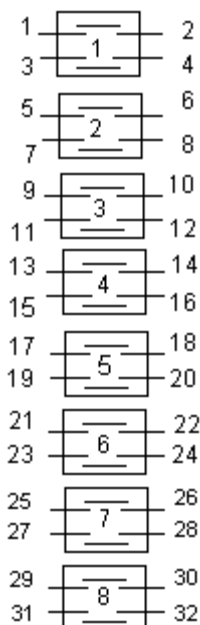


8022 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	X	-	-
23 – 24	-	-	X
25 – 26	-	X	X
27 – 28	-	X	X
29 – 30	-	-	X
31 – 32	-	X	X

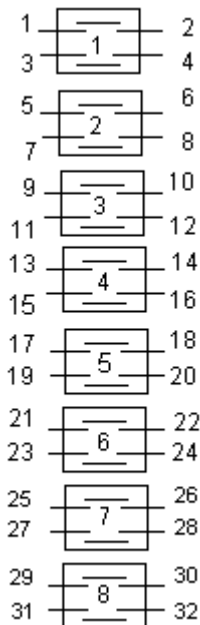

8023 Соединяемые контакты	Способ фиксации: М						
	Положение рукоятки						
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	-	-	-	X	-	-
3 – 4	X	-	-	-	-	-	-
5 – 6	-	-	-	-	X	-	-
7 – 8	X	-	-	-	-	-	-
9 – 10	-	-	-	-	X	-	-
11 – 12	X	-	-	-	-	-	-
13 – 14	-	-	-	-	-	X	-
15 – 16	-	X	-	-	-	-	-
17 – 18	-	-	-	-	-	X	-
19 – 20	-	X	-	-	-	-	-
21 – 22	-	-	-	-	-	X	-
23 – 24	-	X	-	-	-	-	-
25 – 26	-	-	X	-	-	-	-
27 – 28	-	-	-	-	-	-	X
29 – 30	-	-	X	-	-	-	-
31 – 32	-	-	-	-	-	-	X

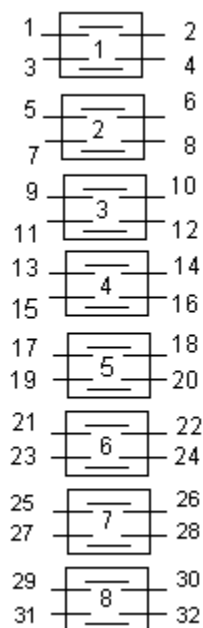

8024 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	X	-
3 – 4	-	X	X
5 – 6	-	-	X
7 – 8	-	X	X
9 – 10	X	-	-
11 – 12	-	X	X
13 – 14	X	-	-
15 – 16	-	X	X
17 – 18	X	X	-
19 – 20	-	-	X
21 – 22	X	X	-
23 – 24	-	-	X
25 – 26	-	X	-
27 – 28	-	-	X
29 – 30	-	X	-
31 – 32	-	-	X

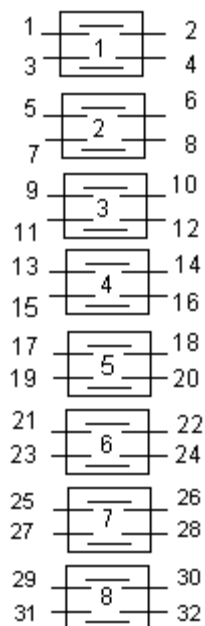

8025 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	X	-	-
21 – 22	-	-	X
23 – 24	X	-	-
25 – 26	-	-	X
27 – 28	-	-	X
29 – 30	X	-	-
31 – 32	-	-	X

Стр.

08-12

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

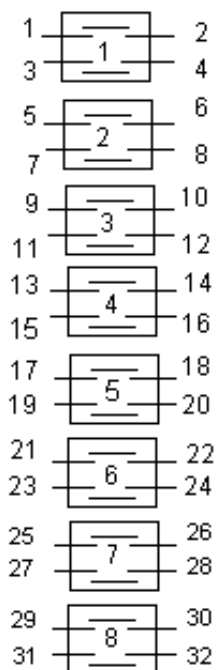


8026 Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	X	-	-
13 – 14	-	-	X	-
15 – 16	X	-	-	-
17 – 18	-	X	X	X
19 – 20	-	X	X	X
21 – 22	-	X	X	X
23 – 24	-	X	X	X
25 – 26	-	X	X	X
27 – 28	-	X	X	X
29 – 30	X	-	-	-
31 – 32	X	-	-	-

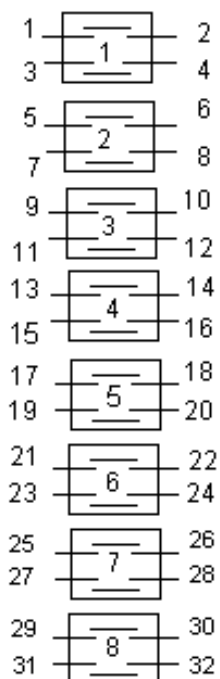

8029 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	-	X	-	-	-
3 - 4	-	-	-	X	-
5 – 6	-	X	-	-	-
7 – 8	-	-	-	X	-
9 – 10	-	X	-	-	-
11 - 12	-	-	-	X	-
13 - 14	-	-	X	-	-
15 - 16	X	-	-	-	-
17 - 18	-	-	-	-	X
19 - 20	-	-	-	-	X
21 – 22	-	-	X	-	-
23 - 24	X	-	-	-	-
25 – 26	-	-	-	-	X
27 – 28	X	-	-	-	-
29 – 30	-	-	X	-	-
31 - 32	X	-	-	-	-

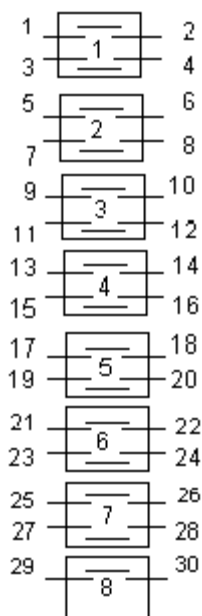

Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135^0	-90^0	-45^0	0^0	$+45^0$	$+90^0$	$+135^0$	$+180^0$
1 – 2	-	X	-	-	-	-	-	-
3 – 4	-	-	X	-	-	-	-	-
5 – 6	-	-	X	-	-	-	-	-
7 – 8	-	-	-	X	-	-	-	-
9 – 10	-	-	-	X	-	-	-	-
11 – 12	-	-	-	-	X	-	-	-
13 – 14	-	-	-	-	X	-	-	-
15 – 16	-	-	-	-	-	X	-	-
17 – 18	-	-	-	-	-	X	-	-
19 – 20	-	-	-	-	-	-	X	-
21 – 22	-	-	-	-	-	-	X	-
23 – 24	-	-	-	-	-	-	X	-
25 – 26	-	-	-	-	-	-	-	X
27 – 28	-	-	-	-	-	-	-	X
29 – 30	-	-	-	-	-	-	-	X

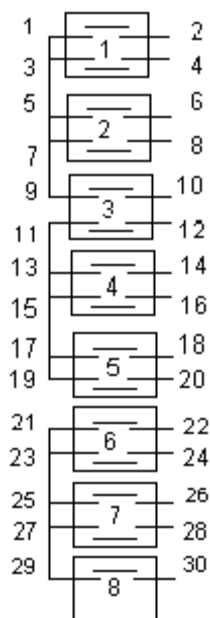

Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90^0	-45^0	0^0	$+45^0$	$+90^0$
1 - 2	X	-	-	-	-
3 - 4	-	X	-	-	-
5 – 6	-	-	X	-	-
7 – 8	-	-	-	X	-
9 – 10	-	-	-	-	X
11 - 12	X	-	-	-	-
13 - 14	-	X	-	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	-	X	-
19 - 20	-	-	-	-	X
21 – 22	X	-	-	-	-
23 - 24	-	X	-	-	-
25 – 26	-	-	X	-	-
27 – 28	-	-	-	X	-
29 – 30	-	-	-	-	X

Стр.

08-14

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

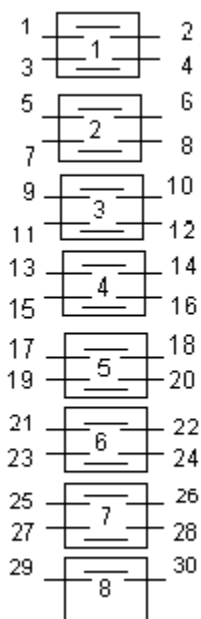


8032 Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90^0	-45^0	0^0	$+45^0$	$+90^0$	$+135^0$
1 – 2	-	-	-	X	X	-
3 – 4	-	X	X	-	-	-
5 – 6	-	-	-	-	-	X
7 – 8	X	-	-	-	-	-
9 – 10	-	-	-	X	X	-
11 – 12	-	-	-	-	-	X
13 – 14	X	X	X	-	-	-
15 – 16	-	-	X	X	-	-
17 – 18	-	-	-	-	X	X
19 – 20	X	X	-	-	-	-
21 – 22	X	X	-	X	-	-
23 – 24	-	-	X	-	X	X
25 – 26	-	-	X	X	-	-
27 – 28	-	-	-	-	X	X
29 – 30	X	X	-	-	-	-

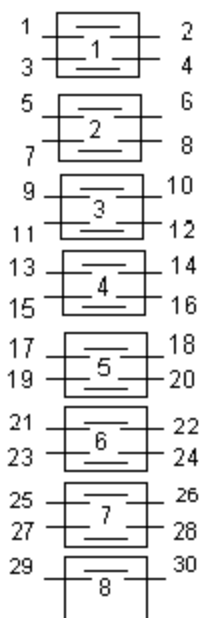


8033 Соединяемые контакты	Способ фиксации: M						
	Положение рукоятки						
	-135^0	-90^0	-45^0	0^0	$+45^0$	$+90^0$	$+135^0$
1 – 2	X	X	X	-	-	-	-
3 – 4	-	-	-	X	-	-	-
5 – 6	-	-	-	-	X	-	-
7 – 8	-	-	-	-	-	X	-
9 – 10	-	-	-	-	-	-	X
11 – 12	-	X	X	-	-	-	-
13 – 14	-	-	-	X	-	-	-
15 – 16	-	-	-	-	X	-	-
17 – 18	-	-	-	-	-	X	-
19 – 20	-	-	-	-	-	-	X
21 – 22	-	-	X	-	-	-	-
23 – 24	-	-	-	X	-	-	-
25 – 26	-	-	-	-	X	-	-
27 – 28	-	-	-	-	-	X	-
29 – 30	-	-	-	-	-	-	X

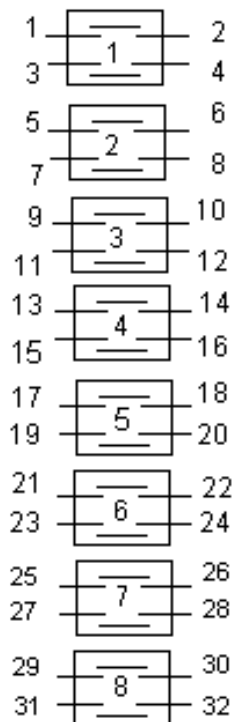


Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	X	-	-	-
3 – 4	-	-	X	-
5 – 6	-	X	-	-
7 – 8	-	-	-	X
9 – 10	X	-	-	-
11 – 12	-	-	X	-
13 – 14	-	X	-	-
15 – 16	-	-	-	X
17 – 18	X	-	-	-
19 – 20	-	-	X	-
21 – 22	-	X	-	-
23 – 24	-	-	-	X
25 – 26	X	-	-	-
27 – 28	-	-	X	-
29 – 30	-	X	-	-
31 – 32	-	-	-	X

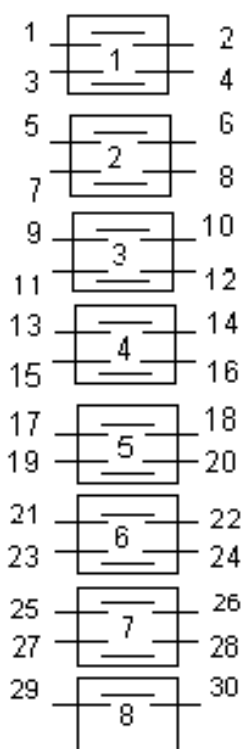


Соединяемые контакты	Способ фиксации: АП		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X
3 – 4	-	X	X
5 – 6	-	X	X
7 – 8	-	X	X
9 – 10	-	X	X
11 – 12	-	X	X
13 – 14	-	X	X
15 – 16	-	X	X
17 – 18	-	X	X
19 – 20	-	X	X
21 – 22	-	X	X
23 – 24	-	X	X
25 – 26	-	-	X
27 – 28	-	-	X
29 – 30	-	X	X

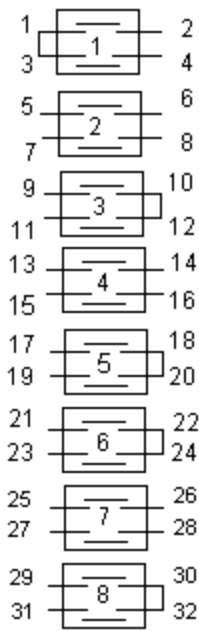


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135^0	-90^0	-45^0	0^0	$+45^0$	$+90^0$	$+135^0$	$+180^0$
1 – 2	X	X	X	-	X	X	X	X
3 – 4	X	X	X	-	-	X	X	X
5 – 6	X	X	X	-	-	-	X	X
7 – 8	X	X	X	-	-	-	-	X
9 – 10	X	X	X	-	-	-	-	-
11 – 12	-	X	X	-	-	-	-	-
13 – 14	-	-	X	-	-	-	-	-
15 – 16	X	X	X	-	-	-	X	X
17 – 18	X	X	X	-	-	-	-	-
19 – 20	-	-	-	-	X	X	X	-
21 – 22	X	-	-	-	X	-	X	-
23 – 24	-	-	X	-	-	-	-	-
25 – 26	X	X	X	-	-	-	-	X
27 – 28	X	X	X	-	-	X	X	X
29 – 30	-	X	X	-	-	-	-	-
31 – 32	-	-	X	-	-	-	-	X

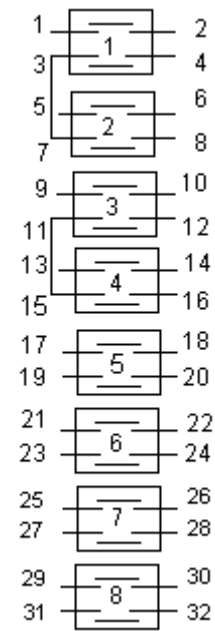

Соединяемые контакты	Способ фиксации: Н (без ограничения хода рукоятки)							
	Положение рукоятки							
	-135^0	-90^0	-45^0	0^0	$+45^0$	$+90^0$	$+135^0$	$+180^0$
1 – 2	-	-	-	X	X	X	-	-
3 – 4	X	X	-	-	-	-	-	X
5 – 6	-	-	X	-	-	-	-	-
7 – 8	-	-	-	-	-	-	X	-
9 – 10	-	-	-	-	X	X	-	-
11 – 12	X	X	-	-	-	-	-	-
13 – 14	-	-	X	-	-	-	-	-
15 – 16	-	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	-	X
19 – 20	-	-	-	X	-	-	-	-
21 – 22	-	X	-	-	-	-	-	-
23 – 24	-	-	-	-	-	X	-	-
25 – 26	-	-	-	X	X	-	-	-
27 – 28	X	-	-	-	-	-	-	X
29 – 30	-	-	-	-	-	-	X	-
31 – 32	-	-	X	-	-	-	-	-

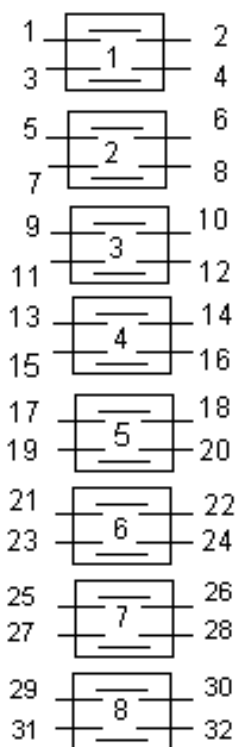

8038 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	X
3 – 4	X	-	X
5 – 6	X	-	X
7 – 8	X	-	X
9 – 10	X	-	X
11 – 12	X	-	X
13 – 14	X	-	X
15 – 16	X	-	X
17 – 18	X	-	X
19 – 20	X	-	X
21 – 22	X	-	X
23 – 24	X	-	X
25 – 26	X	-	X
27 – 28	X	-	X
29 – 30	X	-	X
31 – 32	X	-	X

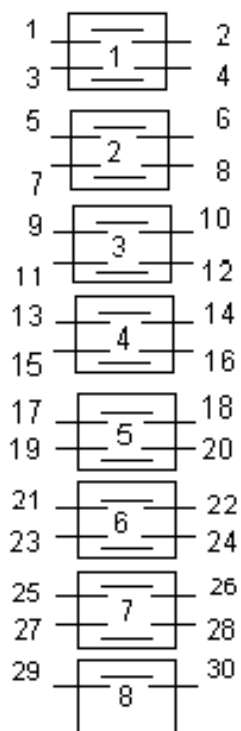

8039 Соединяемые контакты	Способ фиксации: АП		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	X	X
3 – 4	-	X	X
5 – 6	-	X	X
7 – 8	-	X	X
9 – 10	-	X	X
11 – 12	-	X	X
13 – 14	-	X	X
15 – 16	-	X	X
17 – 18	-	X	X
19 – 20	-	X	X
21 – 22	-	X	X
23 – 24	-	X	X
25 – 26	-	X	X
27 – 28	-	-	X
29 – 30	-	-	X

Стр.

08-18

АВКГ 1848


Изм.

Лист


№ докум.

Подпись


Дата

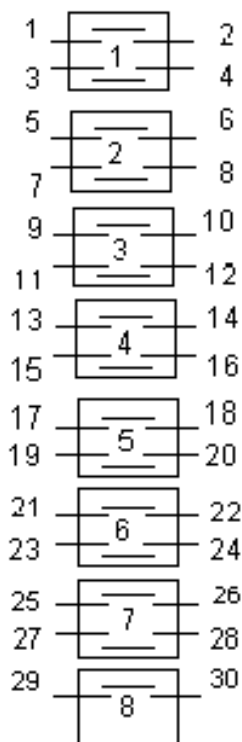


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	X	-	-	-	-
5 - 6	-	X	-	-	-
7 - 8	-	X	-	-	-
9 - 10	-	-	X	-	-
11 - 12	-	-	X	-	-
13 - 14	-	-	-	X	-
15 - 16	-	-	-	X	-
17 - 18	-	-	-	-	X
19 - 20	-	-	-	-	X
21 - 22	X	-	-	-	-
23 - 24	-	X	-	-	-
25 - 26	-	-	X	-	-
27 - 28	-	-	-	X	-
29 - 30	-	-	-	-	X

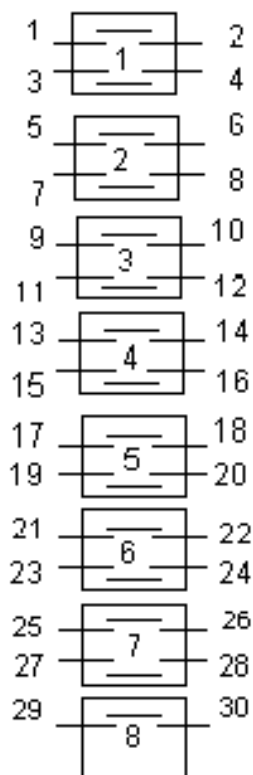


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 - 2	X	-	-
3 - 4	-	-	X
5 - 6	X	-	-
7 - 8	-	-	X
9 - 10	X	-	-
11 - 12	-	-	X
13 - 14	X	-	-
15 - 16	-	-	X
17 - 18	X	-	-
19 - 20	-	-	X
21 - 22	-	X	-
23 - 24	-	X	-
25 - 26	-	X	-
27 - 28	-	X	-
29 - 30	-	X	-

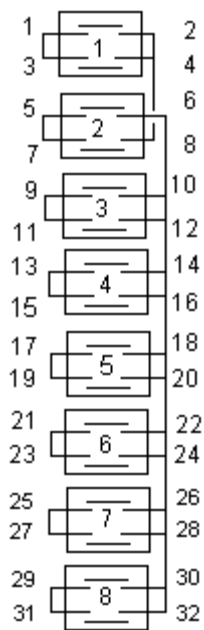


8042 Соединяемые контакты	Способ фиксации: Н (без ограничения хода рукоятки)							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	X	-	-	-	-
3 – 4	-	-	-	X	-	-	-	-
5 – 6	-	-	-	-	X	-	-	-
7 – 8	-	-	-	-	X	-	-	-
9 – 10	-	-	-	-	-	X	-	-
11 – 12	-	-	-	-	-	X	-	-
13 – 14	-	-	-	-	-	-	X	-
15 – 16	-	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	-	X
19 – 20	-	-	-	-	-	-	-	X
21 – 22	X	-	-	-	-	-	-	-
23 – 24	X	-	-	-	-	-	-	-
25 – 26	-	X	-	-	-	-	-	-
27 – 28	-	X	-	-	-	-	-	-
29 – 30	-	-	X	-	-	-	-	-
31 – 32	-	-	X	-	-	-	-	-

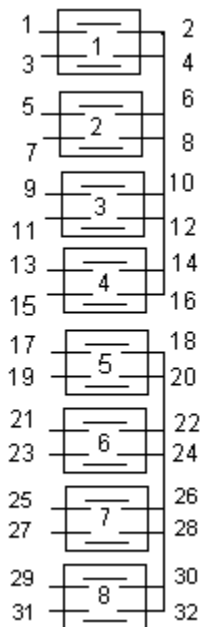


8043 Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135 ⁰	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰	+180 ⁰
1 – 2	-	-	-	-	-	-	-	X
3 – 4	-	-	-	X	-	-	-	-
5 – 6	X	-	-	-	-	-	-	-
7 – 8	-	-	-	-	X	-	-	-
9 – 10	-	X	-	-	-	-	-	-
11 – 12	-	-	-	-	-	X	-	-
13 – 14	-	-	X	-	-	-	-	-
15 – 16	-	-	-	-	-	-	X	-
17 – 18	-	-	-	-	-	-	-	X
19 – 20	-	-	-	X	-	-	-	-
21 – 22	X	-	-	-	-	-	-	-
23 – 24	-	-	-	-	X	-	-	-
25 – 26	-	X	-	-	-	-	-	-
27 – 28	-	-	-	-	-	X	-	-
29 – 30	-	-	X	-	-	-	-	-
31 – 32	-	-	-	-	-	-	X	-

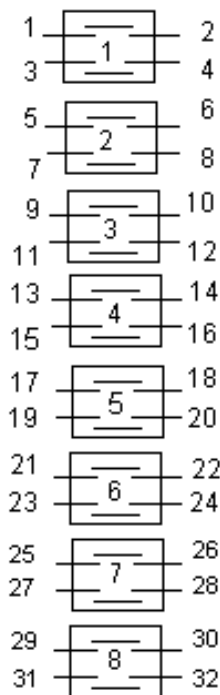


8044 Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	-	X	-	-	-	X
3 – 4	-	-	-	X	-	-
5 – 6	-	X	-	-	-	X
7 – 8	-	-	-	X	-	-
9 – 10	-	X	-	-	-	-
11 – 12	-	-	-	X	-	-
13 – 14	-	X	-	-	-	-
15 – 16	-	-	-	-	-	X
17 – 18	-	-	-	X	-	-
19 – 20	-	-	-	-	-	X
21 – 22	X	-	-	-	-	-
23 – 24	-	-	X	-	-	-
25 – 26	X	-	-	-	-	-
27 – 28	-	-	-	-	X	-
29 – 30	-	-	X	-	-	-
31 – 32	-	-	-	-	X	-

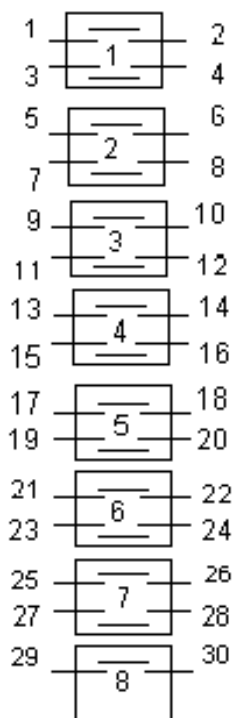


8045 Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 - 2	X	-	-	-	-
3 - 4	X	-	-	-	-
5 – 6	-	X	-	-	-
7 – 8	-	X	-	-	-
9 – 10	-	X	-	-	-
11 - 12	-	X	X	-	-
13 - 14	-	X	X	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	X	-	-
19 - 20	-	-	X	-	X
21 – 22	-	-	-	X	-
23 - 24	-	-	-	X	X
25 – 26	-	-	-	X	X
27 – 28	-	-	-	-	X
29 – 30	-	-	-	-	X

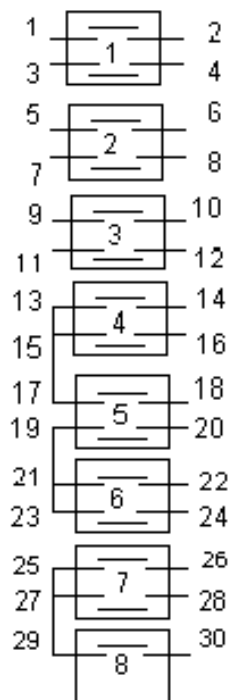


8046 Соединяемые контакты	Способ фиксации: А, С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	-	-	X
3 – 4	X	-	-
5 – 6	-	-	X
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	X	-	-
13 – 14	-	X	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	X	-
21 – 22	-	-	X
23 – 24	X	-	-
25 – 26	-	X	-
27 – 28	-	-	X
29 – 30	X	-	-

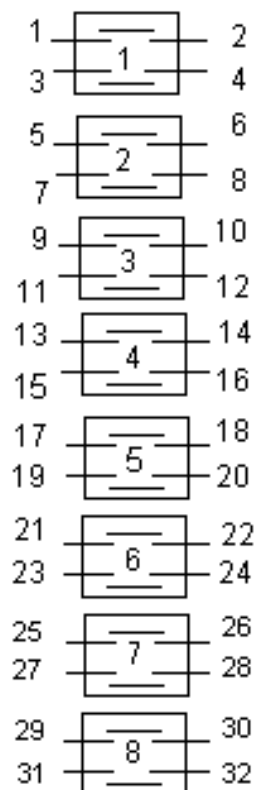


8047 Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	-	-	-	-	-
3 – 4	-	-	-	-	X	-
5 – 6	X	-	-	-	-	-
7 – 8	-	-	-	-	X	-
9 – 10	X	-	-	-	-	-
11 – 12	-	-	-	-	X	-
13 – 14	-	X	-	-	-	-
15 – 16	-	-	-	-	-	X
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	-	-	X
21 – 22	-	-	X	-	-	-
23 – 24	-	-	X	-	-	-
25 – 26	-	-	-	X	-	-
27 – 28	-	-	-	X	-	-
29 – 30	X	-	-	-	-	-
31 – 32	-	X	X	X	-	-

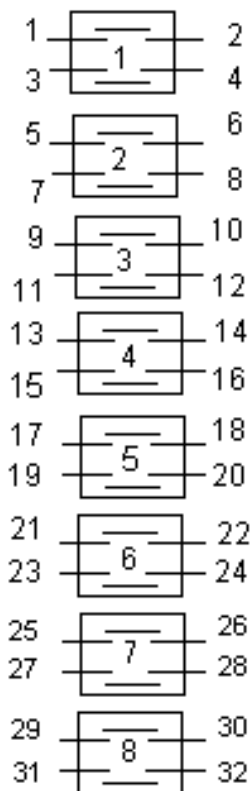


8048 Соединяемые контакты	Способ фиксации: И	
	Положение рукоятки	
	0°	+45°
1 – 2	-	X
3 – 4	X	-
5 – 6	-	X
7 – 8	X	-
9 – 10	-	X
11 – 12	X	-
13 – 14	-	X
15 – 16	X	-
17 – 18	-	X
19 – 20	X	-
21 – 22	-	X
23 – 24	X	-
25 – 26	-	X
27 – 28	X	-
29 – 30	-	X
31 – 32	X	-

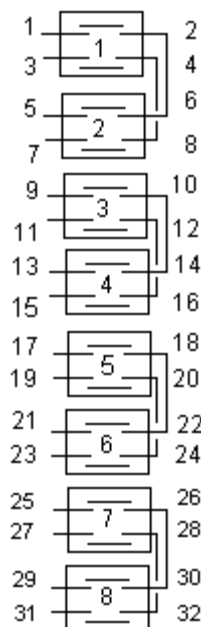


8049 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	-	X
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	X	-	-
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	X	-	-
17 – 18	-	-	X
19 – 20	-	-	X
21 – 22	X	-	-
23 – 24	X	-	-
25 – 26	-	-	X
27 – 28	-	-	X
29 – 30	X	-	-
31 – 32	X	-	-

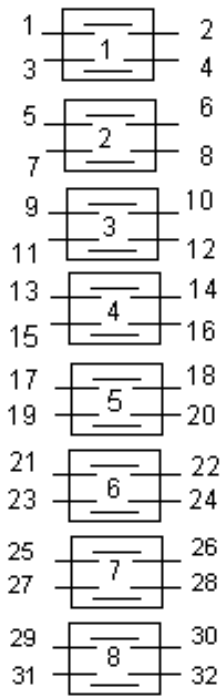

Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45 ⁰	0 ⁰	+45 ⁰
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	-	-	X
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	X	-	-
21 – 22	X	-	-
23 – 24	-	-	X
25 – 26	X	-	X
27 – 28	-	X	-
29 – 30	X	-	-
31 – 32	-	-	X

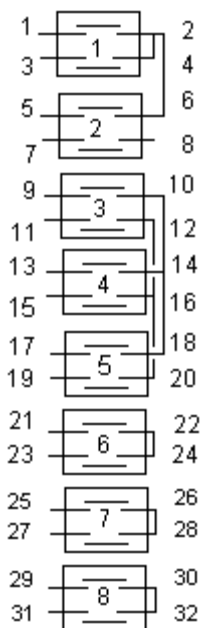

Соединяемые контакты	Способ фиксации: Х					
	Положение рукоятки					
	-90 ⁰	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰	+135 ⁰
1 – 2	X	-	-	X	-	-
3 – 4	-	X	-	-	X	-
5 – 6	-	-	X	-	-	X
7 – 8	-	-	-	-	-	-
9 – 10	-	X	-	-	X	-
11 – 12	-	X	-	-	X	-
13 – 14	X	-	-	X	-	-
15 – 16	X	-	-	X	-	-
17 – 18	-	-	X	-	-	X
19 – 20	-	-	X	-	-	X
21 – 22	X	X	-	-	-	X
23 – 24	-	-	X	X	X	-
25 – 26	X	X	-	-	-	X
27 – 28	-	-	X	X	X	-
29 – 30	X	X	-	-	-	X
31 – 32	-	-	X	X	X	-

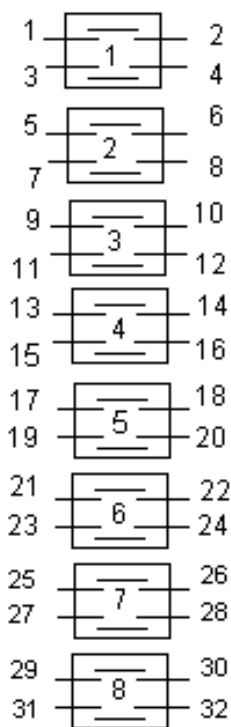

8052 Соединяемые контакты	Способ фиксации: У			
	Положение рукоятки			
	-45 ⁰	0 ⁰	+45 ⁰	+90 ⁰
1 – 2	-	-	-	X
3 – 4	-	-	-	X
5 – 6	-	-	-	X
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 - 14	-	X	-	-
15 - 16	-	X	-	-
17 - 18	-	-	X	-
19 - 20	-	-	X	-
21 – 22	-	X	-	X
23 - 24	-	X	-	X
25 - 26	-	X	X	-
27 - 28	-	X	X	-
29 - 30	-	X	X	-
31 - 32	-	X	X	-