




1001 Соединяемые контакты	Способ фиксации: Ж, С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	X	-	-
23 – 24	-	-	X
25 – 26	X	-	-
27 – 28	-	-	X
29 – 30	X	-	-
31 – 32	-	-	X
33 – 34	X	-	-
35 – 36	-	-	X
37 – 38	X	-	-
39 – 40	-	-	X

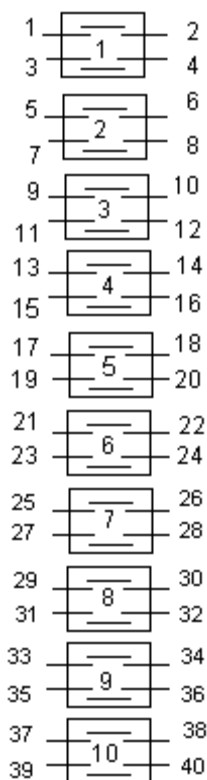


1002 Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	X
3 – 4	X	X	-
5 – 6	-	X	X
7 – 8	X	X	-
9 – 10	-	X	X
11 – 12	X	X	-
13 – 14	X	X	-
15 – 16	-	X	X
17 – 18	X	X	-
19 – 20	-	X	X
21 – 22	X	X	-
23 – 24	-	X	X
25 – 26	X	-	X
27 – 28	X	-	X
29 – 30	X	-	X
31 – 32	X	-	X
33 – 34	X	-	X
35 – 36	X	-	X
37 – 38	X	-	X
39 – 40	X	-	X

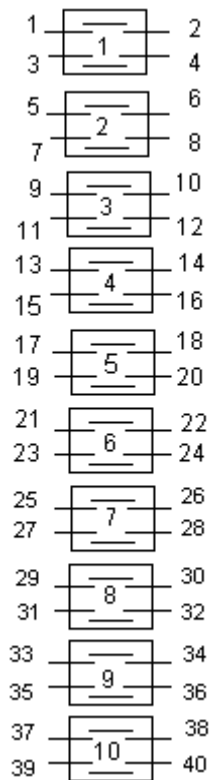


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	-
3 - 4	-	-	-	-	X
5 - 6	X	-	-	-	-
7 - 8	-	-	-	-	X
9 - 10	X	-	-	-	-
11 - 12	-	-	-	-	X
13 - 14	X	-	-	-	-
15 - 16	-	-	-	-	X
17 - 18	X	-	-	-	-
19 - 20	-	-	-	-	X
21 - 22	-	X	-	-	-
23 - 24	-	-	-	X	-
25 - 26	-	X	-	-	-
27 - 28	-	-	-	X	-
29 - 30	-	X	-	-	-
31 - 32	-	-	-	X	-
33 - 34	-	X	-	-	-
35 - 36	-	-	-	X	-
37 - 38	-	X	-	-	-
39 - 40	-	-	-	X	-

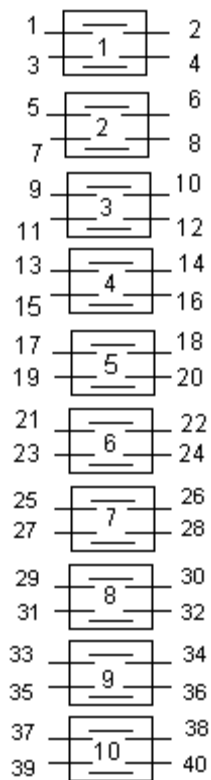


Соединяемые контакты	Способ фиксации: Е		
	Положение рукоятки		
	-90°	0°	+90°
1 - 2	X	-	-
3 - 4	-	X	X
5 - 6	X	-	-
7 - 8	-	X	X
9 - 10	X	-	-
11 - 12	-	X	X
13 - 14	X	-	-
15 - 16	-	X	X
17 - 18	X	-	-
19 - 20	-	X	X
21 - 22	X	-	-
23 - 24	-	X	X
25 - 26	-	-	X
27 - 28	-	X	-
29 - 30	-	-	X
31 - 32	-	X	-
33 - 34	-	X	-
35 - 36	-	X	-
37 - 38	-	X	-
39 - 40	-	X	-

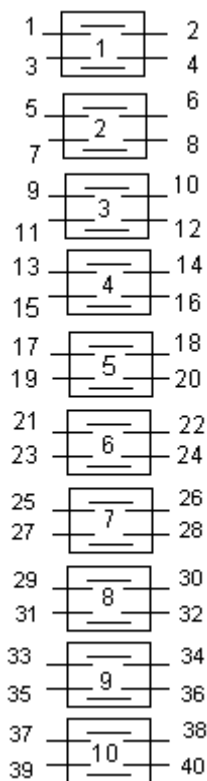


Соединяемые контакты	Способ фиксации: Φ			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	X	-	-	-
3 – 4	X	-	-	-
5 – 6	-	-	-	X
7 – 8	-	-	-	X
9 – 10	-	-	-	X
11 – 12	-	-	-	X
13 – 14	-	-	X	-
15 – 16	-	-	X	-
17 – 18	-	-	X	-
19 – 20	-	-	X	-
21 – 22	-	-	-	X
23 – 24	X	-	-	-
25 – 26	-	-	-	X
27 – 28	X	-	-	-
29 – 30	-	-	-	X
31 – 32	-	-	X	-
33 – 34	-	-	-	X
35 – 36	-	-	X	-
37 – 38	-	-	-	X
39 – 40	-	-	X	-

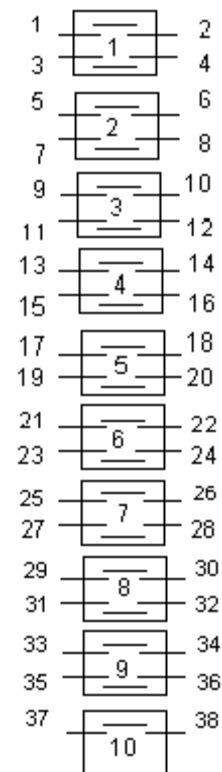


Соединяемые контакты	Способ фиксации: X					
	Положение рукоятки					
	-90°	-45°	0°	+45°	+90°	+135°
1 – 2	-	-	-	-	-	X
3 – 4	-	-	-	X	-	-
5 – 6	-	X	-	-	-	-
7 – 8	-	X	-	X	-	-
9 – 10	-	-	-	X	-	-
11 – 12	-	-	-	-	-	X
13 – 14	-	-	-	X	-	-
15 – 16	-	X	-	X	-	-
17 – 18	-	X	-	-	-	-
19 – 20	-	-	-	-	-	X
21 – 22	-	-	-	X	-	-
23 – 24	-	X	-	X	-	-
25 – 26	-	-	-	X	-	-
27 – 28	-	-	-	-	-	X
29 – 30	-	X	-	-	-	-
31 – 32	-	-	-	-	-	X
33 – 34	-	-	-	-	-	X
35 – 36	-	-	-	-	-	X
37 – 38	-	-	-	-	-	X

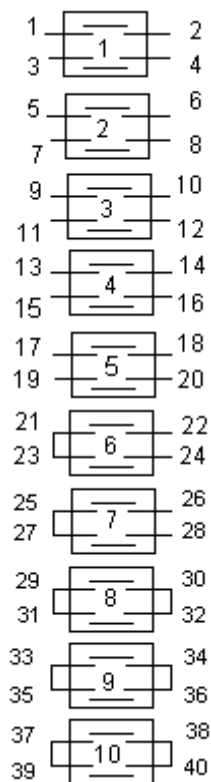


Соединяемые контакты	Способ фиксации: Ж	
	Положение рукоятки	
	-45°	+45°
1 – 2	X	-
3 – 4	X	-
5 – 6	X	-
7 – 8	X	-
9 – 10	X	-
11 – 12	X	-
13 – 14	X	-
15 – 16	X	-
17 – 18	X	-
19 – 20	-	X
21 – 22	-	X
23 – 24	X	-
25 – 26	-	X
27 – 28	X	-
29 – 30	-	X
31 – 32	-	X
33 – 34	X	-
35 – 36	X	-
37 – 38	X	-
39 – 40	X	-

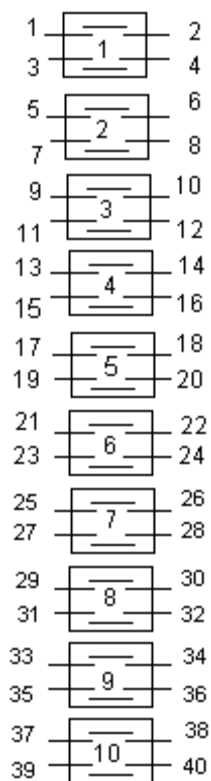


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	X	-	-	-
3 - 4	-	-	X	-	X
5 - 6	X	-	X	-	-
7 - 8	-	-	-	X	-
9 - 10	X	X	-	-	X
11 - 12	-	-	X	-	-
13 - 14	X	-	-	-	-
15 - 16	-	X	-	-	-
17 - 18	X	-	X	-	-
19 - 20	-	-	-	X	-
21 - 22	X	-	-	-	X
23 - 24	-	X	-	X	-
25 - 26	-	X	-	X	-
27 - 28	-	-	-	X	-
29 - 30	-	X	-	X	-
31 - 32	-	-	-	X	-
33 - 34	-	X	-	X	-
35 - 36	-	-	-	X	-
37 - 38	-	-	-	-	X
39 - 40	-	X	-	X	-

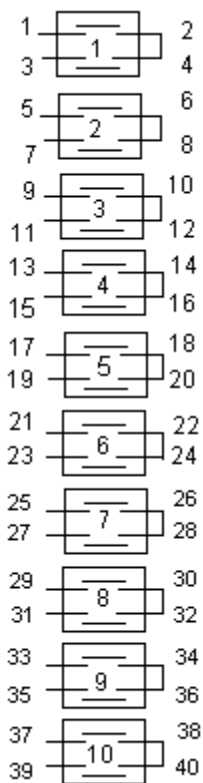


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	X
3 – 4	X	X	-
5 – 6	-	X	X
7 – 8	X	X	-
9 – 10	-	X	X
11 – 12	X	X	-
13 – 14	X	X	-
15 – 16	-	X	X
17 – 18	X	X	-
19 – 20	-	X	X
21 – 22	-	-	X
23 – 24	X	X	-
25 – 26	-	-	X
27 – 28	X	-	-
29 – 30	-	-	X
31 – 32	X	-	-
33 – 34	-	X	-
35 – 36	X	-	-
37 – 38	-	X	-
39 – 40	X	-	-

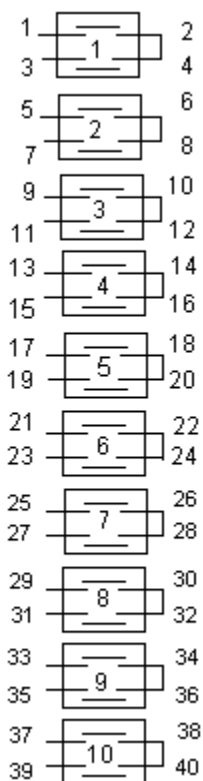


Соединяемые контакты	Способ фиксации: С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	-	X	X
3 – 4	X	X	-
5 – 6	-	X	X
7 – 8	X	X	-
9 – 10	-	X	X
11 – 12	X	X	-
13 – 14	-	X	-
15 – 16	-	X	-
17 – 18	-	X	X
19 – 20	X	-	-
21 – 22	-	X	X
23 – 24	X	-	-
25 – 26	-	X	X
27 – 28	X	-	-
29 – 30	-	X	X
31 – 32	X	-	-
33 – 34	-	X	-
35 – 36	X	-	-
37 – 38	-	X	-
39 – 40	X	-	-

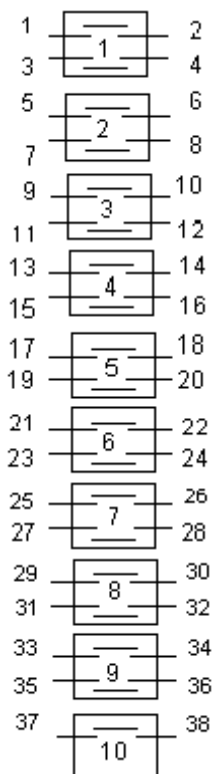


Соединяемые контакты	Способ фиксации: Л				
	Положение рукоятки				
	-90°	-45°	0°	+45°	+90°
1 - 2	X	-	-	-	-
3 - 4	-	-	X	-	-
5 - 6	-	-	-	-	X
7 - 8	-	-	X	-	-
9 - 10	-	-	-	-	X
11 - 12	-	-	-	-	X
13 - 14	X	-	-	-	-
15 - 16	-	-	X	-	-
17 - 18	-	-	-	-	X
19 - 20	-	-	X	-	-
21 - 22	-	-	-	-	X
23 - 24	-	-	-	-	X
25 - 26	X	-	-	-	-
27 - 28	-	-	X	-	-
29 - 30	-	-	-	-	X
31 - 32	-	-	X	-	-
33 - 34	-	-	-	-	X
35 - 36	-	-	-	-	X
37 - 38	X	-	X	-	X

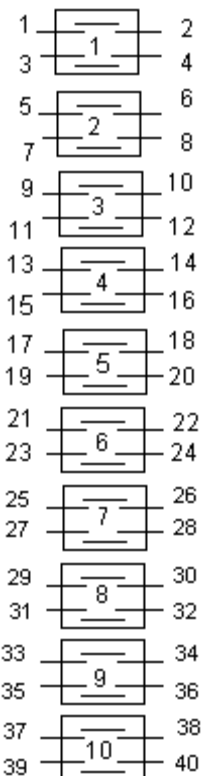


Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 - 2	-	-	-	-	X	-	-	-
3 - 4	-	-	-	-	X	-	-	-
5 - 6	-	-	-	-	-	X	-	-
7 - 8	-	-	-	-	-	X	-	-
9 - 10	-	-	-	-	-	-	X	-
11 - 12	-	-	-	-	-	-	X	-
13 - 14	-	-	-	-	-	-	-	X
15 - 16	-	-	-	-	-	-	-	X
17 - 18	-	-	-	-	-	-	-	X
19 - 20	-	-	-	-	-	-	-	X
21 - 22	X	-	-	-	-	-	-	-
23 - 24	X	-	-	-	-	-	-	-
25 - 26	X	-	-	-	-	-	-	-
27 - 28	X	-	-	-	-	-	-	-
29 - 30	-	X	-	-	-	-	-	-
31 - 32	-	X	-	-	-	-	-	-
33 - 34	-	X	-	-	-	-	-	-
35 - 36	-	X	-	-	-	-	-	-
37 - 38	-	X	-	-	-	-	-	-
39 - 40	-	X	-	-	-	-	-	-

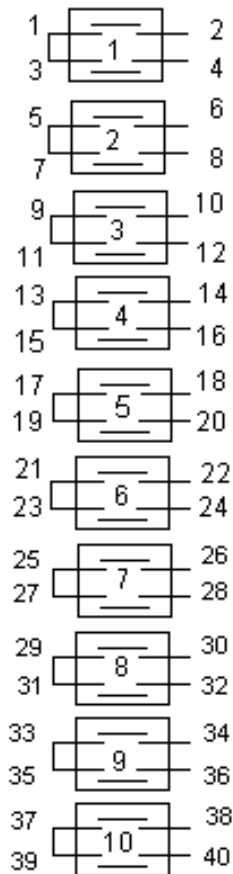


Соединяемые контакты	Способ фиксации: (Ж), С		
	Положение рукоятки		
	-45°	0°	+45°
1 – 2	X	-	-
3 – 4	-	-	X
5 – 6	X	-	-
7 – 8	-	-	X
9 – 10	X	-	-
11 – 12	-	-	X
13 – 14	X	-	-
15 – 16	-	-	X
17 – 18	X	-	-
19 – 20	-	-	X
21 – 22	X	-	-
23 – 24	-	-	X
25 – 26	X	-	-
27 – 28	-	-	X
29 – 30	X	-	-
31 – 32	-	-	X
33 – 34	X	-	-
35 – 36	-	-	X
37 – 38	X	-	-
39 – 40	-	-	X

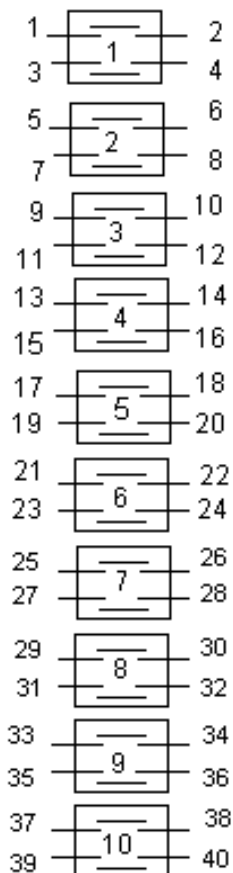

Соединяемые контакты	Способ фиксации: Н							
	Положение рукоятки							
	-135°	-90°	-45°	0°	+45°	+90°	+135°	+180°
1 – 2	-	-	X	X	-	-	-	-
3 – 4	-	X	X	-	-	-	-	-
5 – 6	-	X	X	-	-	-	-	-
7 – 8	-	-	-	X	-	-	-	-
9 – 10	-	X	X	X	-	-	-	-
11 – 12	-	X	X	-	-	X	-	-
13 – 14	-	-	-	-	X	X	-	-
15 – 16	-	-	-	-	X	X	-	-
17 – 18	-	-	-	-	-	-	X	-
19 – 20	-	-	-	-	-	X	-	-
21 – 22	-	-	-	-	X	-	-	-
23 – 24	-	-	-	X	-	-	-	-
25 – 26	X	-	-	-	-	-	-	-
27 – 28	-	-	X	X	-	-	-	-
29 – 30	-	-	-	-	-	X	X	-
31 – 32	-	-	X	X	-	-	X	-
33 – 34	-	-	-	X	-	-	-	-
35 – 36	-	-	X	-	-	X	-	-
37 – 38	-	-	-	X	-	-	-	-
39 – 40	-	-	-	-	-	-	X	-

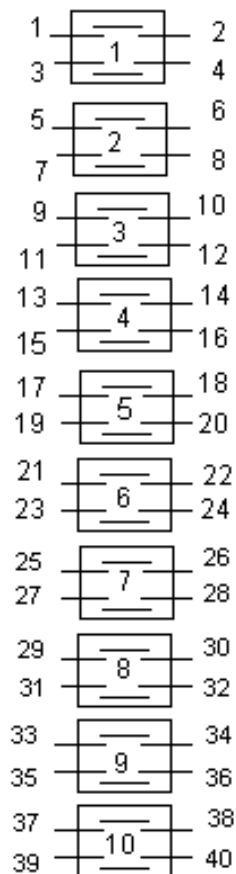

Соединяемые контакты	Способ фиксации: Ж	
	Положение рукоятки	
	-45°	+45°
1 – 2	-	X
3 – 4	-	X
5 – 6	-	X
7 – 8	-	X
9 – 10	-	X
11 – 12	-	X
13 – 14	-	X
15 – 16	-	X
17 – 18	-	X
19 – 20	-	X
21 – 22	-	X
23 – 24	-	X
25 – 26	-	X
27 – 28	-	X
29 – 30	-	X
31 – 32	-	X
33 – 34	-	X
35 – 36	-	X
37 – 38	-	X
39 – 40	-	X

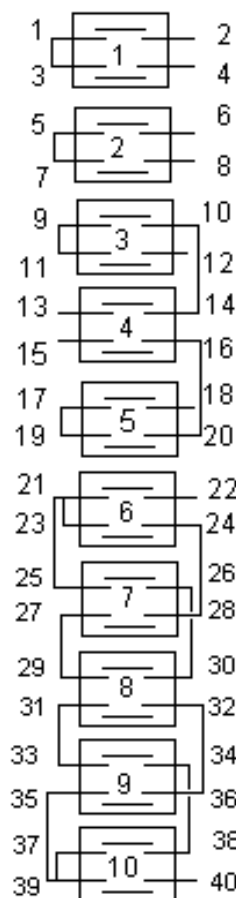

Соединяемые контакты	Способ фиксации: Ф			
	Положение рукоятки			
	-90°	-45°	0°	+45°
1 – 2	-	-	X	X
3 – 4	X	X	-	-
5 – 6	-	-	X	X
7 – 8	X	X	-	-
9 – 10	-	X	X	-
11 – 12	-	-	-	X
13 – 14	X	-	-	-
15 – 16	X	-	-	-
17 – 18	-	-	-	X
19 – 20	-	X	X	-
21 – 22	-	-	X	-
23 – 24	-	X	-	-
25 – 26	-	-	-	X
27 – 28	X	-	-	-
29 – 30	X	-	-	-
31 – 32	X	-	-	-
33 – 34	X	-	-	-
35 – 36	-	-	-	X
37 – 38	-	X	-	-
39 – 40	-	-	X	-

Стр.

10-08

АВКГ 1848

Изм.

Лист

№ докум.

Подпись

Дата